


Fault Code: 232

Coolant Pressure Sensor Circuit - Shorted Low

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 232 PID(P): SPN: FMI: Lamp: Warning SRT:	Engine coolant pressure sensor circuit - shorted low.	No engine protection for coolant pressure.

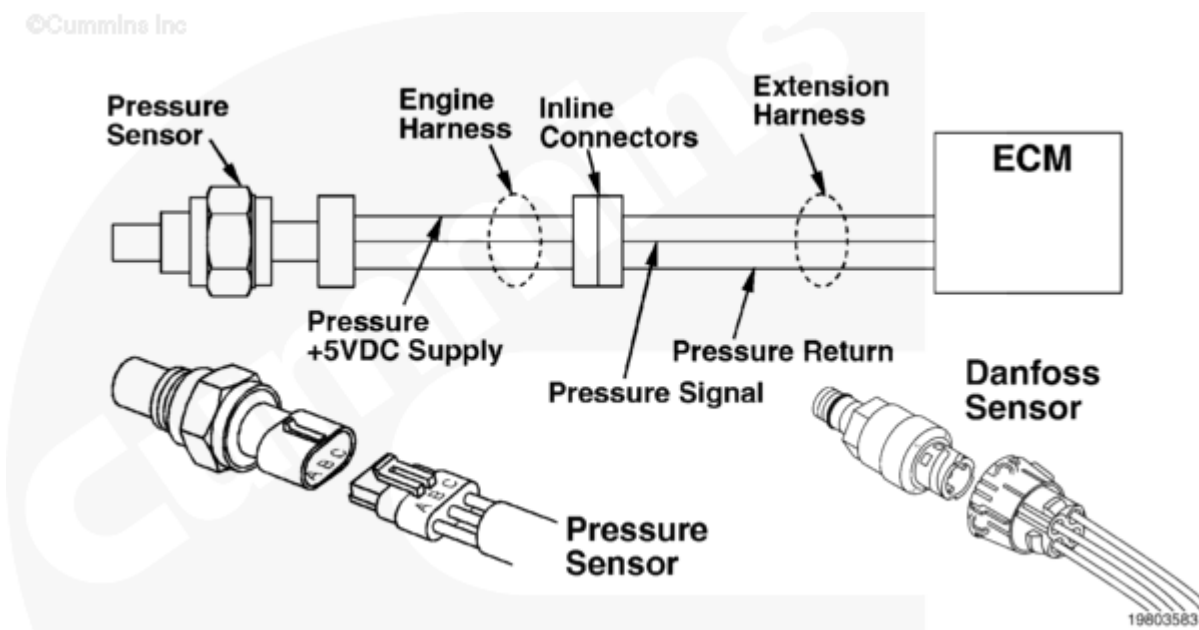

Coolant Pressure Sensor Circuit

Circuit Description

The coolant pressure sensor monitors coolant pressure and passes information to the engine control module (ECM). Low voltage will trip Fault Code 232 and can be caused by shorts in the supply, signal, or return wires, an open in the return wires, or a failed sensor.

Component Location

Use the following procedure for component location. Refer to Procedure 100-002 in Section E (/qs3/pubsys2/xml/en/procedures/01/01-100-002.html).

Shoptalk

Confirm that the radiator cap is installed correctly.

Check the radiator cap for proper operation.

Refer to specific engine wiring diagram for the output voltage of the pressure sensor.

Note: Some engine models will use the Metri-Pack™ type connector on this pressure sensor, and some will use the Danfoss™ type connector. The Metri-Pack™ connector pin designators are alpha and the Danfoss™ connector pin designators are numeric. The steps depicted in this fault code show the Metri-Pack™ type connector with alpha pin callouts. Reference specific engine wiring diagrams to determine the correct pin designators for the type of connector.

Refer to Troubleshooting Fault Code t05-232. (/qs3/pubsys2/xml/en/procedures/01/01-t05-232.html)

Last Modified: 08-May-2012
