


Fault Code: 318

Fuel Supply Pump Actuator - Mechanically Stuck

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 318 PID(P): SPN: FMI: Lamp: Warning SRT:	Fuel supply pump actuator - mechanically stuck. The error between the estimated fuel pump pressure and the desired fuel pump pressure is outside the allowable limits.	No action is taken by the ECM. Possible loss of performance.

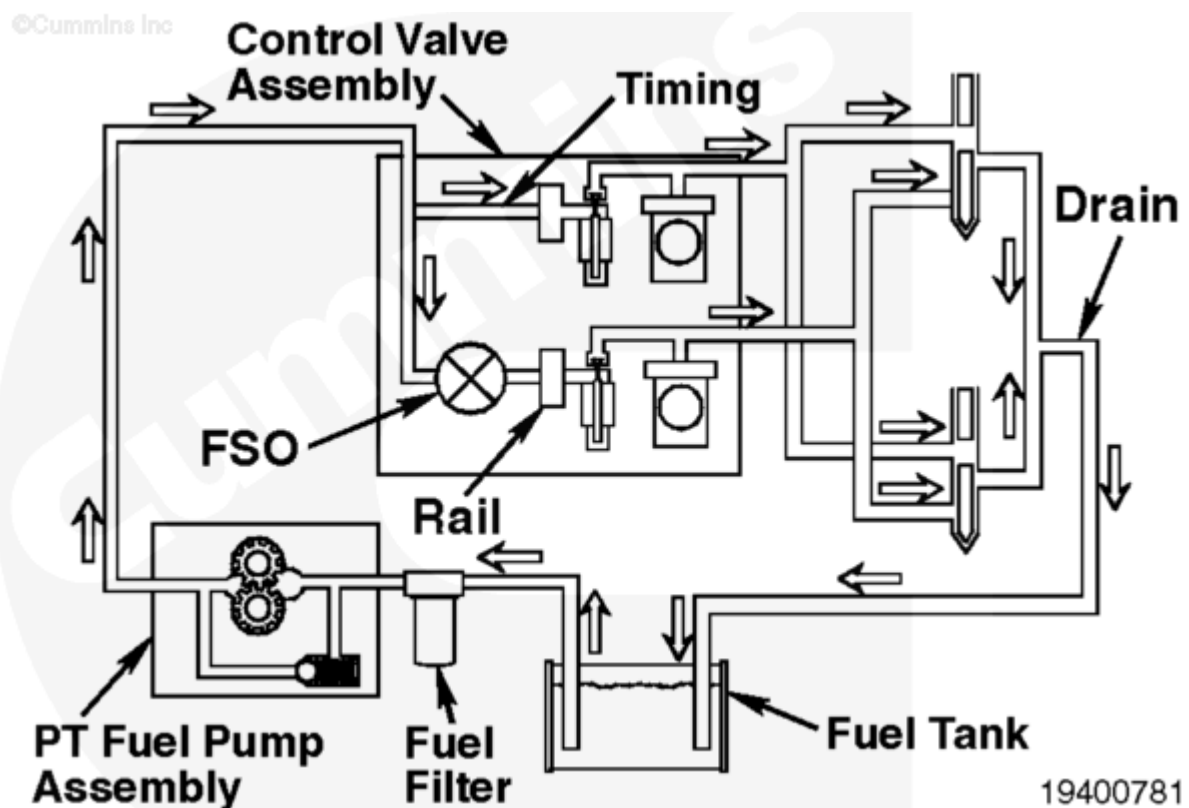

Fuel System Flow Schematic

Circuit Description

The ECM uses the fuel pump pressure signal and engine speed to estimate the actual fueling the engine is receiving, and constantly compares this value to the desired fueling for the given speed and load. When there is too large of an error in these values for too long of a time, Fault Code 318 is logged.

Component Location

The fuel pump actuator is on the fuel pump, just below the fuel pressure sensor.

Shoptalk

This fault is a check on the ECM's control of the fuel pump actuator and subsequent fuel flow. If the desired fueling can **not** be met by commanding more current to the actuator or if the desired fueling is being exceeded and can **not** be reduced by limiting the amount of current to the actuator, then Fault Code 318 is logged. Fault Code 318 is **not** logged if the coolant temperature is below 0°C [32°F].

- Make sure that the correct calibration loaded into the ECM. For example, if a QSK45 calibration is loaded into a QSK60 ECM, this fault code will be activated.
- Check for air in the fuel system.
- Check for high fuel inlet restriction (plugged fuel filter, etc.)

Refer to Troubleshooting Fault Code t05-318 (</qs3/pubsys2/xml/en/procedures/01/01-t05-318.html>)