


Fault Code: 423

Fuel Timing Pressure or Timing Actuator Stuck

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 423 PID(P): SPN: FMI: Lamp: Warning SRT:	Fuel timing pressure or timing actuator stuck. Timing pressure sensor in-range error detected. Voltage signal indicates that the timing pressure sensor signal can possibly not be accurate.	No action taken by the ECM. Possible loss of performance.

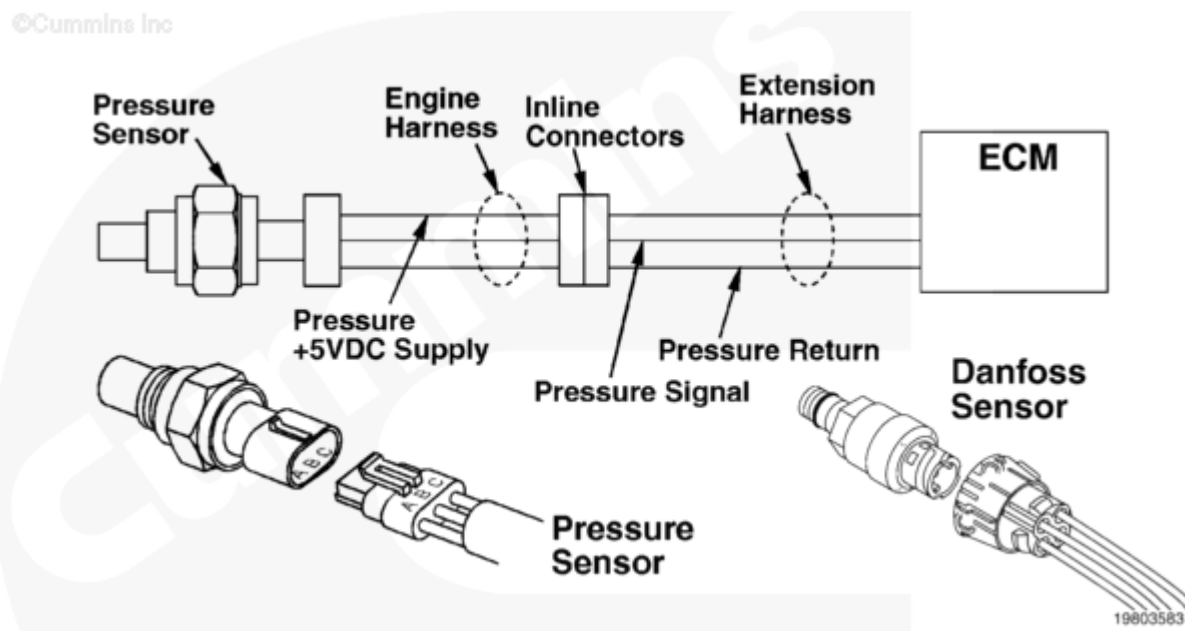

Timing Rail Pressure Sensor Circuit

Circuit Description

The timing rail pressure sensor provides the timing rail pressure signal to the electronic control module (ECM), through the engine harness. The ECM uses the timing rail pressure signal to monitor the timing fuel pressure going to the injector's timing chamber from the control valve body.

Component Location

The fuel timing pressure sensor is located on the right, towards the top of the ECVA. Across from the timing rail actuator.

Shoptalk

Refer to specific engine wiring diagram for the output voltage of the pressure sensor.

Note: Some engine models will use the Metri-Pack type connector on this pressure sensor, and some will use the Danfoss™ type connector. The Metri-Pack connector pin designators are alpha and the Danfoss™ connector pin designators are numeric. The steps depicted in this fault code show the Metri-Pack type connector with alpha pin callouts. Refer to specific engine wiring diagrams to determine the correct pin designators for the type of connector.

Refer to Troubleshooting Fault Code t05-423 (</qs3/pubsys2/xml/en/procedures/01/01-t05-423.html>)

Last Modified: 09-Jun-2023
