


Fault Code: 581

Fuel Supply Pressure Sensor Circuit - Shorted High

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 581 PID(P): SPN: FMI: Lamp: Warning SRT:	Fuel supply pressure sensor circuit - shorted high.	No action taken by the ECM. Possible loss of performance.

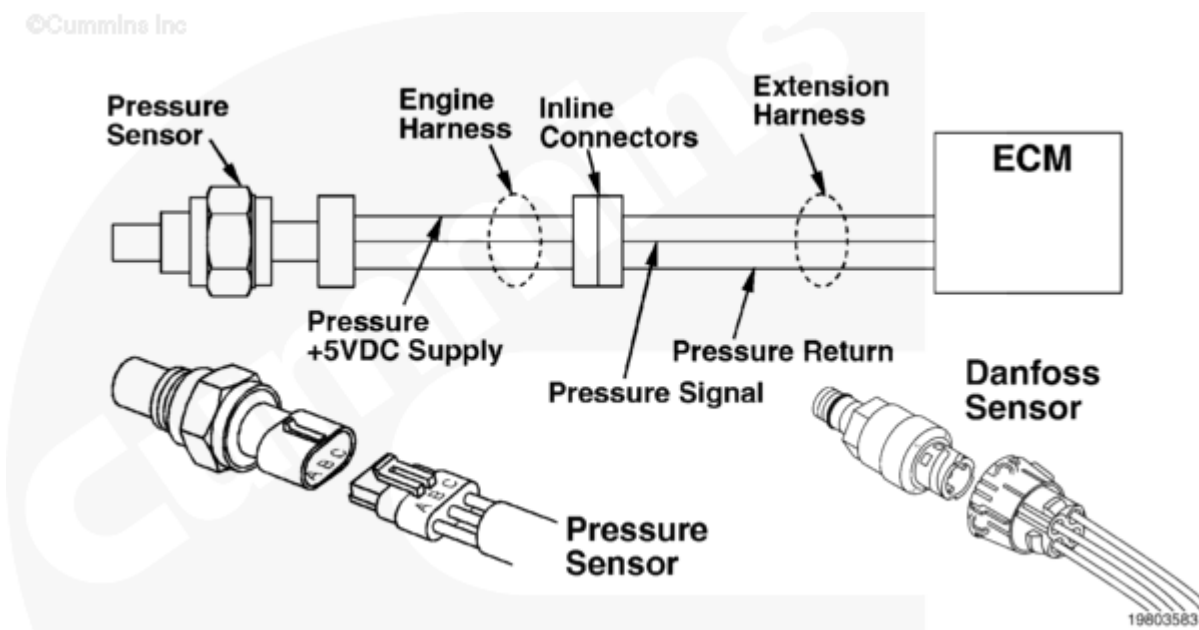

Fuel Supply Pressure Sensor Circuit

Circuit Description

The fuel supply pressure sensor provides the fuel pressure supply signal to the electronic control module (ECM). This fault indicates that the signal pin on the ECM has been shorted to at least 5 VDC.

Component Location

Refer to the Engine Diagrams. 100-002 (</qs3/pubsys2/xml/en/procedures/01/01-100-002.html>) for the component location.

Shoptalk

Refer to specific engine wiring diagram for the output voltage of the pressure sensor.

Note: Some engine models will use the Metri-Pack type connector on this pressure sensor, and some will use the Danfoss™ type connector. The Metri-Pack connector pin designators are alpha and the Danfoss™ connector pin designators are numeric. The steps depicted in this fault code show the Metri-Pack type connector with alpha pin callouts. Refer to specific engine wiring diagrams to determine the correct pin designators for the type of connector.

Refer to Troubleshooting Fault Code t05-581 (</qs3/pubsys2/xml/en/procedures/01/01-t05-581.html>)

Last Modified: 29-Jul-2010
