


Fault Code: 121

Engine Speed/Position Sensor Circuit - Abnormal Rate of Change

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 121 PID(P): P190 SPN: 190 FMI: 10 Lamp: Amber SRT:	Engine speed/position sensor circuit lost one of two signals from the magnetic pickup sensor - abnormal rate of change. Both the primary and secondary speed sensors are hall effect sensors.	Loss of backup engine speed sensor. No action by the ECM is taken.

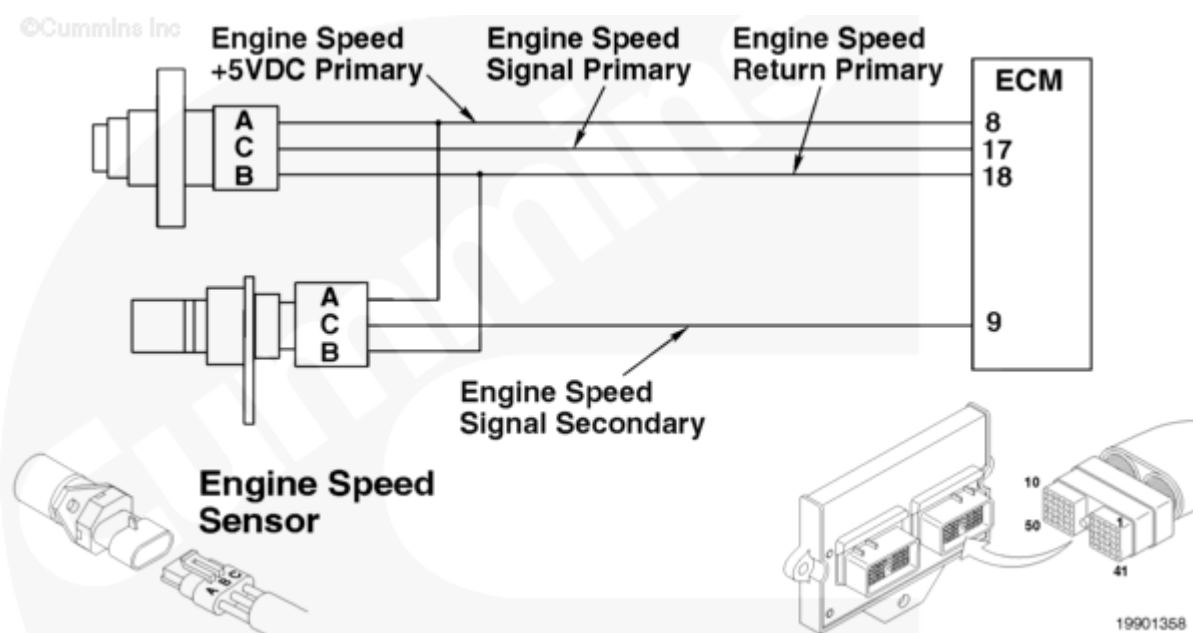

Engine Speed/Position Sensor Circuit

Circuit Description

The secondary engine speed sensor provides a backup engine speed signal to the electronic control module (ECM) through the engine harness. The sensor generates a signal by sensing the movement of the target teeth of the flywheel.

Component Location

The secondary engine speed sensor is located in the flywheel housing.

Shoptalk

The engine speed sensor provides the main engine speed signal to the ECM through the engine harness. The engine speed signal is generated when the engine speed sensor detects teeth on the ring gear. The ECM determines the engine speed by counting the number of voltage switches for a given period of time.

Refer to Troubleshooting Fault Code t05-121 (</qs3/pubsys2/xml/en/procedures/07/07-t05-121.html>)

Last Modified: 18-Dec-2012
