


Fault Code: 122

Intake Manifold Pressure Sensor Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 122 PID(P): P102 SPN: 102 FMI: 3 Lamp: Amber SRT:	Intake Manifold Pressure Sensor Circuit - Voltage Above Normal or Shorted to High Source. High signal voltage detected at the intake manifold pressure circuit.	Derate dependant on calibration. Possible black smoke during acceleration.

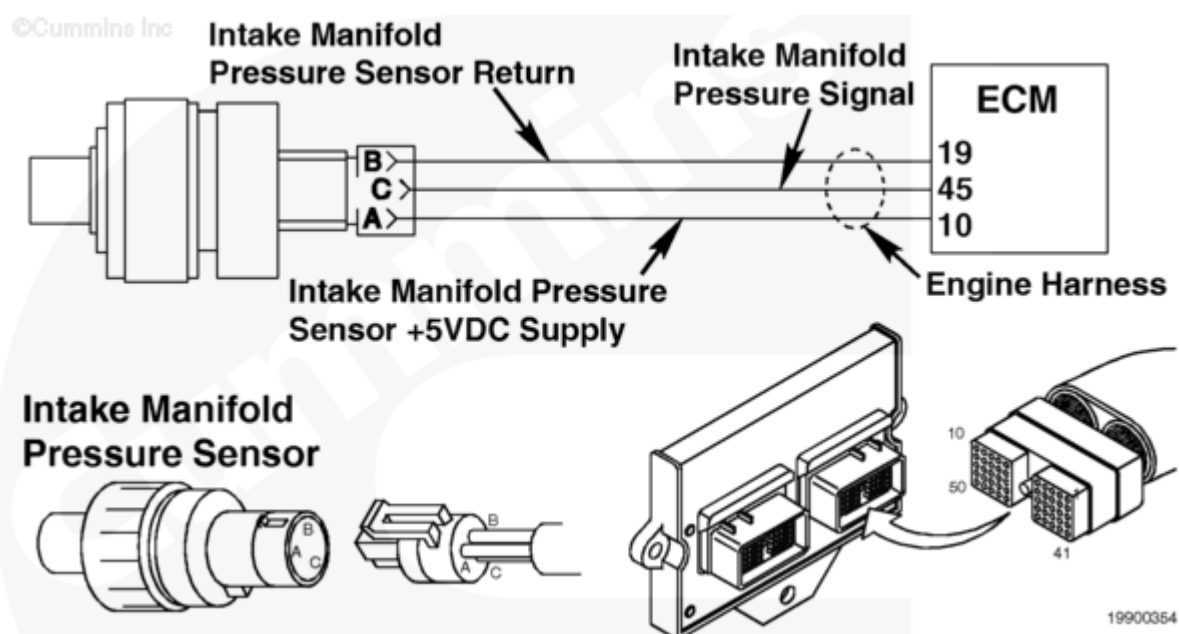

Intake Manifold Pressure Sensor Circuit

Circuit Description

The intake manifold pressure sensor monitors boost pressure and passes information to the electronic control module (ECM) through the intake manifold pressure signal pin of the engine harness.

Component Location

Reference Section E for a detailed component location view. There is one intake manifold pressure sensor on the 480C E engine. It is located next to the air intake heater, behind the ECM.

Shoptalk

- The intake manifold pressure sensor measures gauge pressure. Confirm the sensor is reading properly by comparing the reading seen in the ECM with a reading taken with a mechanical gauge. The sensor should read -38 to 38 mm Hg [-1.5 to 1.5 in Hg] using INSITE™, with the keyswitch turned to the ON position, but the engine **not** running.
- Determine if the engine is being overfueled.
- Confirm the correct intake manifold pressure sensor part number is being used.
- Confirm the correct turbocharger is being used.
- If it is suspected that cold intake air can be the cause of the high intake manifold pressure, test the engine while feeding it warm intake air.
- Inspect the intake manifold pressure sensor circuit for signs of tampering. Remove any extra wires from the circuit.

Refer to Troubleshooting Fault Code t05-122 (</qs3/pubsys2/xml/en/procedures/07/07-t05-122.html>)