


Fault Code: 123

Intake Manifold Pressure Sensor Circuit - Voltage Below Normal or Shorted to Low Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 123 PID(P): P102 SPN: 102 FMI: 4 Lamp: Amber SRT:	Intake Manifold Pressure Sensor Circuit - Voltage Below Normal or Shorted to Low Source. Low signal voltage detected at the intake manifold pressure circuit.	Derate dependant on calibration.

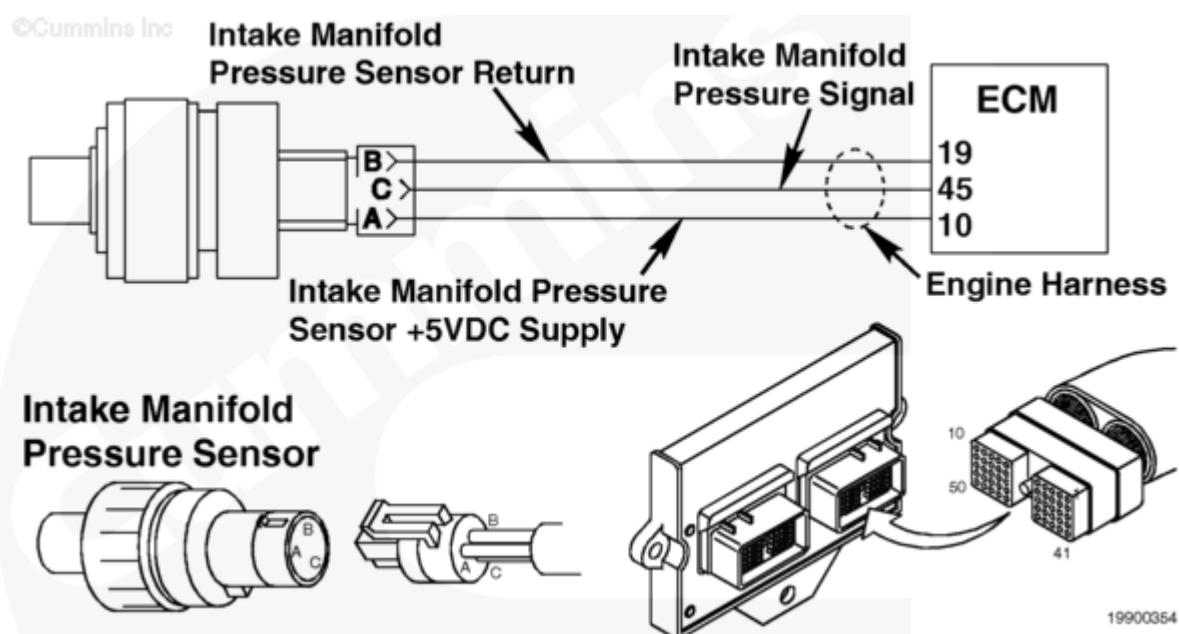

Intake Manifold Pressure Sensor Circuit

Circuit Description

The intake manifold pressure sensor monitors boost pressure and passes information to the electronic control module (ECM) through the intake manifold pressure signal pin of the engine harness.

Component Location

Reference Section E for a detailed component location view. There is one intake manifold pressure sensor on the 480C E engine. It is located next to the air intake heater, behind the ECM.

Shoptalk

- The intake manifold pressure sensor measures gauge pressure. Confirm the sensor is reading properly by comparing the reading seen in the ECM with a reading taken with a mechanical gauge. The sensor should read -38 to 38 mm Hg [-1.5 to 1.5 in Hg] using INSITE™, with the keyswitch turned to the ON position, but the engine **not** running.
- Check for high restriction in the intake manifold due to clogged air filters or a shutdown device in the manifold (if the vessel is equipped with one). Do **not** remove this device. If the engine is operated in a flammable atmosphere, the device is an essential safety feature.
- Make sure the turbocharger is working correctly. Check for a positive intake manifold pressure.

Refer to Troubleshooting Fault Code t05-123 (/qs3/pubsys2/xml/en/procedures/07/07-t05-123.html)