


Fault Code: 132

Throttle Position Signal Circuit - Low Voltage

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 132 PID(P): P091 SPN: 91 FMI: 3 Lamp: Red SRT:	Low voltage detected at the throttle position signal circuit.	Severe derate (power and speed). Limp home power only .

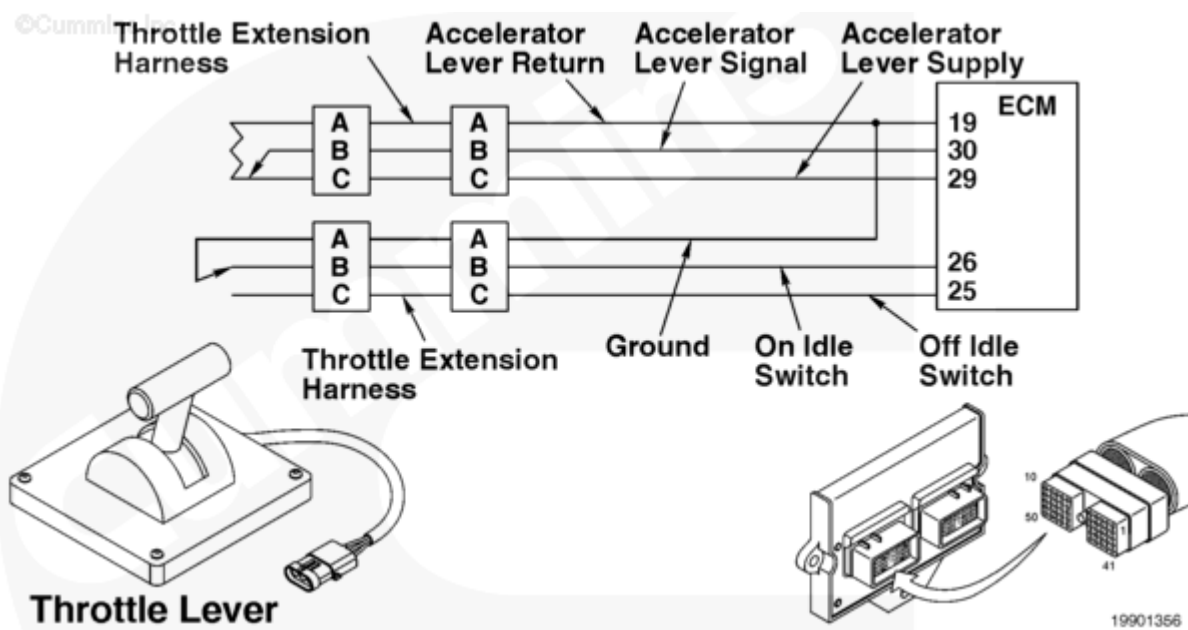

Throttle Position Signal Circuit

Circuit Description

The accelerator pedal/lever provides the driver's accelerator command to the electronic control module (ECM) through the marine OEM harness and the throttle extension harness. The ECM uses this signal to determine the fueling command for the P7100 fuel pump rack.

Component Location

Reference Section E for a detailed component location view. The accelerator pedal/lever location varies with each OEM.

Shoptalk

The accelerator pedal/lever position sensor is a potentiometer. The resistance specifications of the accelerator pedal/lever position sensor are as follows:

- Between supply and return = 2000 to 3000 ohms
- Between supply and signal:Released = 1500 to 3000 ohmsDepressed = 200 to 1500 ohms

If the accelerator pedal/lever or accelerator pedal/lever position sensor is changed, or after a calibration download, cycle the accelerator pedal/lever (turn keyswitch ON) through its complete travel three times. This procedure calibrates the new accelerator pedal/lever with the ECM.

Refer to Troubleshooting Fault Code t05-132 (</qs3/pubsys2/xml/en/procedures/07/07-t05-132.html>)

Last Modified: 18-Dec-2012
