


Fault Code: 497

Multiple Unit Synchronization Switch Circuit - Data Erratic, Intermittent, or Incorrect

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 497 PID(P): S114 SPN: 1377 FMI: 2 Lamp: Amber SRT:	Multiple unit synchronization switch circuit - data erratic, intermittent, or incorrect.	Engines will not be able to be controlled with one throttle input. The secondary engine must be controlled separately via its throttle input.

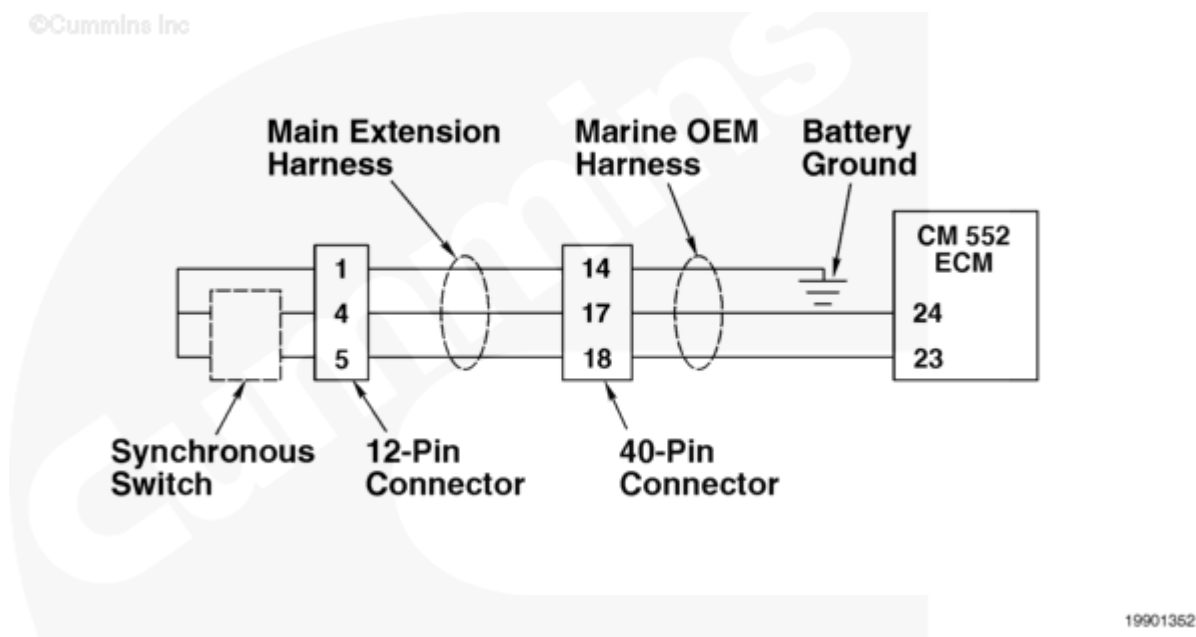

Multiple Unit Synchronization Switch Circuit

Circuit Description

The multiple unit synchronization circuit uses a complimentary switch to provide two opposite signals into the electronic control module (ECM). A double-pole, double-throw switch is used to activate synchronization mode on both engines.

Component Location

The multiple unit synchronization switch is mounted on the engine switch control panel. Reference the OEM manual for the specific location.

Shoptalk

The multiple unit synchronization switch is used to activate the engine synchronization function. The ECM expects to see the engine synchronization on/off and engine synchronization on/off complimentary switch toggle state once the feature is activated. Typical fail modes which can generate this fault are:

- Wires are dislodged from the rear of the switch.
- Intermittent connections are in the signal path.
- A switch has failed.
- Contaminated connections at the synchronization switch or in the circuit path.
- This fault can occur when a “C-Cruise” enabled ECM calibration is improperly loaded in an engine that is not intended to use multiple unit synchronization switch and does not have a synchronization switch installed. In this situation, realibrating the ECM with the correct non “C-Cruise” calibration will eliminate the fault.

Refer to Troubleshooting Fault Code t05-497 (</qs3/pubsys2/xml/en/procedures/07/07-t05-497.html>)