


## Fault Code: 1542

### Auxiliary Pressure Sensor Input 1 Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version

#### Overview

| Codes                                                                                | Reason                                                                                                                                                                                         | Effect               |
|--------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|
| Fault Code: 1542<br><br>PID(P): P137<br>SPN: 1387<br>FMI: 3/3<br>Lamp: Amber<br>SRT: | Auxiliary Pressure Sensor Input 1 Circuit - Voltage Above Normal or Shorted to High Source. High signal voltage detected at the original equipment manufacturer (OEM) pressure sensor circuit. | None on performance. |

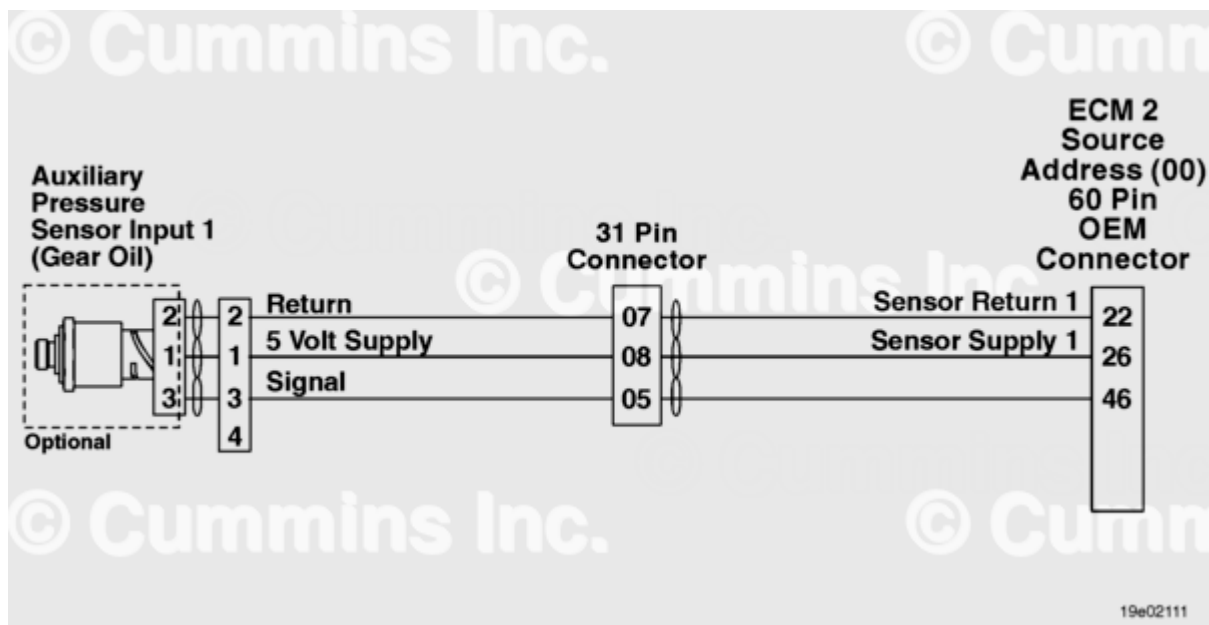

QSK60 CM2150 Industrial - Auxiliary Pressure Sensor Input 1 Circuit

#### Circuit Description

The OEM has the option of wiring an auxiliary pressure sensor input to the engine control module (ECM). Refer to the OEM service manual for information about the auxiliary pressure sensor.

## Component Location

The OEM pressure sensor input will vary depending on application. Refer to the OEM service manual for sensor location.

## Conditions For Running The Diagnostics

This diagnostic runs continuously when the keyswitch is in the ON position.

## Conditions For Setting The Fault Codes

The ECM detected the OEM pressure signal circuit was out of range high.

## Action Taken When The Fault Code Is Active

- The ECM illuminates the white MAINTENANCE lamp or flashes the amber CHECK ENGINE lamp, indicating a maintenance condition, immediately after the diagnostic runs and fails.

## Conditions For Clearing The Fault Code

- To validate the repair, perform a key cycle, and leave the key in the ON position for 1 minute.
- The fault code status displayed by INSITE™ electronic service tool will change to INACTIVE immediately after the diagnostic runs and passes.
- The ECM will turn off the flashing amber CHECK ENGINE lamp / MAINTENANCE lamp immediately after the diagnostic runs and passes.
- The Reset All Faults command in INSITE™ electronic service tool can be used to clear active and inactive faults.

## Shoptalk

Possible causes of this fault code include:

- Open return circuit in the harness, connectors, or sensor
- Signal circuit shorted to sensor supply or battery voltage.

Refer to Troubleshooting Fault Code 1542. (</qs3/pubsys2/xml/en/procedures/122/122-t05-1542.html>)