


Fault Code: 1852

Water in Fuel Indicator - Data Valid But Above Normal Operating Range - Moderately Severe Level


 Printable Version

Overview


Codes	Reason	Effect
Fault Code: 1852 PID(P): SPN: 97 FMI: 16 Lamp: Amber SRT:	Water In Fuel Indicator - Data Valid But Above Normal Operating Range - Moderately Severe Level. Water has been detected in the fuel filter.	Possible white smoke, loss of power, or hard starting. Engine derate will occur on Marine engines if optional engine protection feature is enabled.

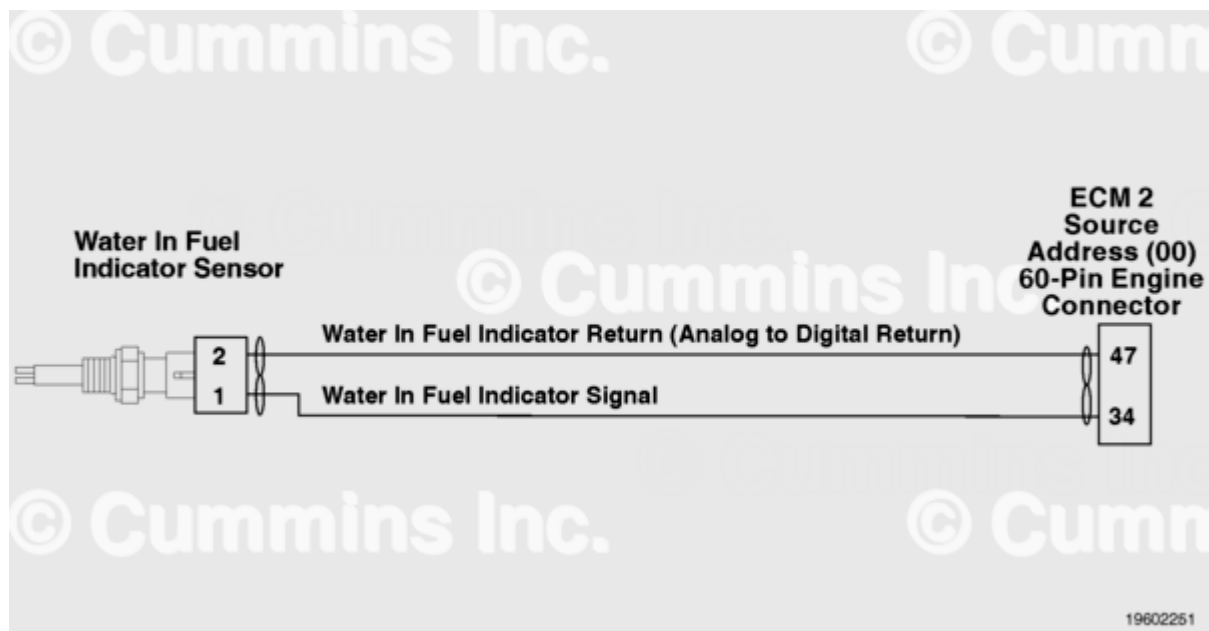


QSK38 CM2150 Industrial/QSK38 CM2150 Marine with C Command™ Panel System - Water in Fuel Indicator Sensor Circuit

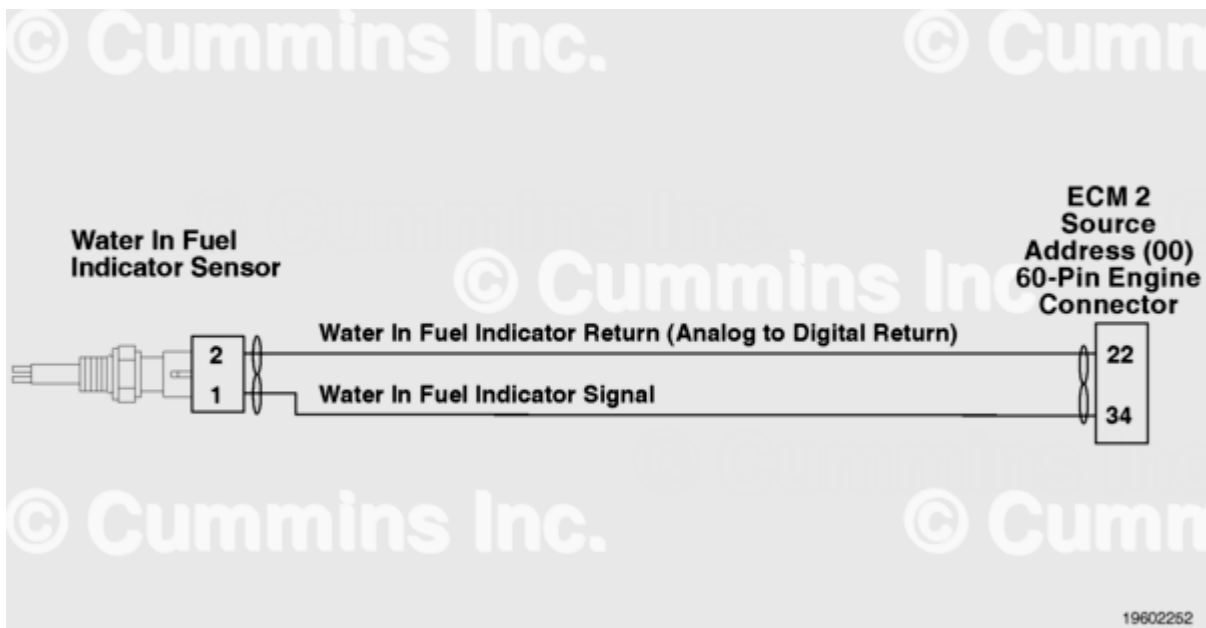


QSK38 CM2150 Marine with C Command Elite™ and C Command Elite Plus™ Panel System - Water in Fuel Indicator Sensor Circuit

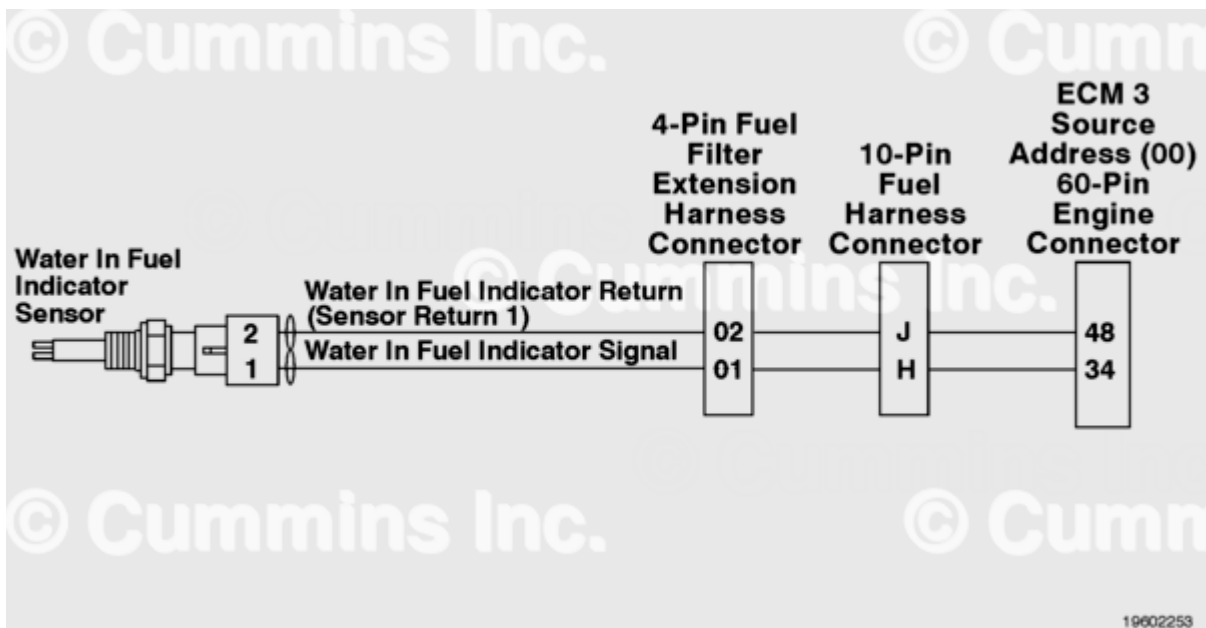


QSK50 CM2150 Industrial - Water in Fuel Indicator Sensor Circuit

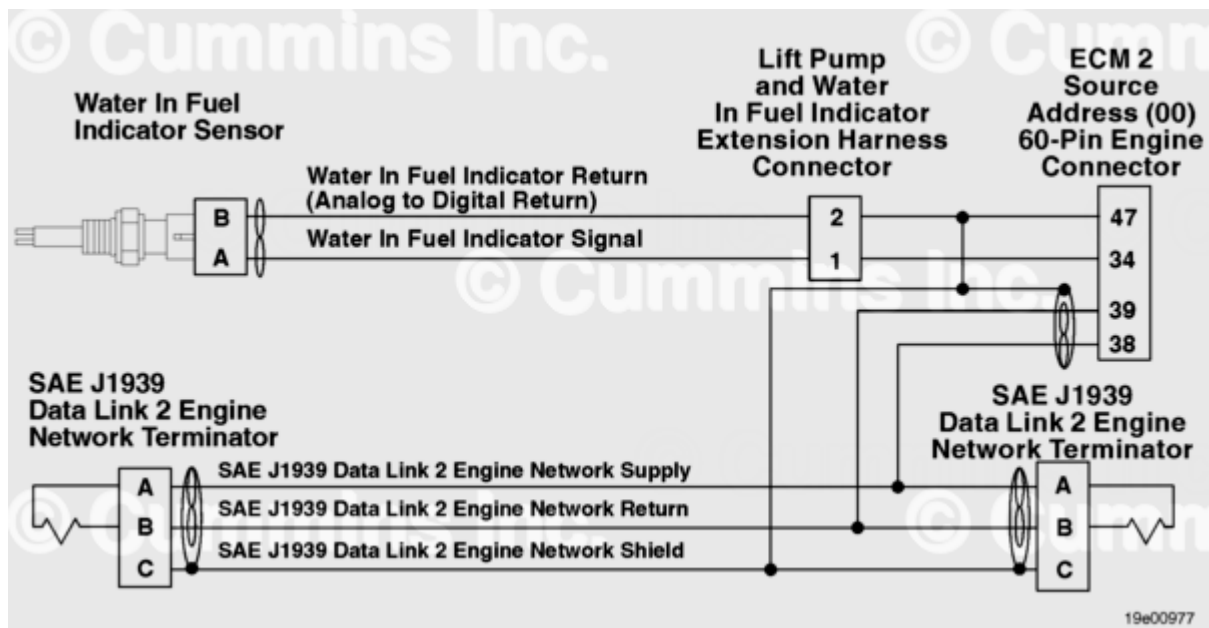


QSK38 CM2150 Power Generation and QSK38 CM2150 Power Generation (Military Application) - Water in Fuel Indicator Sensor Circuit

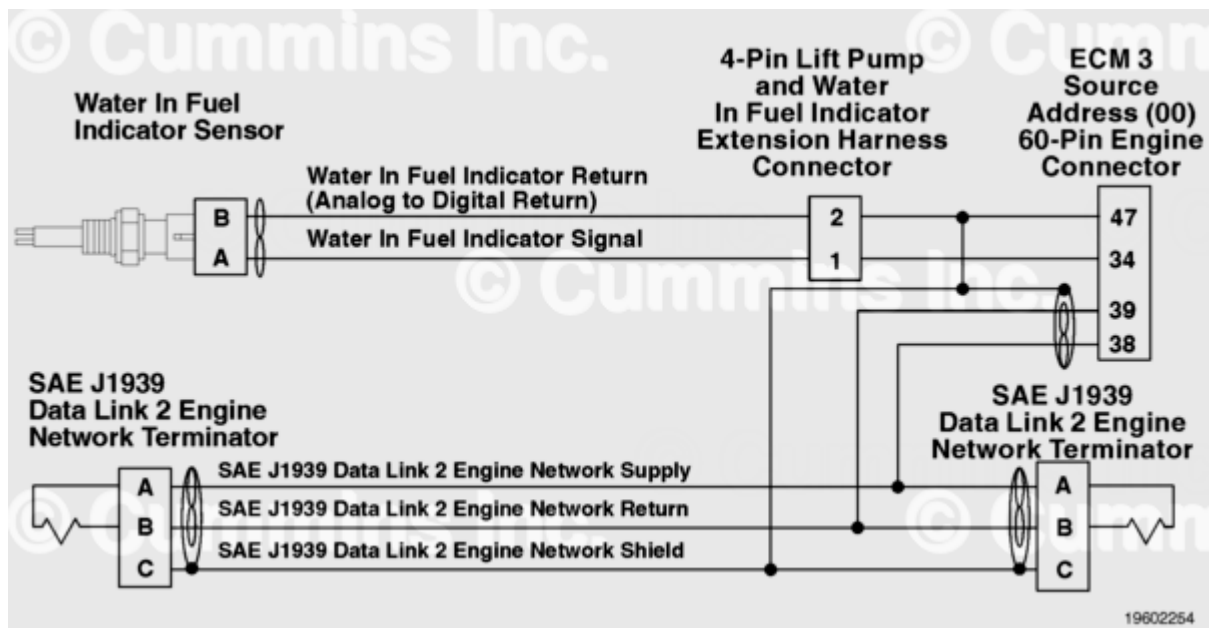

QSK50 CM2150 Power Generation with Advanced Engine Monitoring/QSK50 CM2150 Power Generation without Advanced Engine Monitoring/QSK60 CM2150 Power Generation - Water in Fuel Indicator Sensor Circuit

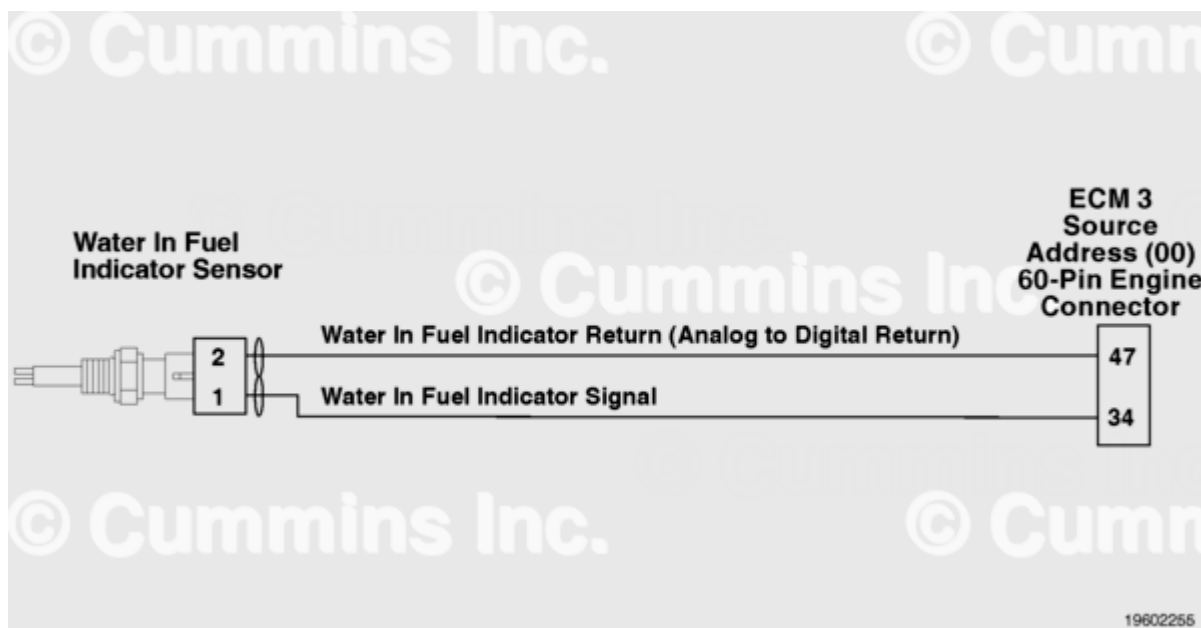

QSK50 and QSK60 CM2150 Marine/QSK60 CM2150 Drill Rig - Water in Fuel Indicator Sensor Circuit

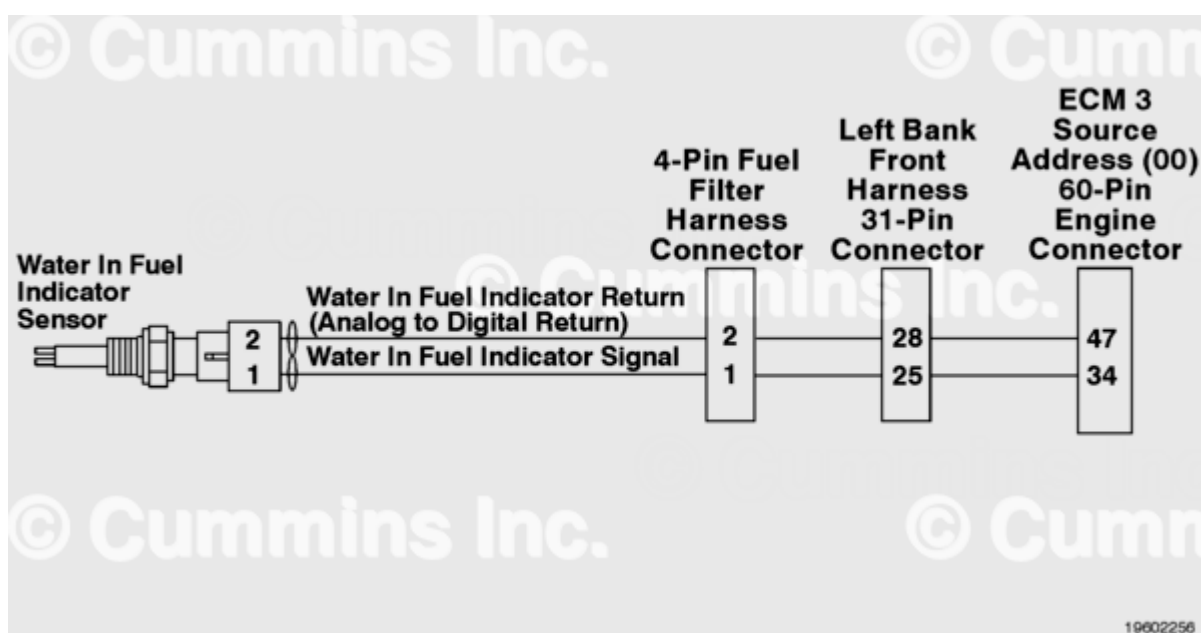

QSK60 CM2150 Industrial - Water in Fuel Indicator Sensor Circuit

Circuit Description

The water in fuel indicator sensor is attached to the first stage fuel filter. The water in fuel indicator sensor sends a signal to the engine control module (ECM) when a set volume of water has accumulated in the fuel filter. The water in fuel indicator sensor circuit contains two wires; a water in fuel indicator return (sensor return 1) ground wire and a water in fuel indicator signal wire.

Component Location

The water in fuel indicator sensor is integrated into the first stage fuel filter housing which is mounted off-engine. See equipment manufacturer service information.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the keyswitch is in the ON position.

Conditions For Setting The Fault Codes

The ECM detected water in the fuel filter was above the sensor level.

Action Taken When The Fault Code Is Active

- The ECM illuminates the amber CHECK ENGINE lamp immediately when the diagnostic runs and fails.
- On Marine Propulsion engines, if the optional engine protection feature has been enabled, a torque derate will occur.

Conditions For Clearing The Fault Code

- To validate the repair, perform a key cycle, start the engine and let it idle for 1 minute.
- The fault code status displayed by INSITE™ electronic service tool will change to INACTIVE immediately after the diagnostic runs and passes.
- The ECM will turn off the amber CHECK ENGINE lamp immediately after the diagnostic runs and passes.
- The Reset All Faults command in INSITE™ electronic service tool can be used to clear active and inactive faults.

Shoptalk

Each ECM has an individual source address that displays when INSITE™ electronic service tool is connected. When troubleshooting a fault code, use the source address displayed in INSITE™ electronic service tool to determine which ECM and circuit is affected.

Water in the fuel can do extensive damage to the fuel system, due to the tight tolerances of the fuel system components.

Drain the Stage 1 and/or duplex fuel filters.

Bulk fuel supply may be contaminated.

If this fault code is active and there is no water in the fuel filter then a malfunctioning Water-In-Fuel sensor or water in the sensor connector could be causing the fault.

Refer to Troubleshooting Fault Code t05-1852. (</qs3/pubsys2/xml/en/procedures/00/00-t05-1852.html>)

