


Fault Code: 1911

Injector Metering Rail 1 Pressure - Data Valid but Above Normal Operating Range - Most Severe Level


 Printable Version

Overview


Codes	Reason	Effect
Fault Code: 1911 PID(P): SPN: 157 FMI: 0 Lamp: Amber SRT:	Injector Metering Rail 1 Pressure - Data Valid but Above Normal Operating Range - Most Severe Level. Mechanical dump valve has tripped.	Engine performance derate.

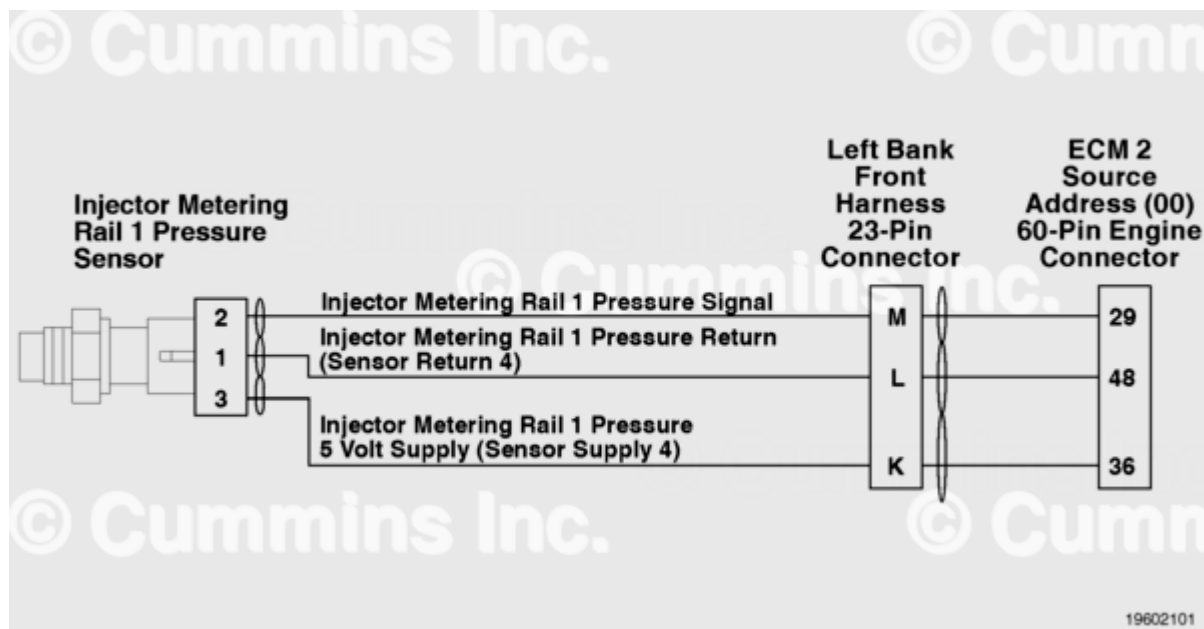

QSK38 CM2150 Industrial - Injector Metering Rail 1 Pressure Circuit

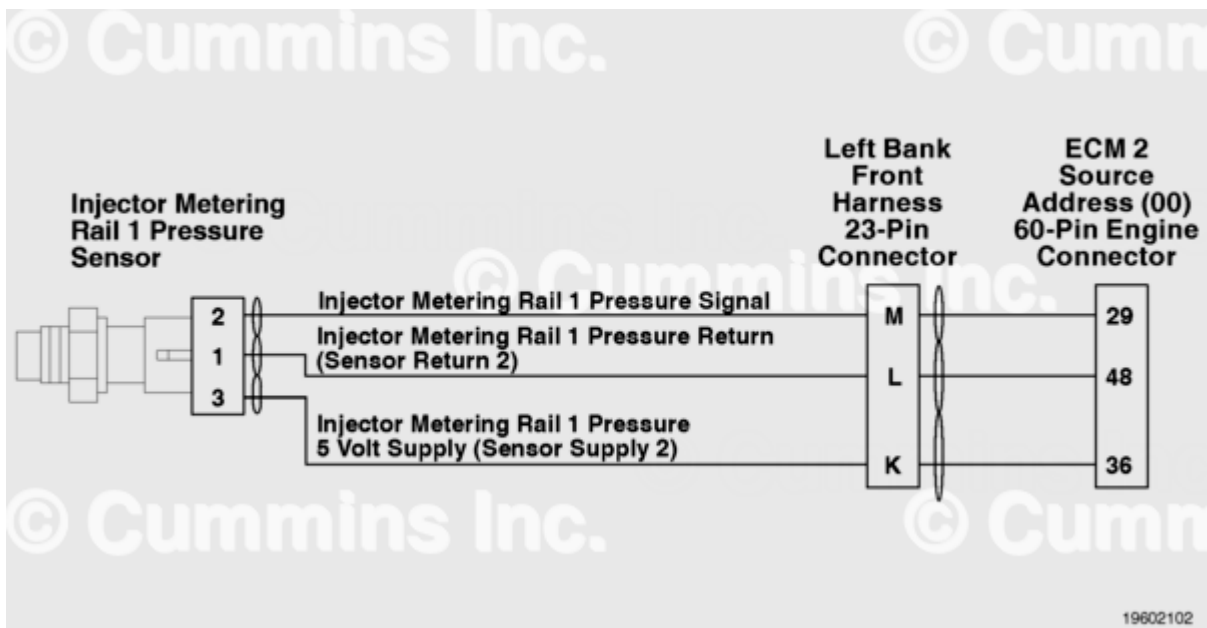


QSK38 CM2150 Marine - Injector Metering Rail 1 Pressure Circuit

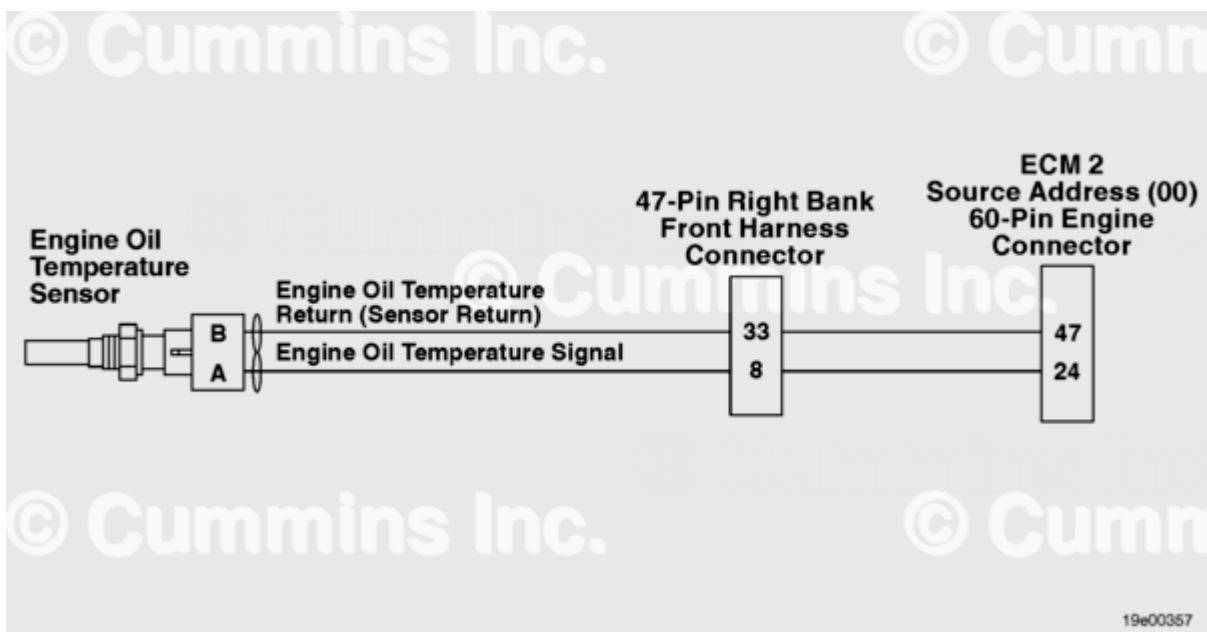

QSK38 CM2150 Power Generation - Injector Metering Rail 1 Pressure Circuit




QSK38 CM2150 Power Generation (Military Application) - Injector Metering Rail 1 Pressure Circuit

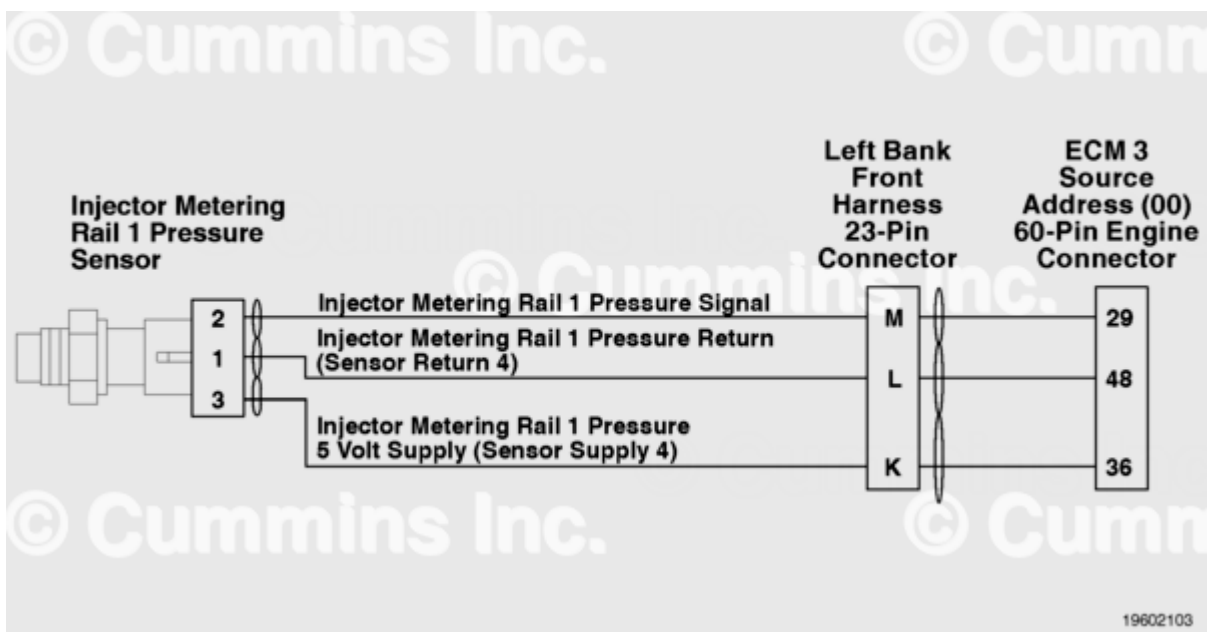


QSK50 CM2150 Industrial - Injector Metering Rail 1 Pressure Circuit




QSK50 CM2150 Power Generation without Advanced Engine Monitoring/QSK50 CM2150 Power Generation with Advanced Engine Monitoring - Injector Metering Rail 1 Pressure Circuit

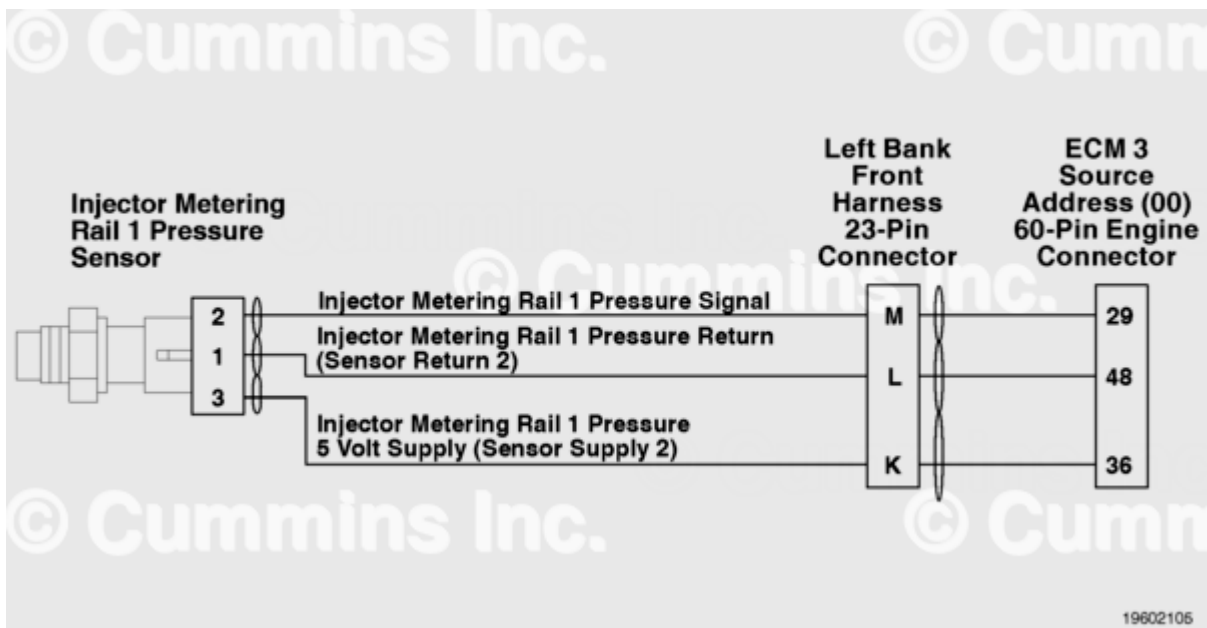


QSK50 CM2150 Marine - Injector Metering Rail 1 Pressure Circuit

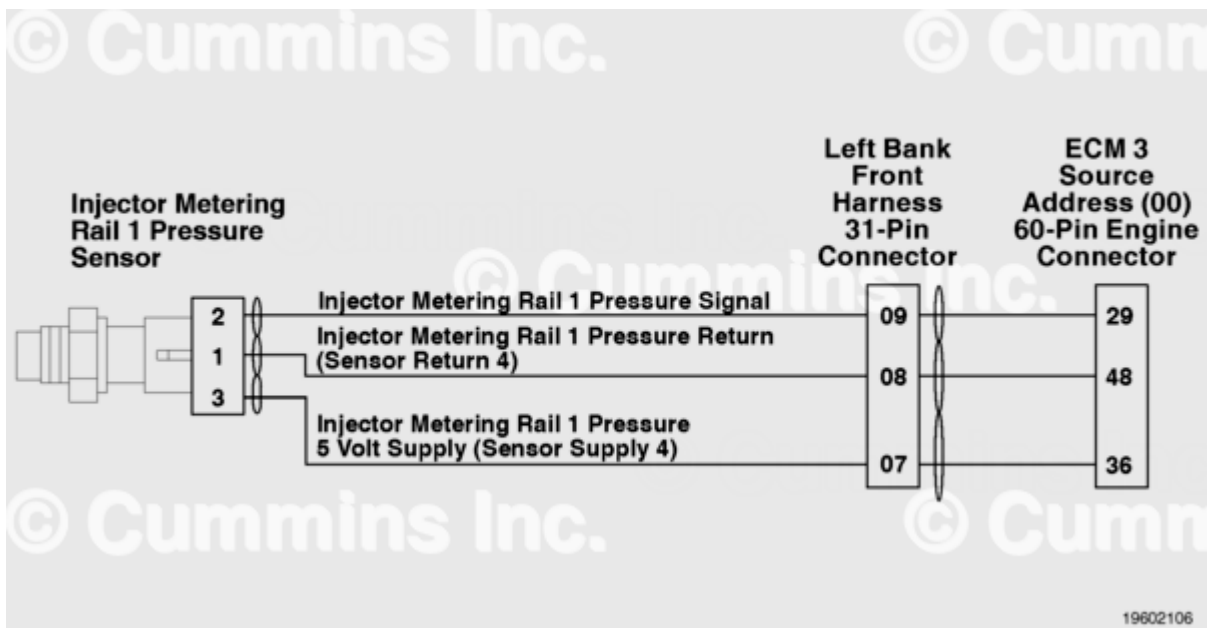

QSK60 CM2150 Industrial - Injector Metering Rail 1 Pressure Circuit

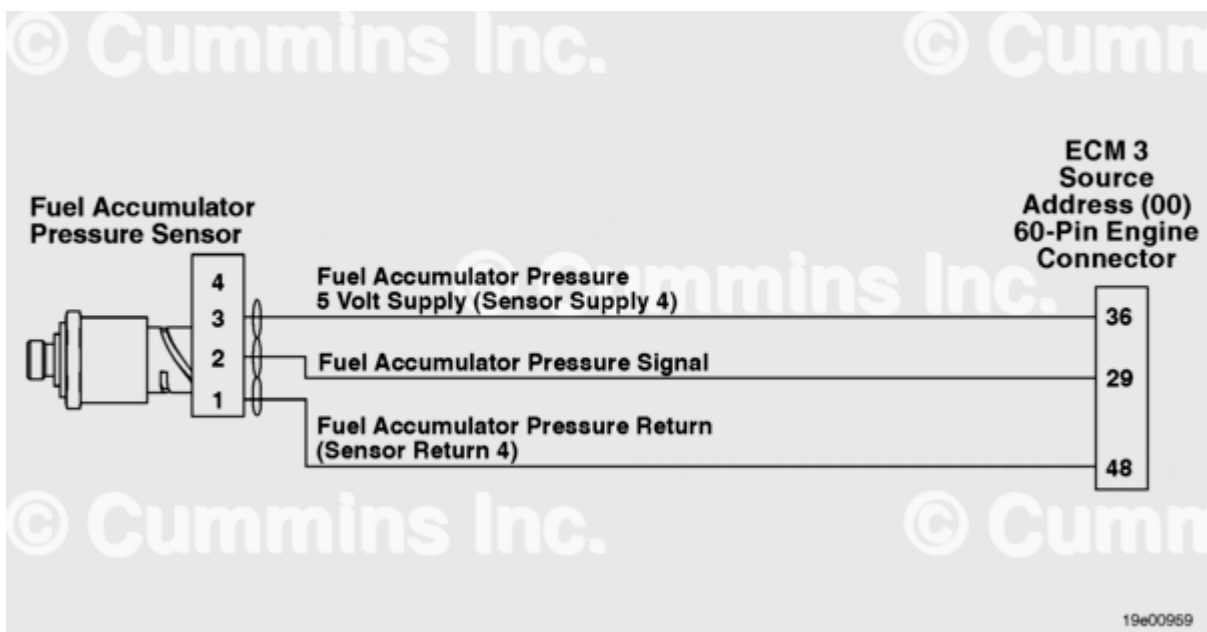

QSK60 CM2150 Power Generation- Injector Metering Rail 1 Pressure Circuit

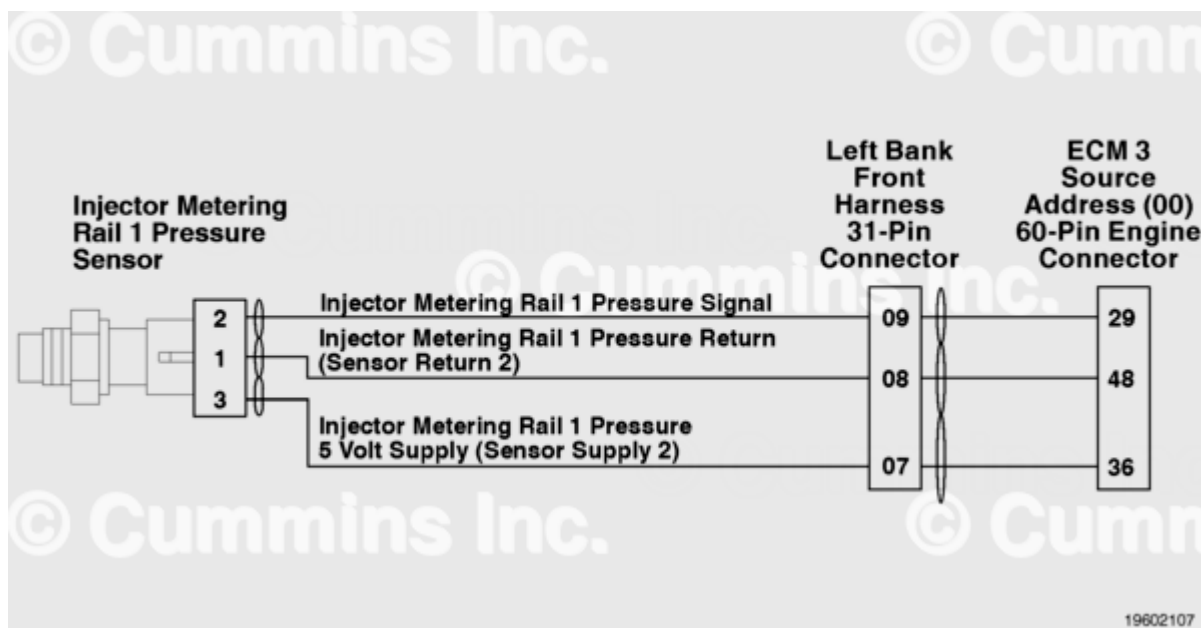

QSK60 CM2150 Marine/QSK60 CM2150 Drill Rig - Injector Metering Rail 1 Pressure Circuit

Circuit Description

The pressure control loop relies on fuel pressure supplied to the high-pressure pump by the gerotor pump. The ECM monitors the injector metering rail 1 pressure and engine operating conditions, and changes the flow command to maintain the proper injector metering rail 1 pressure. Changes to the flow command result in opening or closing of the fuel pump pressurizing assembly.

The high-pressure relief valve is set to trip at 1950 bar [28,282 psi]. After it trips, it then regulates at 900 to 1300 bar [13,053 to 18,854 psi].

Component Location

The high-pressure fuel pump is mounted to the gear housing on the left side of the engine.

Shoptalk

There are multiple ECMs for the engine models included in this manual. Each ECM has an individual source address that displays when INSITE™ electronic service tool is connected. When troubleshooting a fault code, use the source address displayed in INSITE™ electronic service tool to determine which ECM and circuit is affected.

Fuel drain flow and drain fuel temperature will increase due to the following possible causes:

- Fuel pump pressurizing assembly o-ring leaking
- High gerotor outlet pressure
- High gerotor inlet pressure
- Air in fuel.

Refer to Troubleshooting Fault Code 1911. (</qs3/pubsys2/xml/en/procedures/122/122-t05-1911.html>)

Last Modified: 13-Dec-2010
