


Fault Code: 3696

Droop Adjust Potentiometer Circuit - Voltage Below Normal or Shorted to Low Source


 Printable Version

Overview


Codes	Reason	Effect
Fault Code: 3696 PID(P): SPN: 4183 FMI: 4 Lamp: Amber SRT:	Droop Adjust Potentiometer Circuit - Voltage Below Normal or Shorted to Low Source	The droop adjust potentiometer will go to the default value.

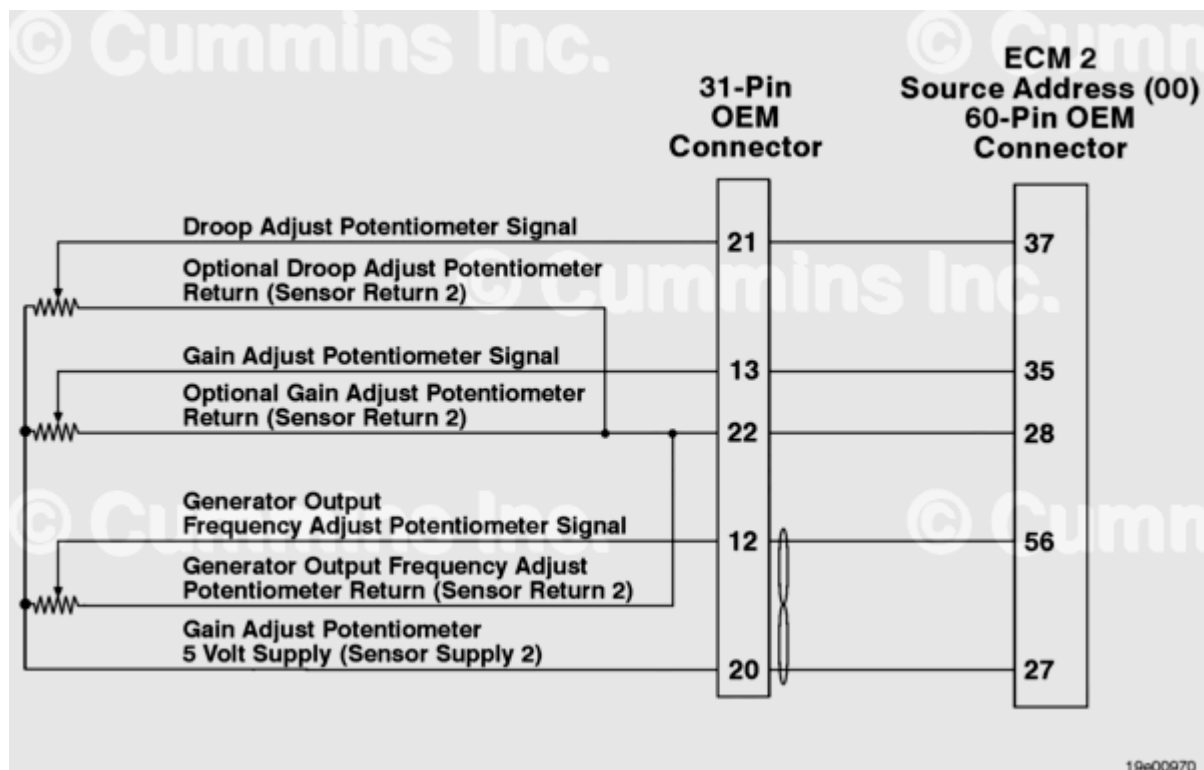


QSK38 CM2150 Power Generation -Droop Adjust Potentiometer Circuit

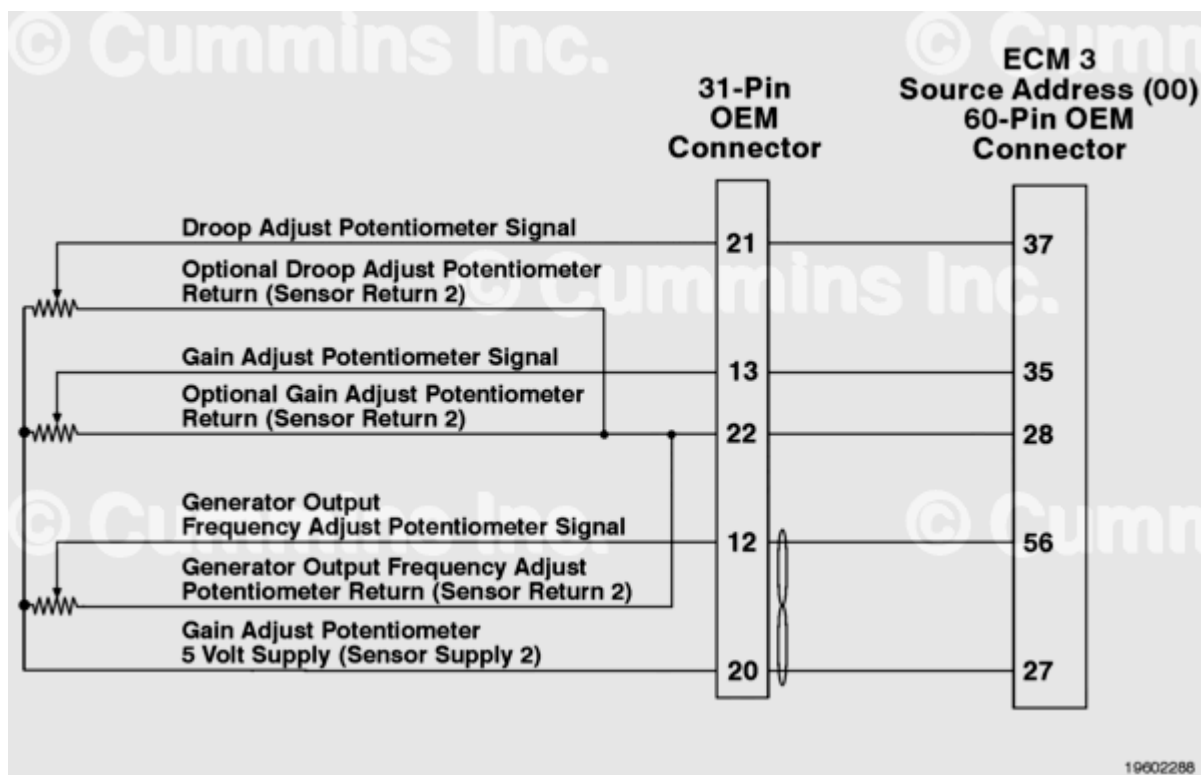


QSK50 CM2150 without Advanced Engine Monitoring/QSK50 CM2150 with Advanced Engine Monitoring/QSK60 CM2150 Power Generation - Droop Adjust Potentiometer Circuit

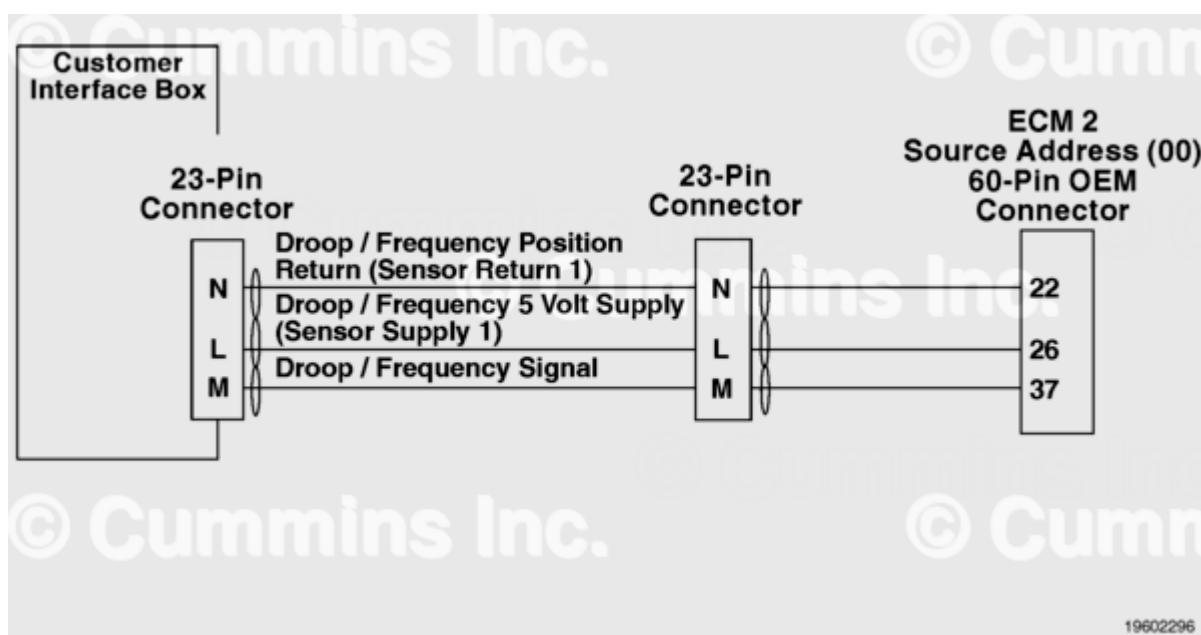


QSK38 CM2150 Marine Auxiliary with C Command Elite™ and C Command Elite Plus™ Panel System - Droop Adjust Potentiometer Circuit

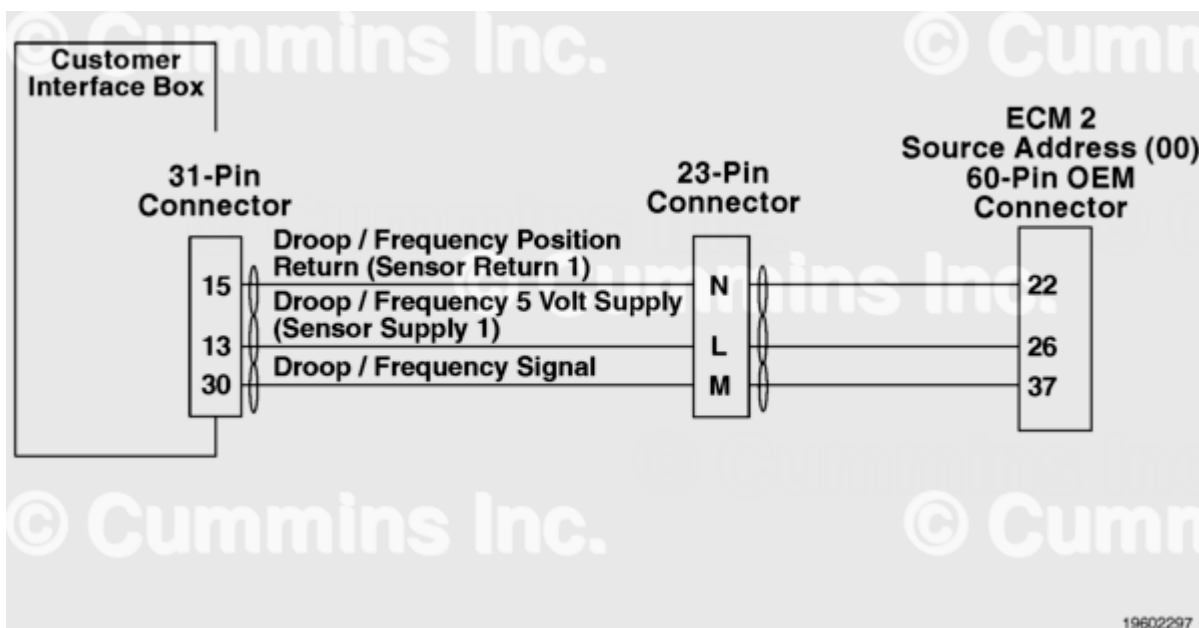

QSK38 CM2150 Marine Auxiliary with C Command™ Panel System - Droop Adjust Potentiometer Circuit

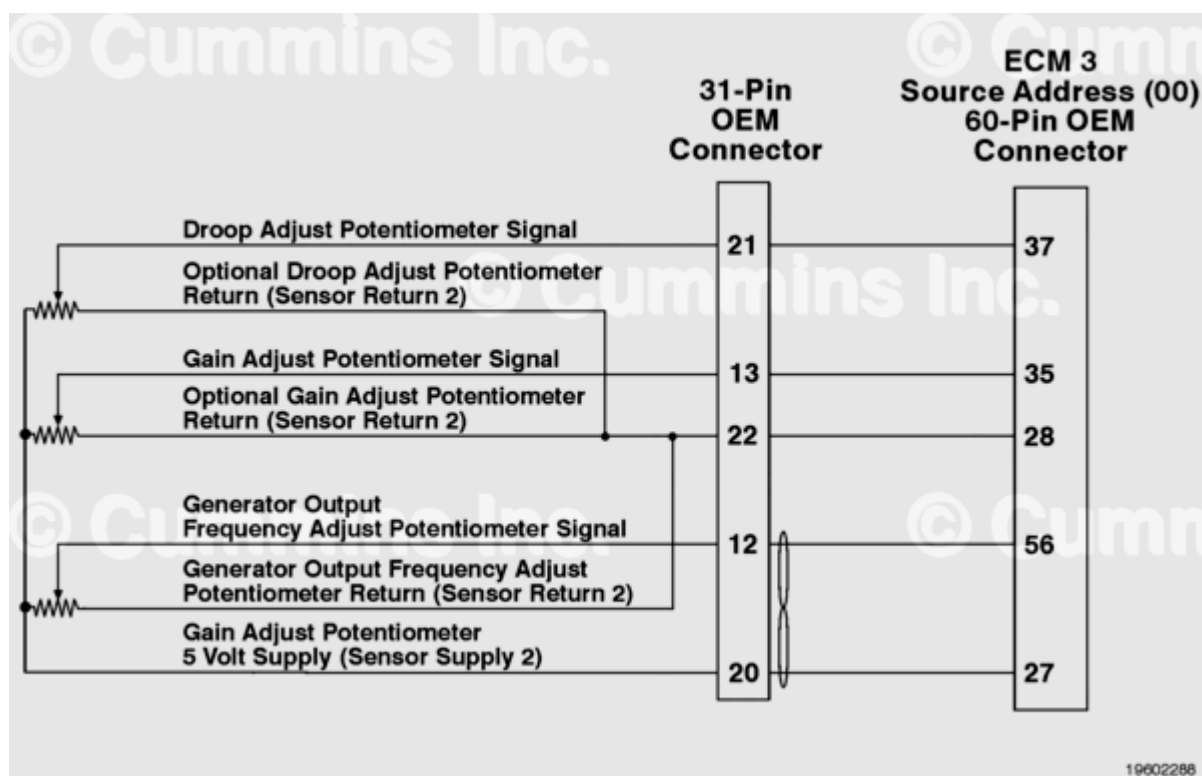

QSK50 and QSK60 CM2150 Marine Auxiliary with C Command Elite™ and C Command Elite Plus™ Panel System/QSK60 CM2150 Drill Rig - Droop Adjust Potentiometer Circuit

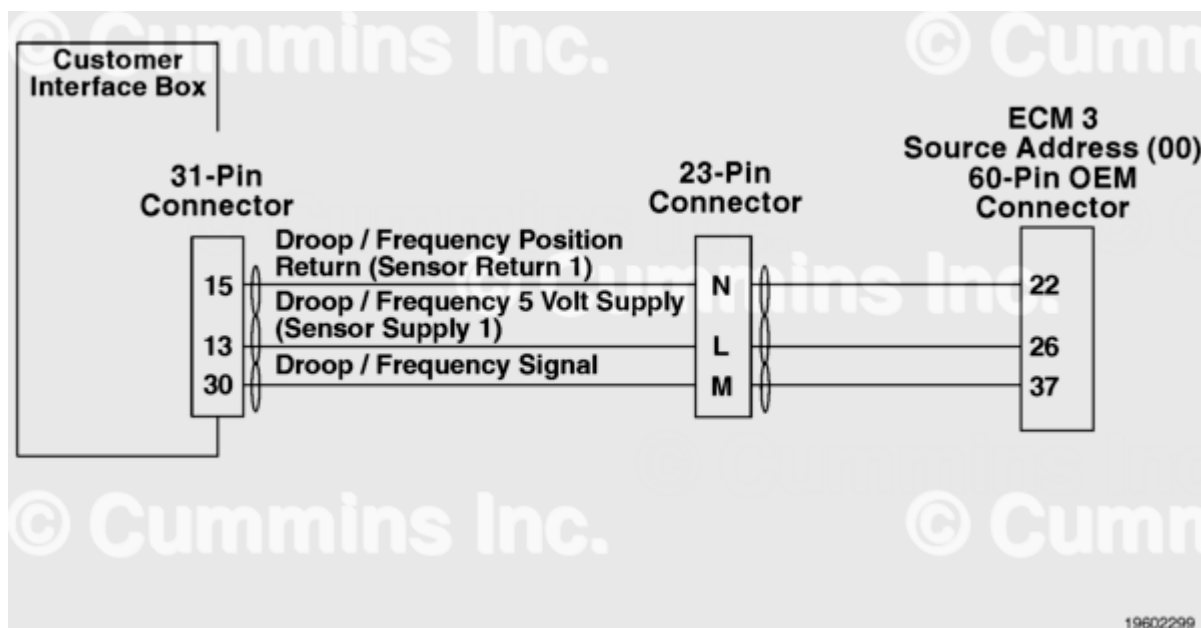

QSK50 and QSK60 CM2150 Marine Auxiliary with C Command™ Panel System - Droop Adjust Potentiometer Circuit

Circuit Description

The droop adjust potentiometer is used to regulate the engine droop.

Component Location

The droop adjust potentiometer is located on the generator control panel. Refer to the OEM service manual.

Shoptalk

There are multiple electronic control module (ECM)s for the engine models included in this manual. Each ECM has an individual source address that displays when INSITE™ electronic service tool is connected. When troubleshooting a fault code, use the source address displayed in INSITE™ electronic service tool to determine which ECM and circuit is affected.

Possible causes of the fault code include:

- SIGNAL wire open or shorted to ground
- SUPPLY wire open or shorted to ground.

Refer to Troubleshooting Fault Code 3696. (</qs3/pubsys2/xml/en/procedures/122/122-t05-3696.html>)

