


Fault Code: 3722

Intake Manifold Pressure Bank Imbalance - Data Erratic, Intermittent, or Incorrect


 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 3722 PID(P): SPN: FMI: Lamp: Maintenance SRT:	Intake Manifold Pressure Bank Imbalance - Data Erratic, Intermittent, or Incorrect.	Engine shutdown or derate.

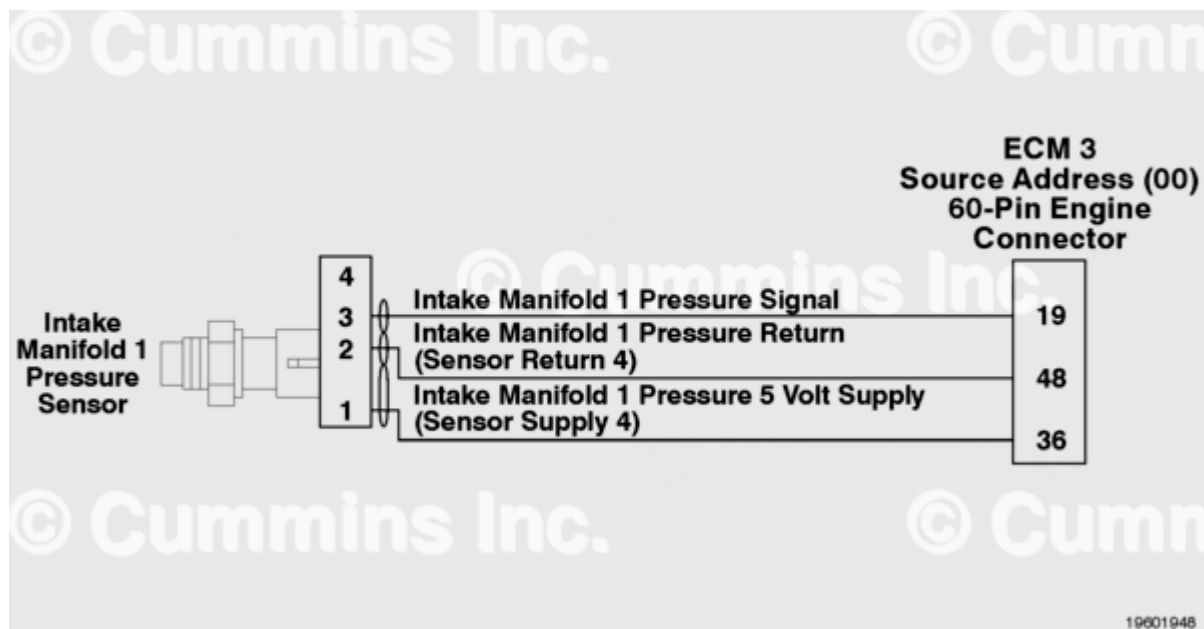

QSK50 CM2150 Power Generation with Advanced Engine Monitoring - Intake Manifold 1 Pressure Sensor Circuit

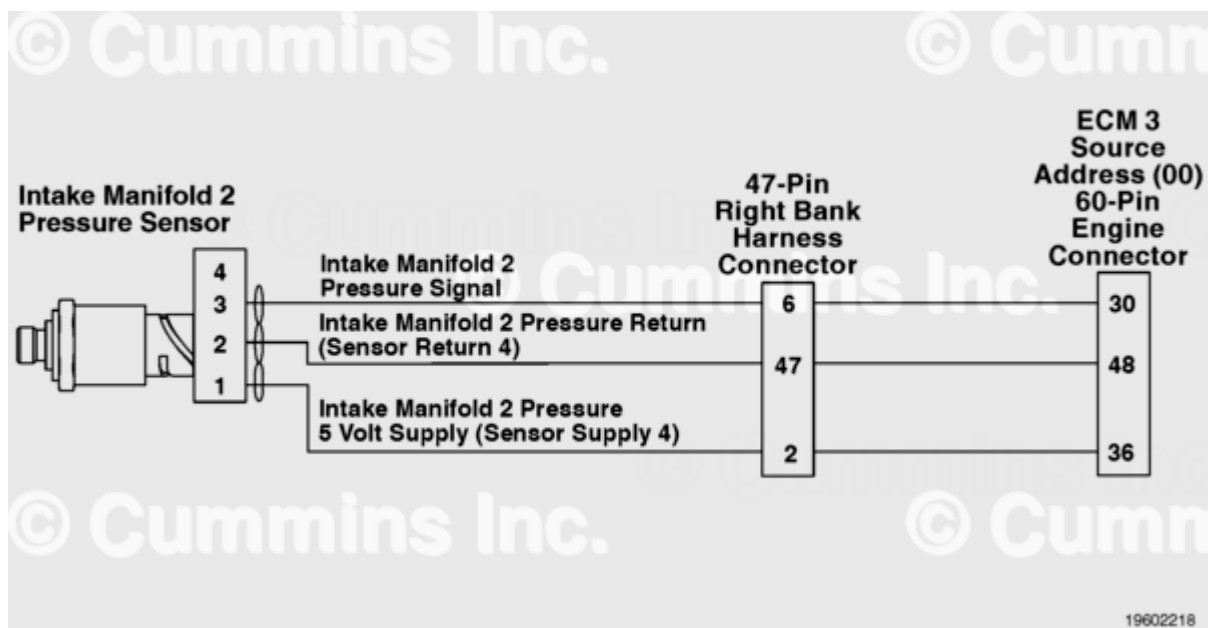

QSK50 CM2150 Power Generation with Advanced Engine Monitoring - Intake Manifold 2 Pressure Sensor Circuits

Circuit Description

The intake manifold 1 and 2 pressure sensors monitor intake manifold air pressure and pass information to the engine control module (ECM) through the engine harness. The ECM calculates a differential pressure between the left and right bank based on this information.

Component Location

The intake manifold 1 pressure sensors are located in the left and right bank front air intake manifold.

Conditions For Running The Diagnostics

- This diagnostic runs continuously when the ECM keyswitch is in the ON position.

Conditions For Setting The Fault Codes

- If the boost pressure differential between the left and right bank intake manifold pressure sensors exceeded a calibrated value for a calibrated amount of time, the fault will activate.

Action Taken When The Fault Code Is Active

- N/A

Conditions For Clearing The Fault Code

- N/A

Shoptalk

There are multiple ECMs for the engine models included in this manual. Each ECM has an individual source address that displays when INSITE™ electronic service tool is connected. When troubleshooting a fault code, use the source address displayed in INSITE™ electronic service tool to determine which ECM and circuit is affected.

Possible causes of this fault code include:

- Restricted air intake filters
- An intake air system boost leak
- A closed intake air shut off valve
- An issue with one of the turbochargers
- Multiple malfunctioning injectors on one bank.

Refer to Troubleshooting Fault Code t05-3722. (</qs3/pubsys2/xml/en/procedures/122/122-t05-3722.html>)