


Fault Code: 419

Intake Manifold Pressure Bank Imbalance - Data Erratic, Intermittent, or Incorrect


 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 419 PID(P): SPN: FMI: Lamp: Amber SRT:	Intake Manifold Pressure Bank Imbalance - Data Erratic, Intermittent, or Incorrect.	Engine shutdown or derate.

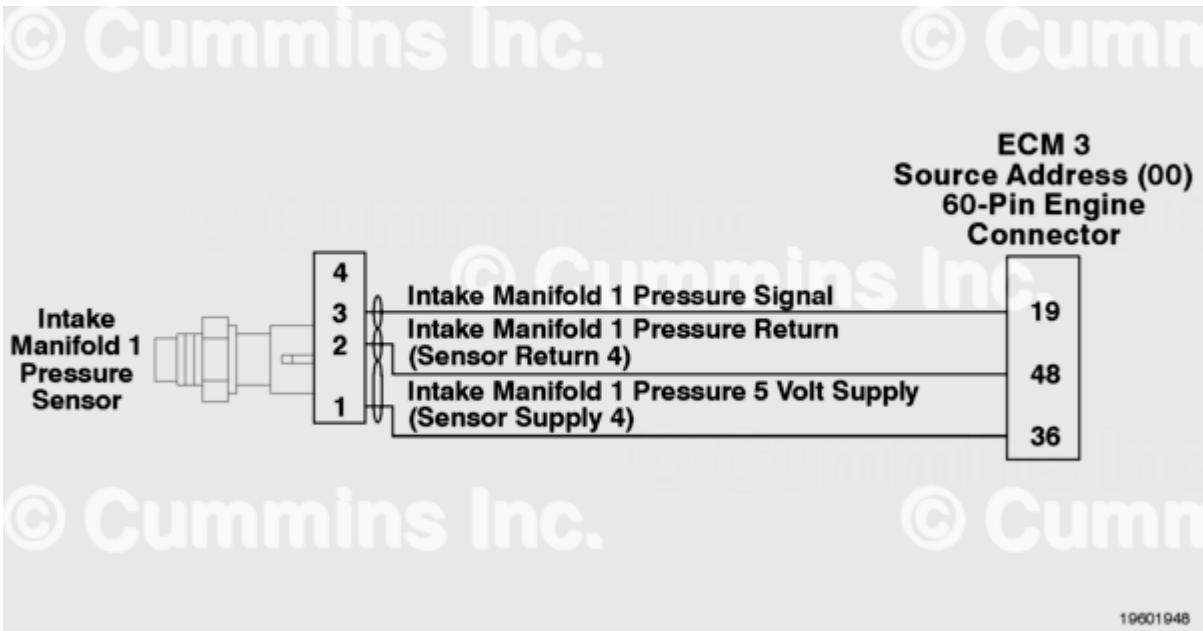

QSK50 CM2150 Power Generation with Advanced Engine Monitoring - Intake Manifold 1 Pressure Sensor Circuit

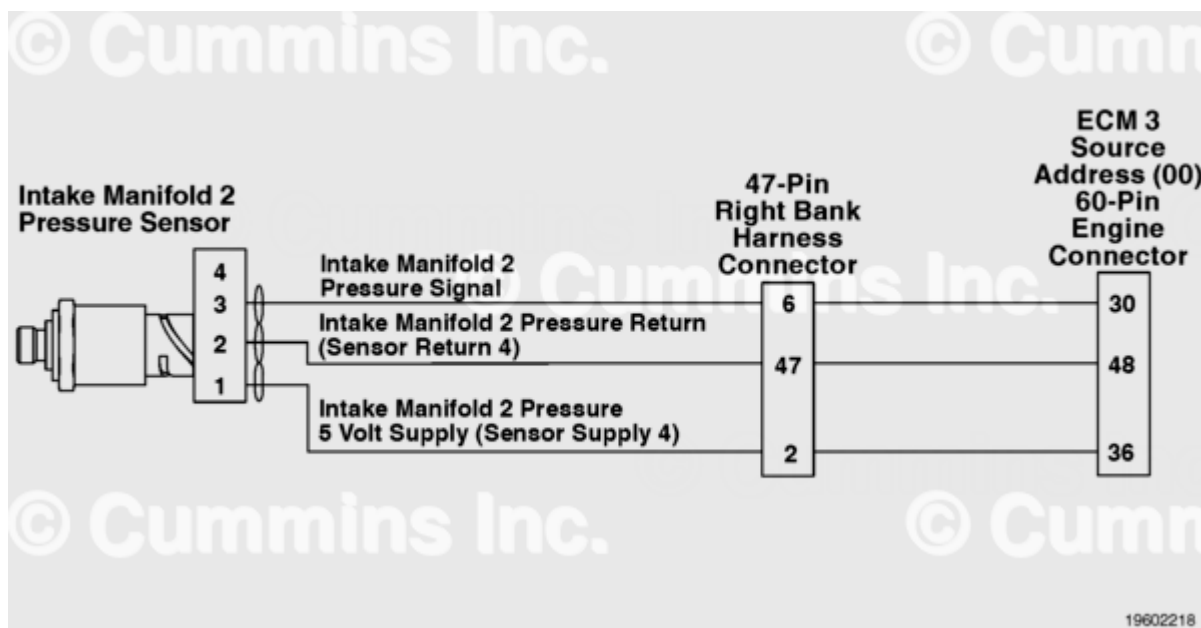

QSK50 CM2150 Power Generation with Advanced Engine Monitoring - Intake Manifold 2 Pressure Sensor Circuits

Circuit Description

The intake manifold 1 and 2 pressure sensors monitor intake manifold air pressure and pass information to the engine control module (ECM) through the engine harness. The ECM calculates a differential pressure between the left and right bank based on this information.

Component Location

The intake manifold pressure sensors are located in the air intake manifold toward the front of the engine.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the ECM keyswitch is in the ON position.

Conditions For Setting The Fault Codes

If the boost pressure differential between the left and right bank intake manifold pressure sensors exceeded a calibrated value for a calibrated amount of time, the fault will activate.

Action Taken When The Fault Code Is Active

- N/A

Conditions For Clearing The Fault Code

- N/A

Shoptalk

There are multiple ECMs for the engine models included in this manual. Each ECM has an individual source address that displays when INSITE™ electronic service tool is connected. When troubleshooting a fault code, use the source address displayed in INSITE™ electronic service tool to determine which ECM and circuit is affected.

Possible causes of the fault code include:

- Restricted air intake filters
- High compressor intake temperatures
- An issue with one of the turbochargers
- A closed intake air shut off valve.

Refer to Troubleshooting Fault Code t05-419. (</qs3/pubsys2/xml/en/procedures/122/122-t05-419.html>)