


Fault Code: 559

Injector Metering Rail 1 Pressure - Data Valid but Below Normal Operating Range - Moderately Severe Level


 Printable Version

Overview


Codes	Reason	Effect
Fault Code: 559 PID(P): SPN: 157 FMI: 1/18 Lamp: Amber SRT:	Injector Metering Rail 1 Pressure - Data Valid - but Below Normal Operating Range - Moderately Severe Level. The ECM has detected that the fuel pressure is lower than commanded.	Low Power, possible shutdown, or no start.

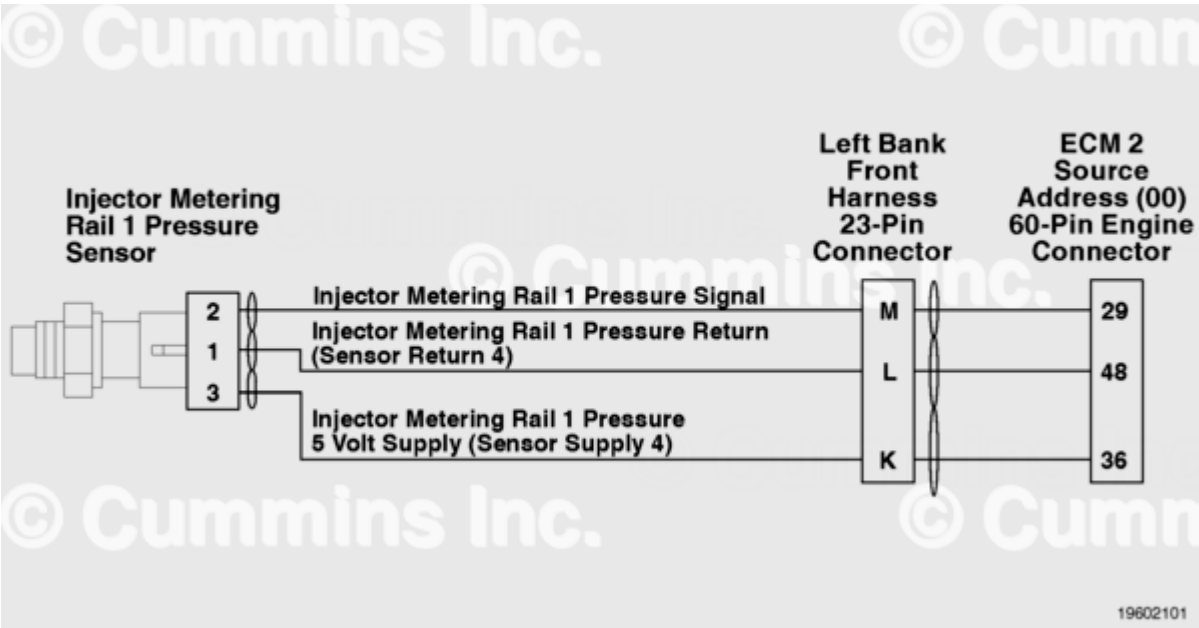


QSK38 CM2150 Industrial - Injector Metering Rail 1 Pressure Circuit

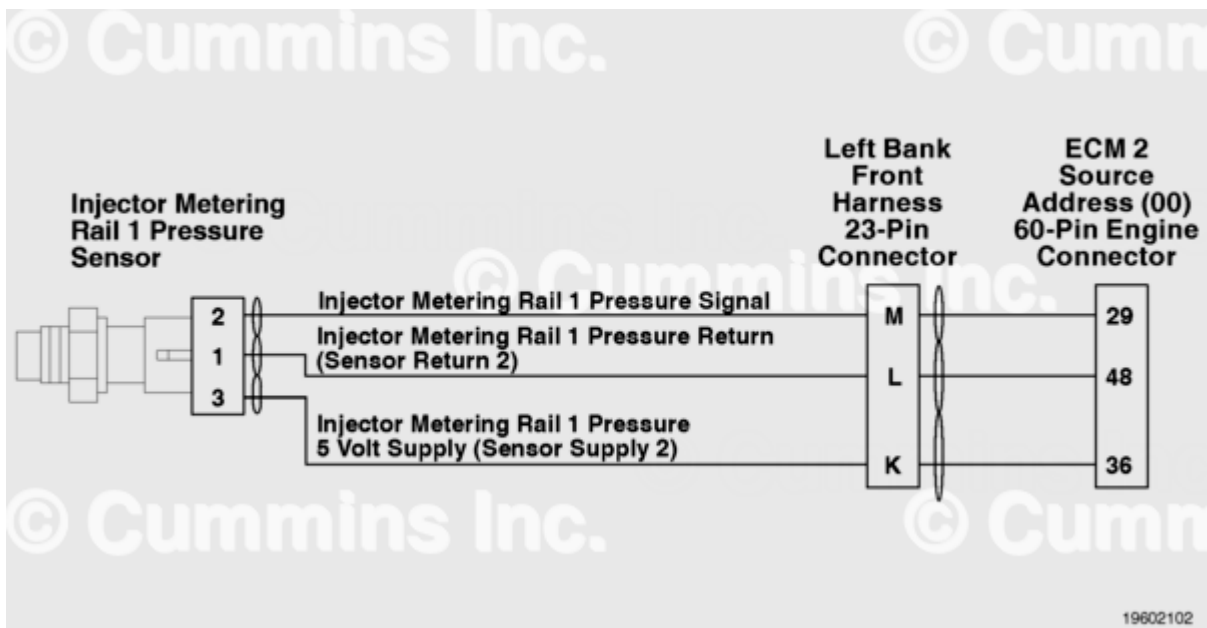


QSK38 CM2150 Marine - Injector Metering Rail 1 Pressure Circuit

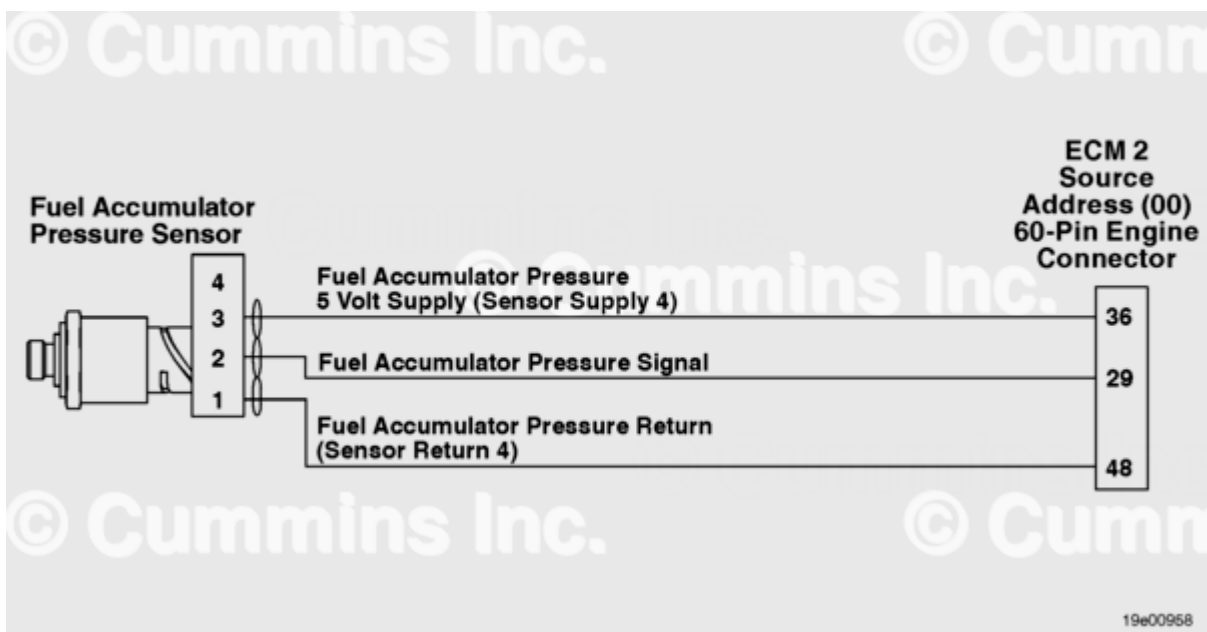


QSK38 CM2150 Power Generation/QSK38 CM2150 Power Generation (Military Application) -
Injector Metering Rail 1 Pressure Circuit

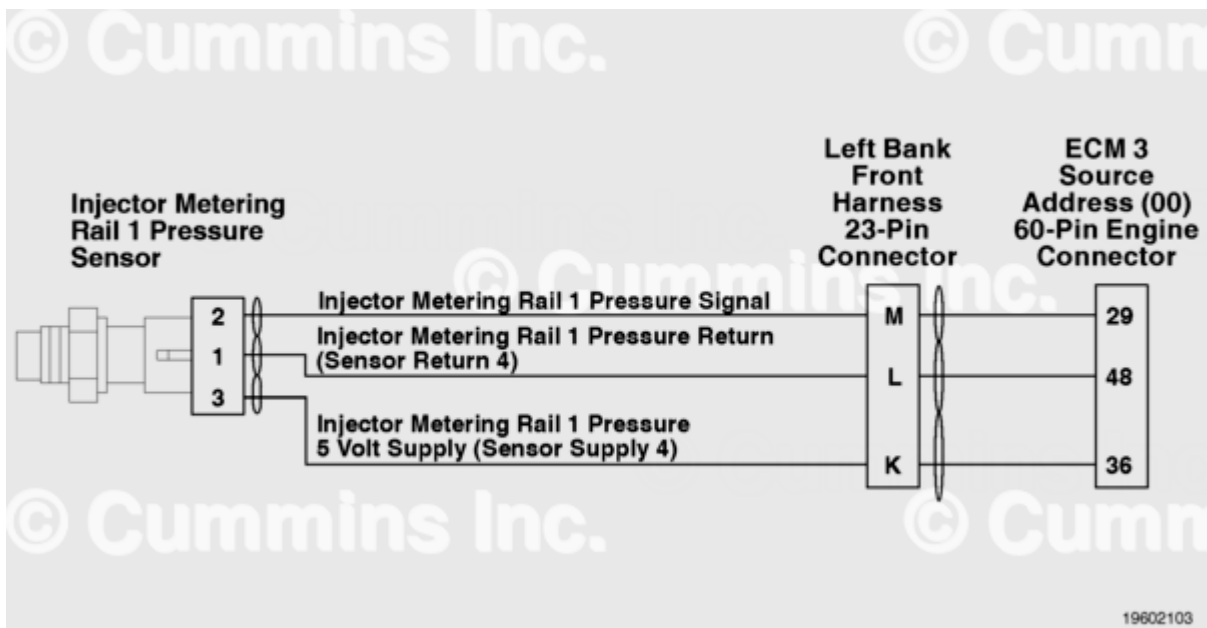


QSK50 CM2150 Industrial - Injector Metering Rail 1 Pressure Circuit

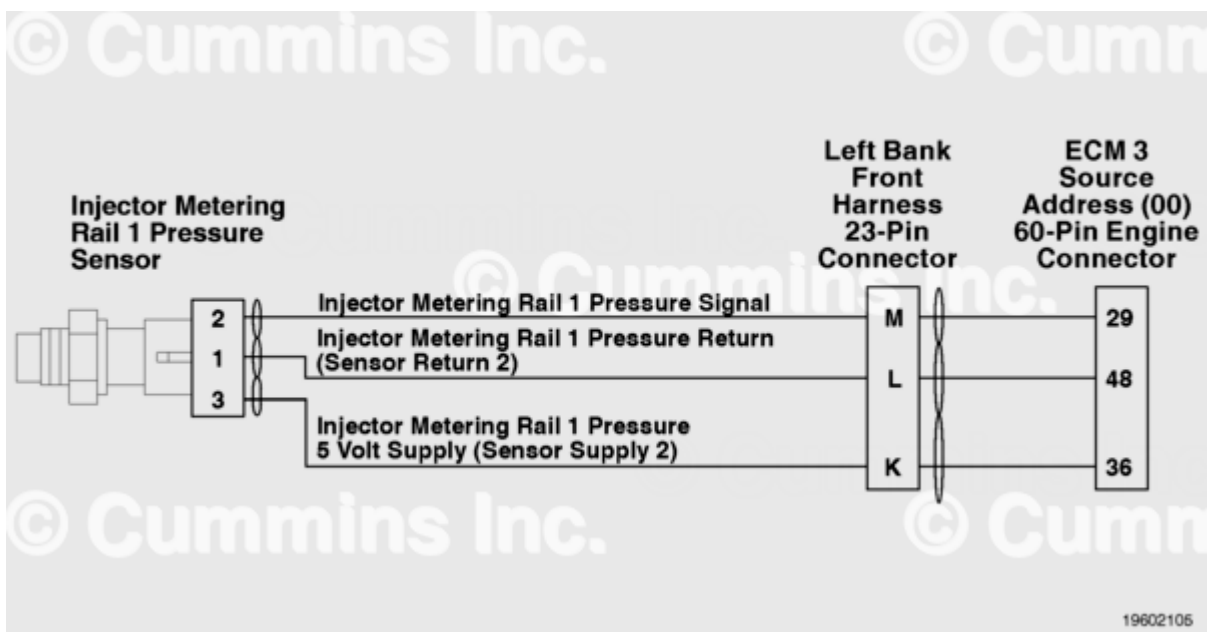


QSK50 CM2150 Marine - Injector Metering Rail 1 Pressure Circuit

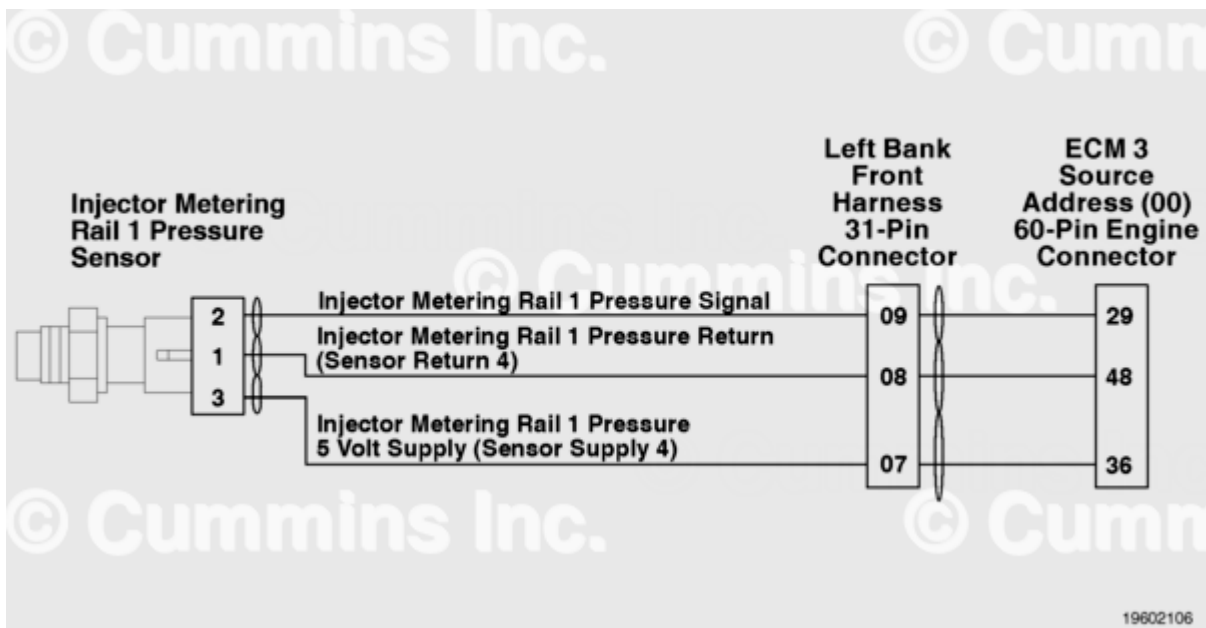

QSK60 CM2150 Industrial - Injector Metering Rail 1 Pressure Circuit

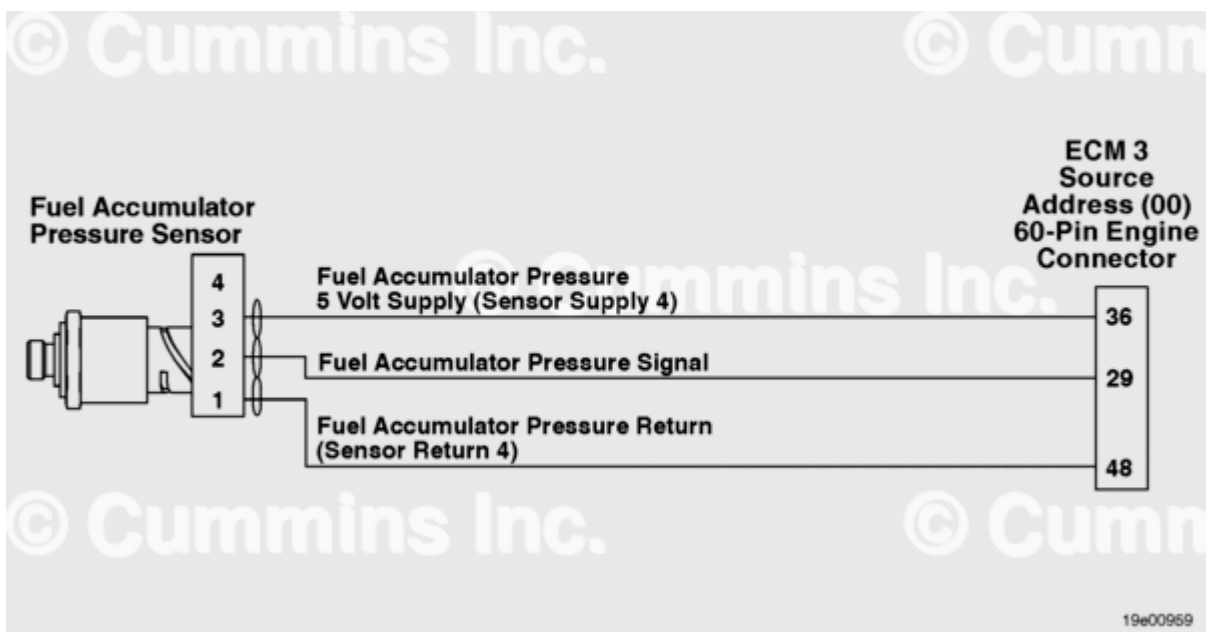

QSK50 CM2150 Power Generation without Advanced Engine Monitoring/QSK50 CM2150 Power Generation with Advanced Engine Monitoring/QSK60 CM2150 Power Generation - Injector Metering Rail 1 Pressure Circuit

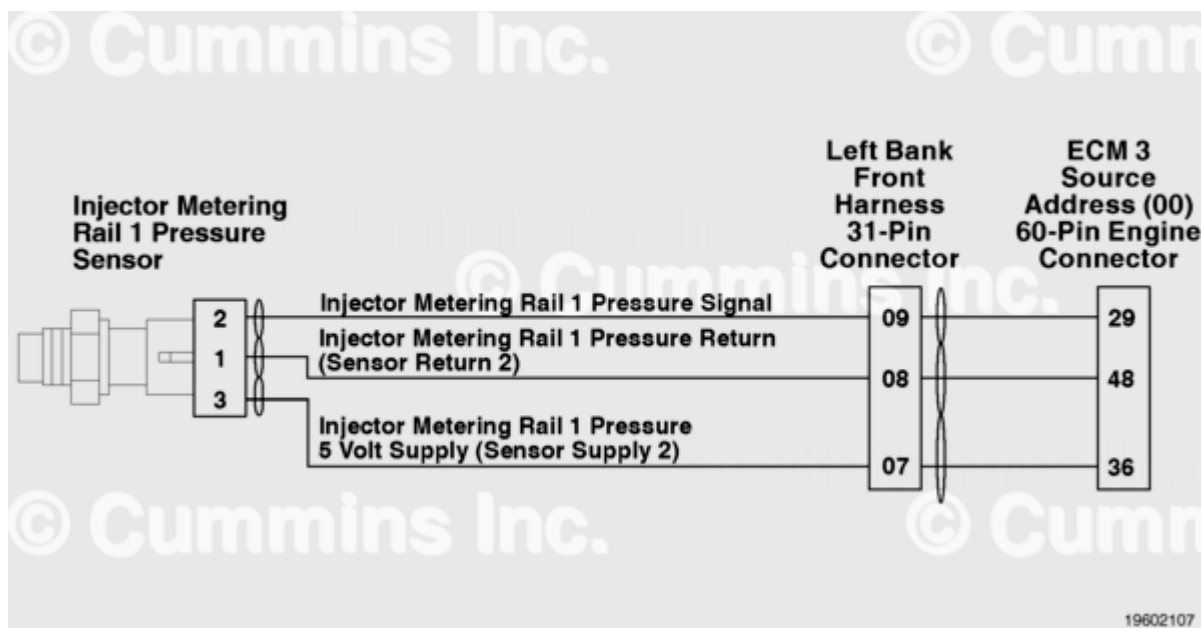

QSK60 CM2150 Marine/QSK60 CM2150 Drill Rig - Injector Metering Rail 1 Pressure Circuit

Circuit Description

The pressure control loop relies on fuel pressure supplied to the high-pressure pump by the gerotor pump. The ECM monitors the injector metering rail 1 pressure and engine operating conditions, and changes the flow command to maintain the proper injector metering rail 1 pressure. Changes to the flow command result in opening or closing of the fuel pump pressurizing assembly 1.

Component Location

The high-pressure fuel pump is mounted to the front gear housing on the left bank of the engine.

Shoptalk

There are multiple ECMs for the engine models included in this manual. Each ECM has an individual source address that displays when INSITE™ electronic service tool is connected. When troubleshooting a fault code, use the source address displayed in INSITE™ electronic service tool to determine which ECM and circuit is affected.

Possible causes of this fault code include:

- Fuel inlet restriction
- Fuel filter plugging
- Gerotor pump output low
- Gerotor pump pressure regulator sticking or leaking
- High-pressure pump capacity decay
- Mechanical dump valve leaks to drain

- Mechanical dump valve opens at low pressure
- High-pressure injector supply line inner wall leak
- Malfunctioning fuel pump pressurizing assembly.

Refer to Troubleshooting Fault Code 559. (</qs3/pubsys2/xml/en/procedures/122/122-t05-559.html>)

Last Modified: 17-Sep-2010
