


Fault Code: 187


Sensor Supply 2 Circuit - Voltage Below Normal or Shorted to Low Source

 Printable Version


Overview

Codes	Reason	Effect
Fault Code: 187 PID(P): SPN: 3510 FMI: 4/4 Lamp: Amber SRT:	Low voltage detected at sensor supply number 2 circuit.	Loss of some sensor functionality.

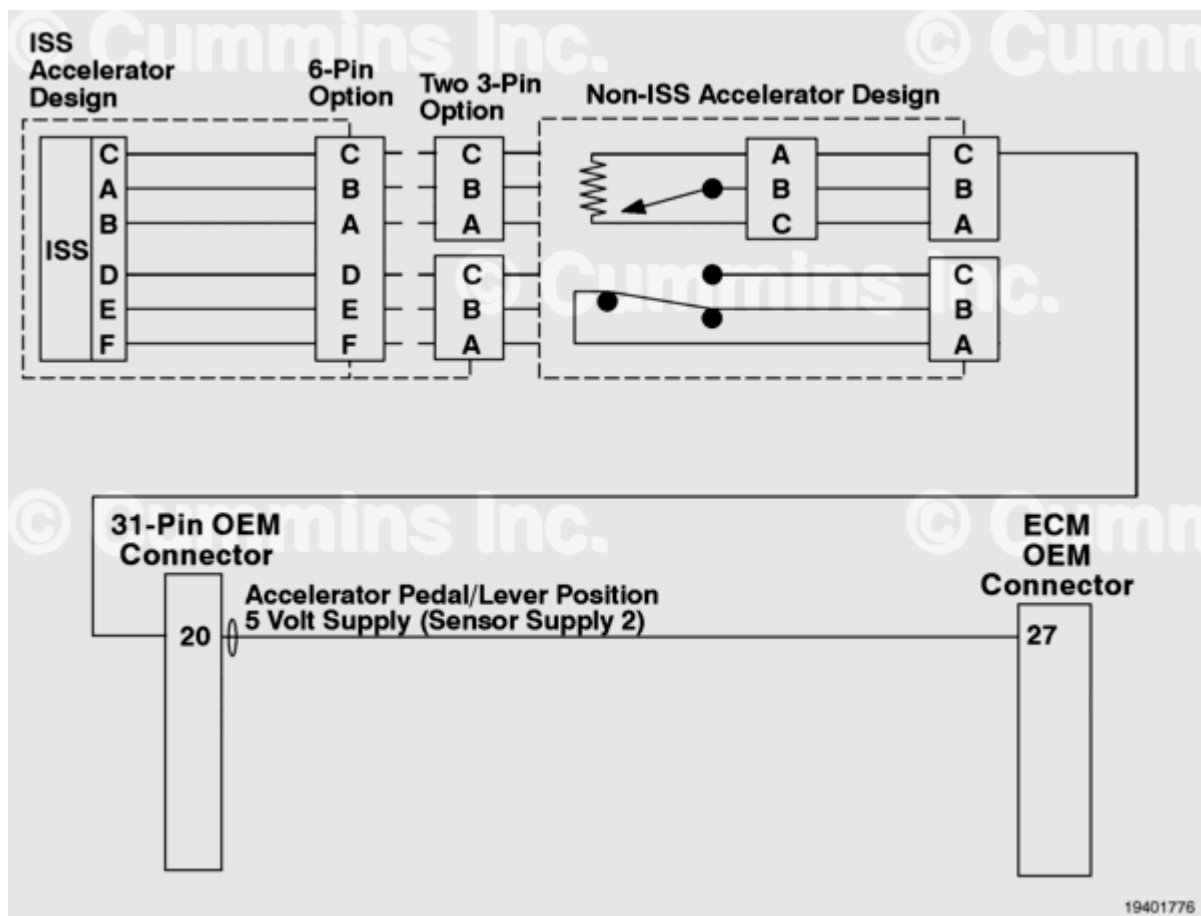


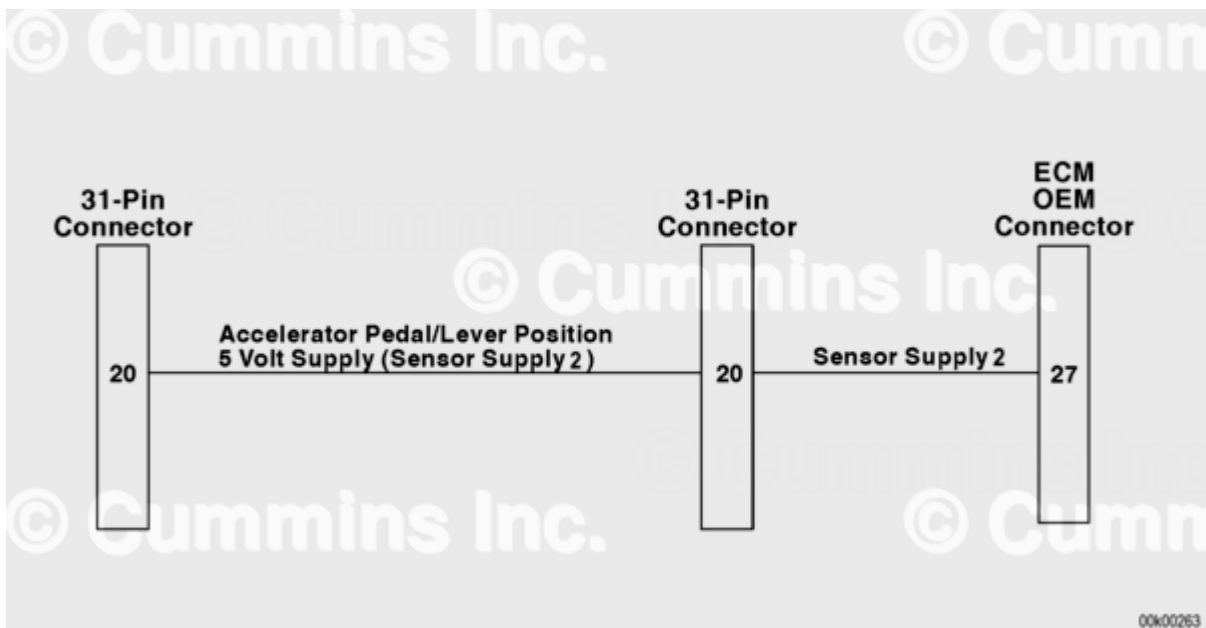

QSK19 CM2150 Marine/Marine Propulsion - Sensor Supply 2 Circuit

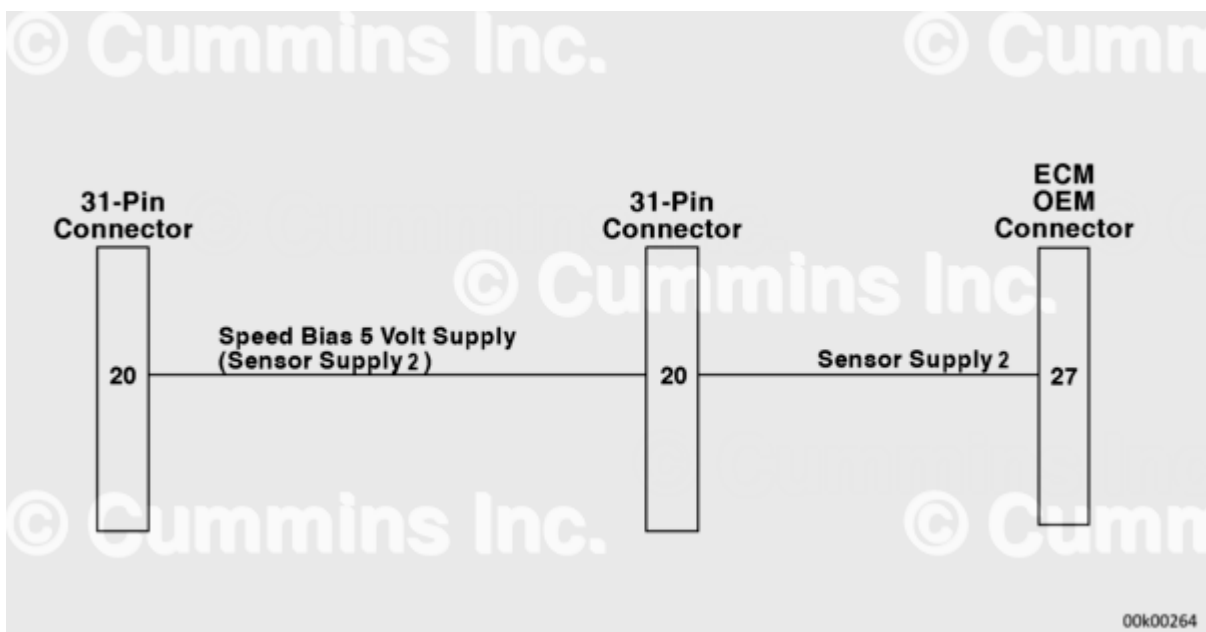

QSK19 CM2150 Marine/Marine Auxiliary - Sensor Supply 2 Circuit

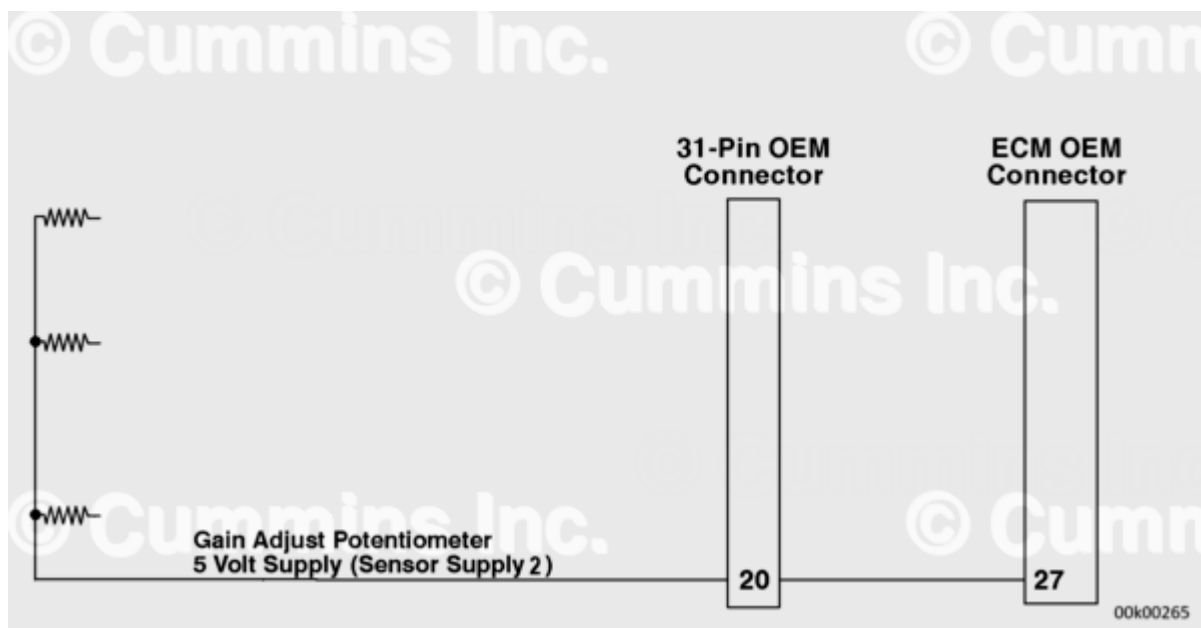

QSK19 CM2150 Power Generation - Sensor Supply 2 Circuit

Circuit Description

The sensor supply 2 circuit of the engine control module (ECM) provides a 5 volt supply to various sensors.

Component Location

The sensor supply 2 circuit of the engine control module (ECM) provides a 5 volt supply to various sensors. Refer to the wiring diagram for sensor supply identification.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged engine wiring harness
- Malfunctioning or damaged OEM wiring harness
- Malfunctioning or damaged accelerator pedal or lever position sensor
- Malfunctioning or damaged speed bias switch
- Malfunctioning or damaged gain adjust potentiometer

Refer to Troubleshooting Fault Code t05-187. (</qs3/pubsys2/xml/en/procedures/123/123-t05-187.html>)

