



Technical Service Bulletin

Technical Service Bulletin: tsb080038	Released Date: 06-May-2008
Cylinder Block and Centinel™ Valve Bracket	

Cylinder Block and Centinel™ Valve Bracket

Core Issue

This Early Field Notification addresses an incompatibility issue between the present production cylinder block, Part Number 4965679 and Centinel™ valve bracket, Part Number 3681176. The Centinel™ valve bracket does **not** mount to the present cylinder block.

Confirmation

All QSX15 engines that use the Centinel™ fuel system and present production cylinder block.


The Centinel™ valve bracket will **not** mount to the cylinder block.

None.

There was an oversight at the release of the EGR product, due to the low volume usage of the Centinel™ fuel system.

None.

Resolution

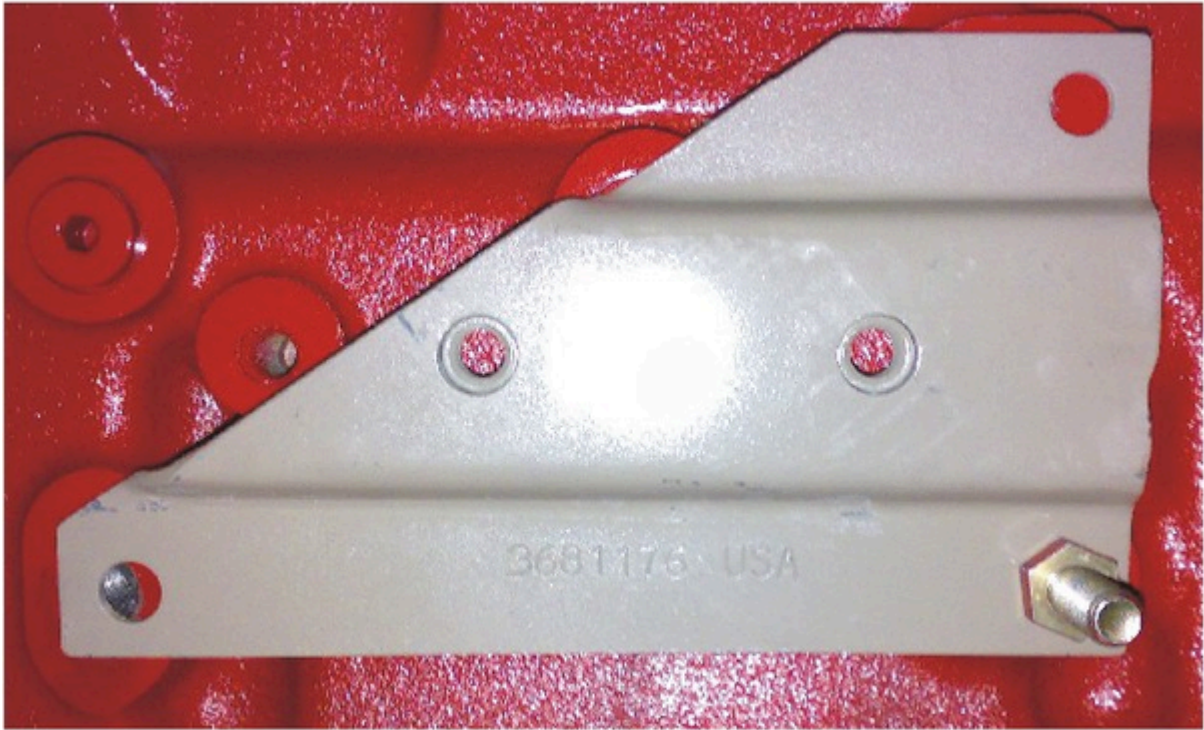

01d00418

The Centinel™ valve bracket mounting hole, located on the bottom right, as viewed in the photo, will need to be slotted approximately 7.5 mm [0.295 in].

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Last Modified: 06-May-2008
