



Technical Service Bulletin: TSB190170

Released Date: 30-Sep-2019

Front Gear Cover Inspection to Prevent Front Gear Cover Cracking

Front Gear Cover Inspection to Prevent Front Gear Cover Cracking

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK23 CM500
- QSK23 CM2250 K109
- QSK23 CM2350 K127

Issue

Symptom

- Front gear cover cracking

Root Cause

- Debris or sealant in blind tapped holes in front gear cover

Resolution

- When removing the front gear cover, clean and remove debris and sealant from the blind tapped holes in the front gear cover.
- The presence of sealant in the blind tapped hole in the front gear cover leads to less capscrew thread engagement. The exerted pressure when the capscrew is torqued, can cause the front gear cover to crack.

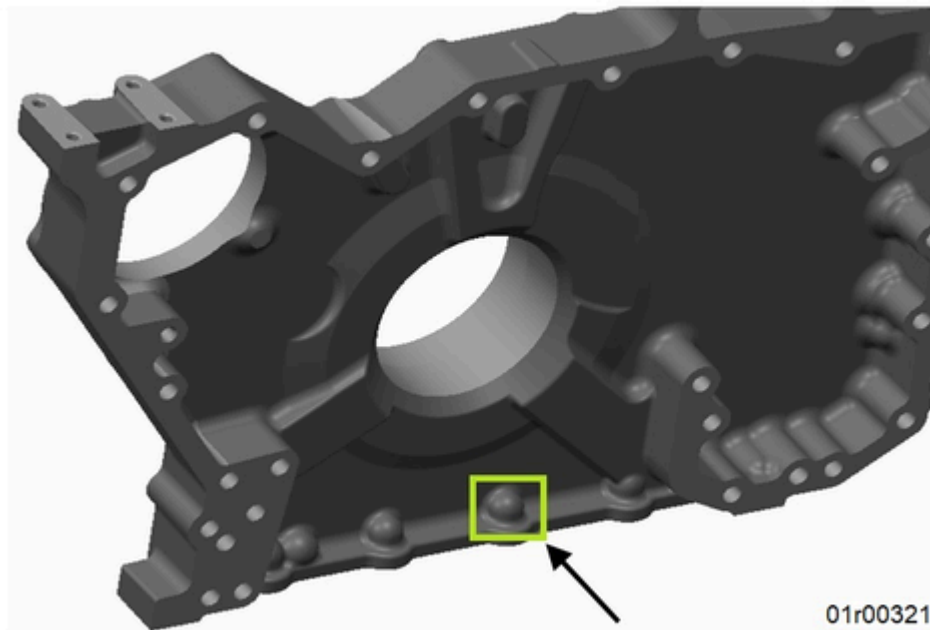


Figure 1, Example Location of a Blind Tapped Hole on Front Gear Cover.



Figure 2, Fractured Front Gear Cover Material.

Publications Affected

Table 1, Publications Affected					
Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Troubleshooting and Repair Manual	QSK23 (All Versions)	4021375	Gear Cover, Front	Refer to Procedure 001-031 (/qs3/pubsys2/xml/en/procedures/89/89-001-031.html)	1

Document History

Date	Details
2019-9-26	Module Created