



Technical Service Bulletin: TSB200004

Released Date: 28-Jan-2020

New Idler Pulley and Secondary Tensioner with Dust Seals

New Idler Pulley and Secondary Tensioner with Dust Seals

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSX15 CM570 (Excavator and driller application **only**)

Issue

Primary idler pulley and secondary tensioner fail due to dust and dirt in the bearings.

Symptom:

- Bearing noise, loss of drive belt, engine overheating.

Root Cause:

- High levels of dirt and dust in environment contaminate bearing grease.

Verification

Check primary idler pulley, part number 3681587, and secondary tensioner, part number 3104027, for rough or seized pulley rotation. Check for damage to the primary and secondary belt.

Resolution

A new primary idler pulley and secondary tensioner, both with improved bearing dust seals, have been released.

Service Instructions

1. Remove primary drive belt (Drive Belt, Water Pump). Refer to Procedure 008-003 (</qs3/pubsys2/xml/en/procedures/10/10-008-003.html>).
2. Remove secondary drive belt (Drive Belt, Refrigerant Compressor). Refer to Procedure 009-052 (</qs3/pubsys2/xml/en/procedures/10/10-009-052-tr.html>).
3. Remove primary idler pulley, part number 3681587, and pilot adapter, part number 3681715. See Figures 1 and 2. Refer to Procedure 008-062 (</qs3/pubsys2/xml/en/procedures/10/10-008-062-tr.html>).

4. Remove secondary tensioner, part number 3104027. See Figure 1. Refer to Procedure 009-053 (/qs3/pubsys2/xml/en/procedures/10/10-009-053-tr.html).
5. Install new pilot adapter, part number 5582573, and new idler pulley assembly, part number 5582393. Refer to Procedure 008-062 (/qs3/pubsys2/xml/en/procedures/10/10-008-062-tr.html).
6. Install dust shield, part number 5582393, onto idler pulley assembly. Refer to Procedure 008-062 (/qs3/pubsys2/xml/en/procedures/10/10-008-062-tr.html).
7. Intall new secondary tensioner, part number 5582391. Use capscrew part number 3896408. Refer to Procedure 009-053 (/qs3/pubsys2/xml/en/procedures/10/10-009-053-tr.html).
8. Reinstall secondary drive belt (Drive Belt, Refrigerant Compressor). Refer to Procedure 009-052 (/qs3/pubsys2/xml/en/procedures/10/10-009-052-tr.html).
9. Reinstall primary drive belt (Drive Belt, Water Pump). Refer to Procedure 008-003 (/qs3/pubsys2/xml/en/procedures/10/10-008-003.html).

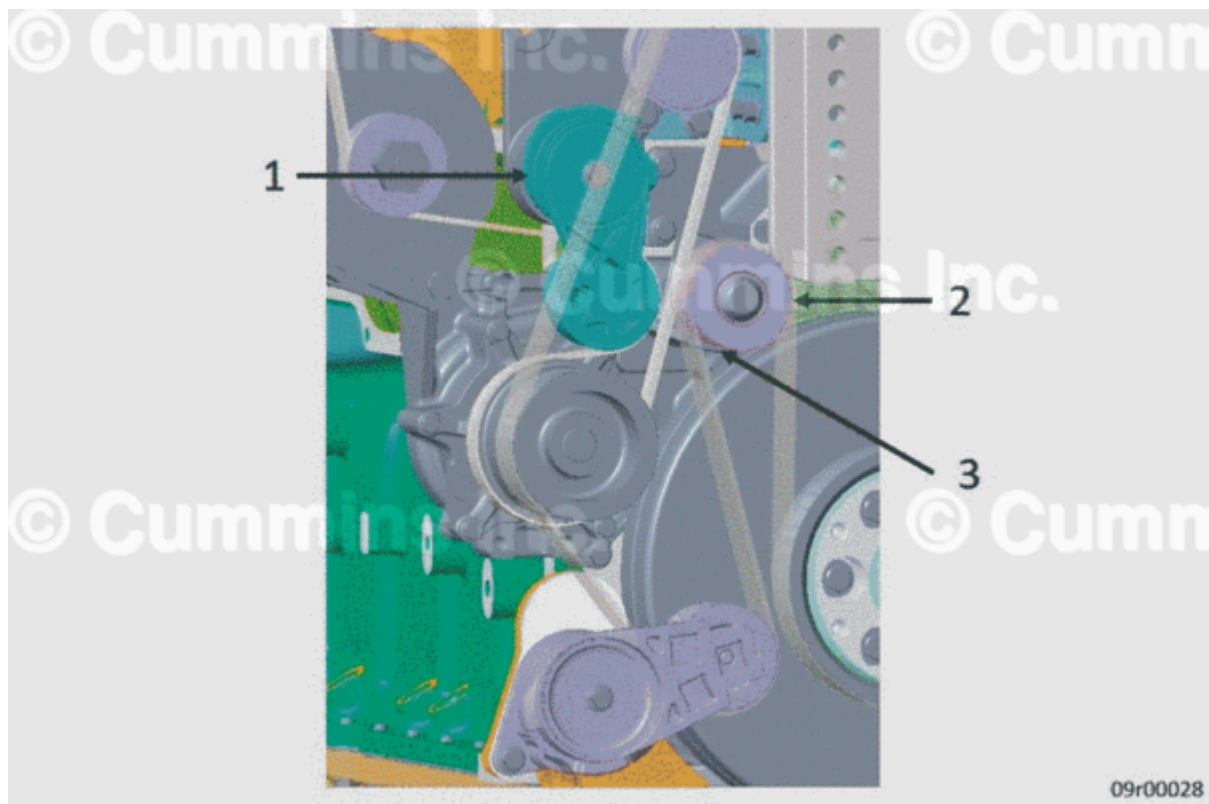


Figure 1, Drive Layout

1. Secondary Tensioner
2. Primary Idler Pulley
3. Pilot Adapter

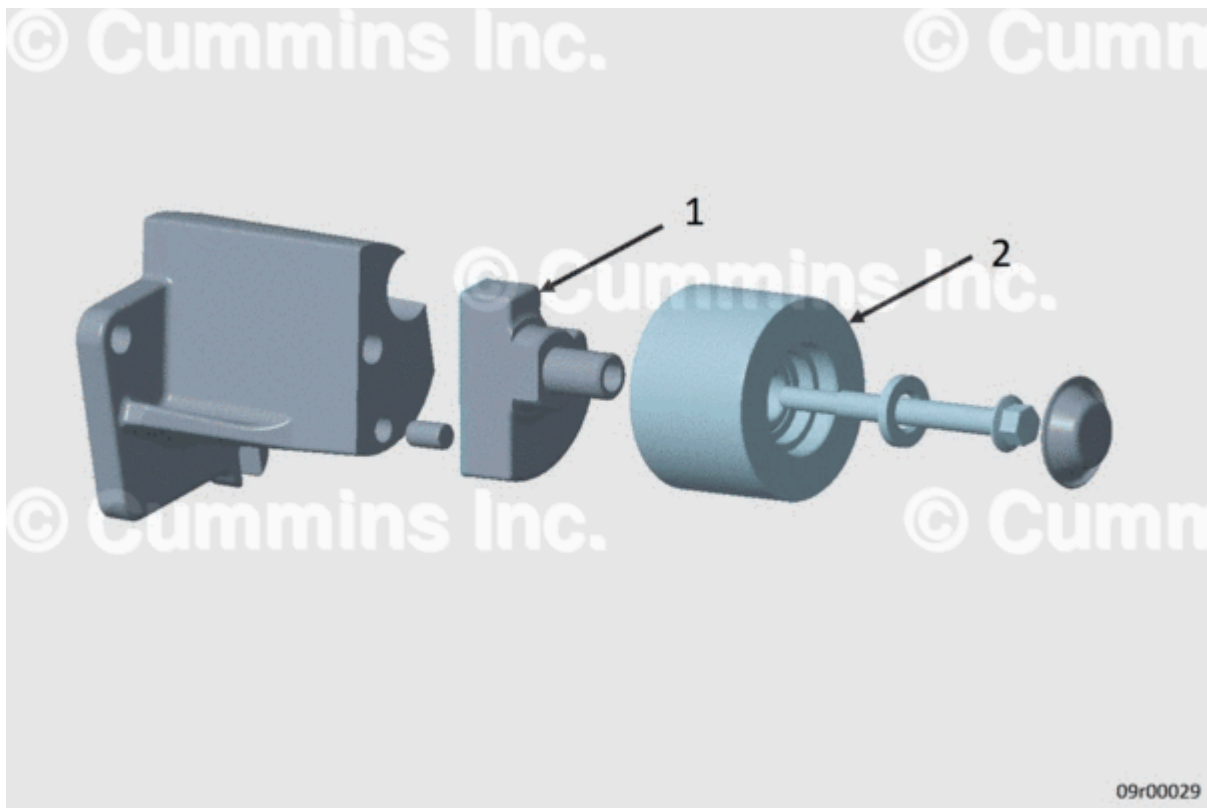


Figure 2, Existing Pilot Adapter and Idler Pulley Assembly

1. Pilot Adapter
2. Primary Idler Pulley

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
TENSIONER, BELT	3104027	No	No	5582391
PULLEY, IDLER	3681587	No	No	5582393
ADAPTER, PILOT	3681715	No	No	5582573

Part Compatibility

New parts compatible on QSX15 engines built with FA1450 and EH1102. Intended for use on excavator and driller units in dirty and dusty environments.

Production Status

Table 2, Production Information		
ESN First	Build Date ¹	Plant
80229043	11 November 2019	Jamestown Engine Plant
¹ Engine build date can be found on engine dataplate.		

Document History

Date	Details
2020-1-8	Module Created