



Technical Service Bulletin

Technical Service Bulletin: TSB200168

Released Date: 07-Oct-2020

Engine Wiring Harness Routing

Engine Wiring Harness Routing

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK23 CM500

Issue

Engine wiring harness interference with the ECM cover plate.

Symptom:

- Engine wiring harness rubs through the ECM cover plate.

Root Cause:

- Engine wiring harness routing not robust.

Verification/Confirmation

Wiring harness interferes with the ECM cover plate.

Resolution

Add wire tie to hold the harness away from ECM cover plate to prevent interference. There should be a gap of at least 25 mm (1 in) between the cover plate and the wiring harness.

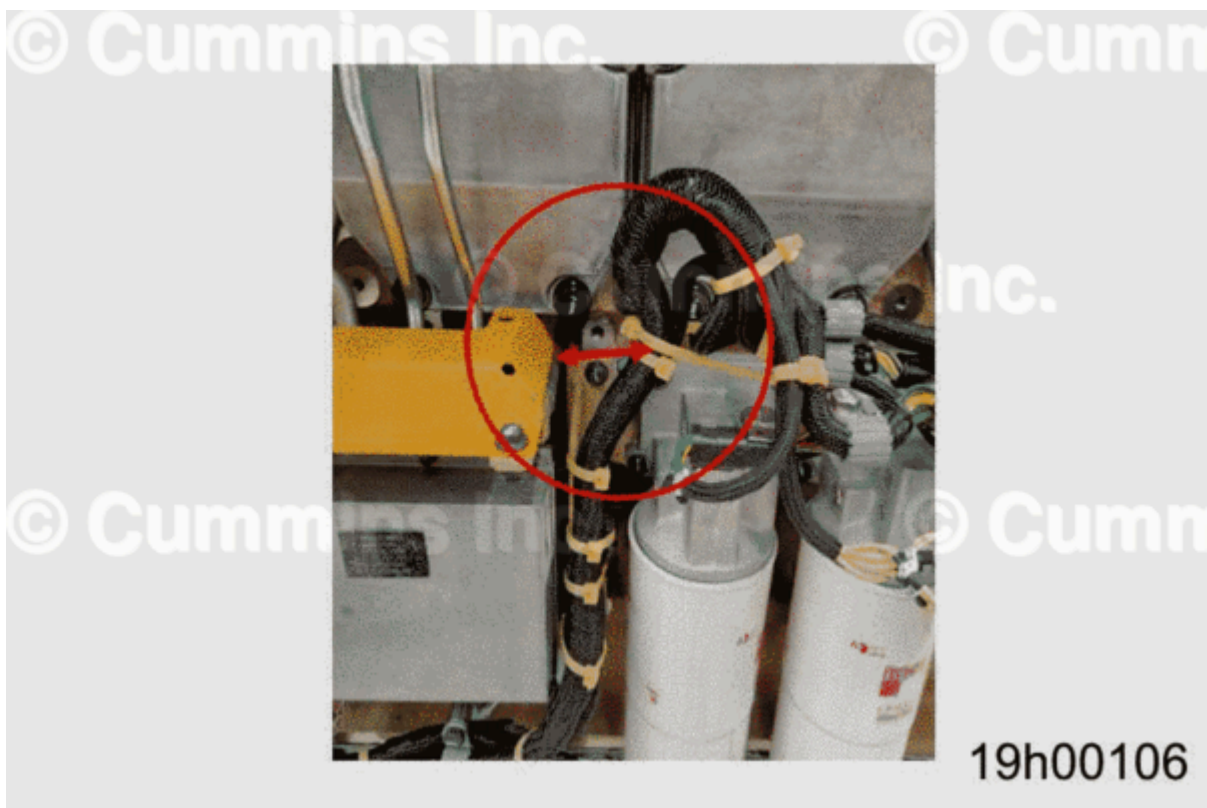


Figure 1, Wiring Harness Installed with Wire Ties

Service Instructions

Wire tie the harness to prevent interference with the ECM cover plate.

Production Status

Implemented for production. See table below.

Table 1, Production Information

ESN First	Build Date ¹	Plant
85007524	10 March 2020	Phalton Engine Plant

¹Engine build date can be found on engine dataplate.

Document History

Date	Details
2020-7-27	Module Created

