



Service Bulletin Number: 3666243-01

Released Date: 01-apr-1998

Catalyst Muffler for Service Use Only

Catalyst Muffler for Service Use Only

Purpose

This Service Bulletin introduces a new service design for the diesel catalyst in the B and C Series diesel engines.

Diesel oxidation catalysts are being used on B Series and C Series automotive engines to reduce the particulate emissions and meet EPA emissions standards. Customers have reported a loss of engine power due to the plugging of the catalyst.

⚠ CAUTION ⚠

Do not idle engine for long periods of time. Long periods of idling (more than 10 minutes) can damage an engine by dropping combustion chamber temperatures so low the fuel will not burn completely. This will cause carbon to clog the injector spray holes and piston rings, and can cause the valves to stick. It can also plug the catalyst muffler, leading to a low power complaint.

If the engine coolant temperature becomes too low (60°C [140°F]), raw fuel will wash the lubricating oil off the cylinder walls and dilute the crankcase oil. Moving parts will no longer receive the correct amount of lubrication.

This condition is typically reported on engines with:

- A light load operation (frequent and/or extended idle) and/or
- Low ambient temperature.

The new service design was developed to resist plugging, particularly for engines operated in northern climates with a light-duty cycle condition.

Engine Family	Production Catalyst Number	Service Catalyst Identification
B5.9	26233	32434
C8.3	26265	32434

- 6B all automotive engines
- 6C most truck engines (see exceptions).
- 6C transit buses.

Note : Periodic operation at high engine loads will help prevent this failure by burning off accumulated deposits.

To determine if a catalyst muffler is the root cause of the low power or no response complaint:

1. Connect a pressure gauge (measuring in Hg) to the pressure tap on the inlet end of the catalyst muffler.
2. Measure the exhaust restriction on the engine under rated rpm and load.

a. If pressure is above 6 in Hg, replace the catalyst muffler with the service use only catalyst muffler (see instructions).

b. If pressure is less than 6 in-Hg, the catalyst muffler is not the root cause of the low power or no response complaint. Please reference the appropriate Troubleshooting and Repair Manuals for low power complaints in the "Engine Power Output Low" symptom tree.

For instructions on taking measurements, look at the following publications:

- Troubleshooting and Repair Manual, B Series Engines 1991 and 1994 Certification Levels, Bulletin 3666087. Refer to Procedure .
- Troubleshooting and Repair Manual, C Series Engines 1991 and 1994 Certification Levels, Bulletin 3666003. Refer to Procedure .

Note : The above test procedure must be run at the engine rated rpm and load for proper verification of plugged catalyst.

Replacement catalyst mufflers are available through authorized OEM dealers or direct from suppliers such as:

- Donaldson Company, Inc. (800) 374-1374 or
- Nelson Industries, Inc. (800) 356-6606.

Cummins Inc. does **not** supply the replacement catalyst muffler. The following are the catalyst element numbers that are used to make sure that the correct service use **only** catalyst element is inside the muffler. The service use **only** catalyst replacement mufflers require at least a 10-inch diameter muffler can.

Engine Family	Production Catalyst Identification	Service Catalyst Identification
B5.9	26233	32434
C8.3	26265	32434


The service use **only** catalyst muffler does **not** supersede or obsolete the original part number for the catalyst muffler. It is **not** to be used to fix a low power and/or no response complaint when the exhaust restriction is below 6 in Hg and the catalyst muffler is **not** plugged. The same service catalyst substrate will be used for the B5.9 and C8.3 engine families.

Note : The service use only catalysts have been certified by EPA for all B and C Series engine configurations.

The following configurations are covered by field fix number 226 since they are certified products that are no longer in production. The dataplate **must** be stamped with field fix number 226 (FF226) in the box that reads “Reference Number” (1) whenever a service use **only** catalyst muffler (Part Number 32434) is installed on an engine.

Engine Family	Model	CPL
403E	B5.9 - 160	1549
403G	B5.9 - 160	1968

©Cummins Inc

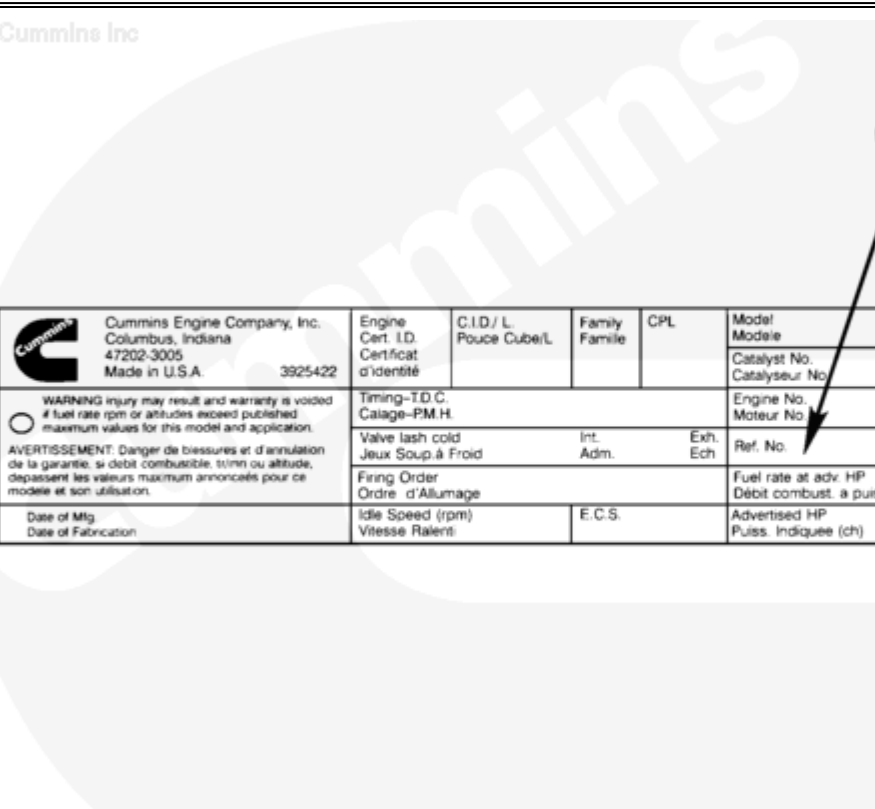

1


 Cummins Engine Company, Inc. Columbus, Indiana 47202-3005 Made in U.S.A. 3925422	Engine Cert. I.D. Certificat d'identité	C.I.D./ L. Pouce Cube/L	Family Famille	CPL	Model Modèle	FEL	EPA	CARB
	Catalyst No. Catalyseur No.					NOX		
	Engine No. Moteur No.					PM		
	Ref. No.							
	Fuel rate at adv. HP Débit combust. à puiss. indiquée					mm3 stroke		
Date of Mfg. Date of Fabrication	Idle Speed (rpm) Vitesse Ralent	E.C.S.	Advised HP Puiss. Indiquée (ch)			at à	rpm	

00900115

Automotive Engine Dataplate

1. Reference number