



Technical Service Bulletin

Technical Service Bulletin: TSB110077

Released Date: 23-Mar-2011

New C-Series Connecting Rod Assembly

New C-Series Connecting Rod Assembly

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents


This document introduces a new C Series connecting rod assembly.

The design for the new rod is very similar to the present C Series connecting rod, but a new part number was needed, due to slight differences in appearance and to improve traceability. The new connecting rod assembly, Part Number 5266243, is very similar to the present connecting rod assembly, Part Number 4947898.

The most notable difference in the new connecting rod, compared to the present C Series connecting rod, is the addition of a thermal installation process for the connecting rod small end bushing. This process is used by the supplier for the B and L connecting rods, and is expected to significantly improve small end bushing contact.

The new connecting rod assembly, Part Number 5266243, and the present connecting rod assembly, Part Number 4947898, are interchangeable and may be mixed in the same engine. Service will use a single cylinder replacement strategy for these new connecting rods.

Along with the introduction of this new connecting rod assembly, all C Series connecting rods will have an increase in final torque angle from 60 degrees to 90 degrees, yielding a higher clamping force.

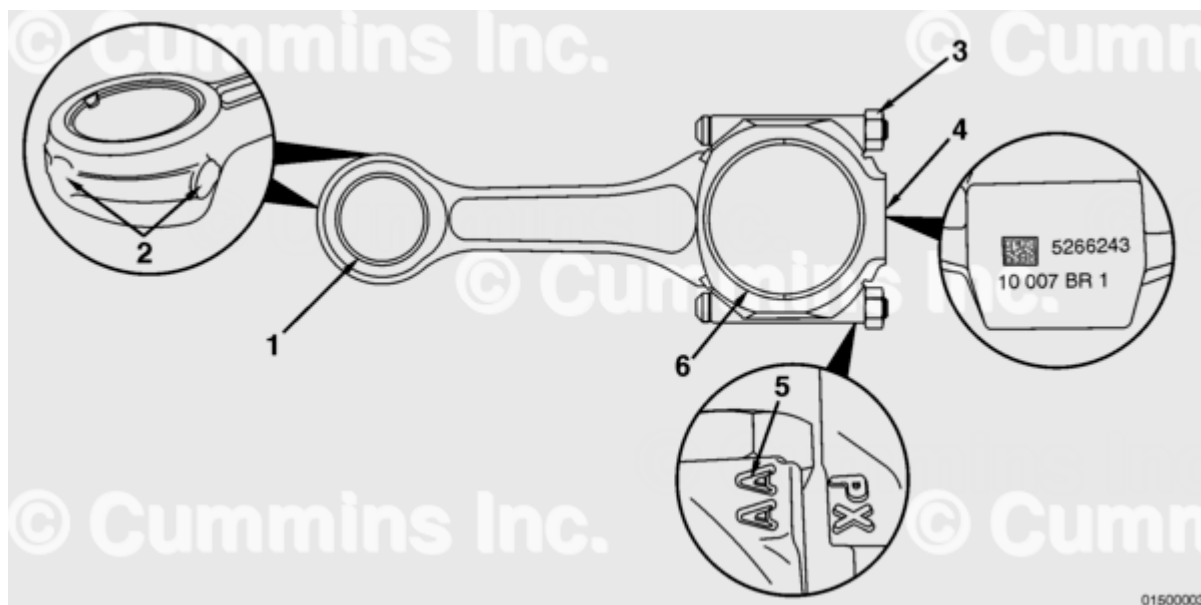

New C-Series Connecting Rod Improvements

1. Thermal assist bushing installation (**not** serviceable).
2. Machined reference pads.
3. New nut supplier (same source for rod bolt and bushing).
4. Part number barcode added.
5. Heat code changed from raised to low relief.
6. Machined split design (same as present part).

Engines families affected:

All C Series engine families.

Options affected:

PP 2236, PP 2237, PP 2995, PP 2996, PP 2997, PP 8145, PP 8146, PP 8159, PP 8161, PP 8185, PP 8211, PP 8220, PP 8222, PP 8292, PP 8307, PP 8388, PP 8418, PP 8430, PP 8494, PP 8517, PP 8535, PP 8537, PP8539, PP 8627, PP 8630, PP 8639, PP 8657, PP 8692, PP 8697, PP 8698, PP 8728, PP 8729, PP 8730, PP 8745, PP 8746, PP 8765, PP 8786, PP40303, PP40311, PP40333, PP40355, PP40667, PP40883, PP40913, PP40997, PP41101, PP41376, PP41387, PP41632, PP41738, PP42085, PP42705, PP42723, PP42735, PP43064, PP43092, PP43093, PP43153, PP43154, PP43228, PP43287, PP43325, PP43363, PP43364, PP43365, PP43366, PP48585, PP48759, PP43105.

The option number can be found in the parts catalog option list found on the parts page on QuickServe™ Online.

Document History

Date	Details
2011-3-16	Module Created

Date	Details
2011-3-23	QSOL Quick Fix Reason: Outfile Notes: none

Last Modified: 23-Mar-2011
