



Technical Service Bulletin

Technical Service Bulletin: TSB180087

Released Date: 10-Jul-2018

New Junction Box

New Junction Box

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- NH, NT / PT Fixed Time
- NTA855

Reason for Change

Wire insulation can malfunction because of contact with junction box front cover plate. This can lead to electrical system shorting and other component damage.

Description of Change

- Width increased by 30mm [1.18 in] for clearance between harness and front cover plate.
- Addition of 12mm +/- 1 mm [0.5 in] thick plain foam (Firend TB 070) on inside of front cover plate, with self-adhesive backing.

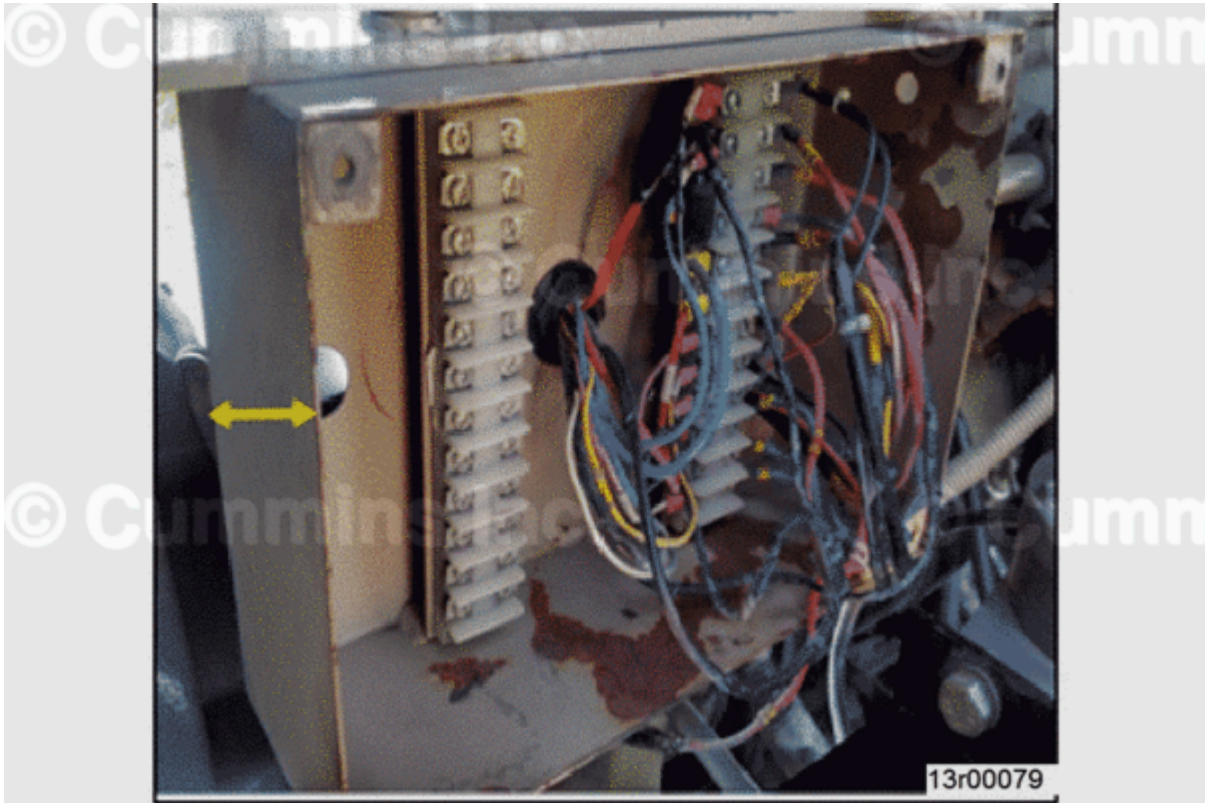


Figure 1, Old Box Junction Width – 89mm [3.5 in]

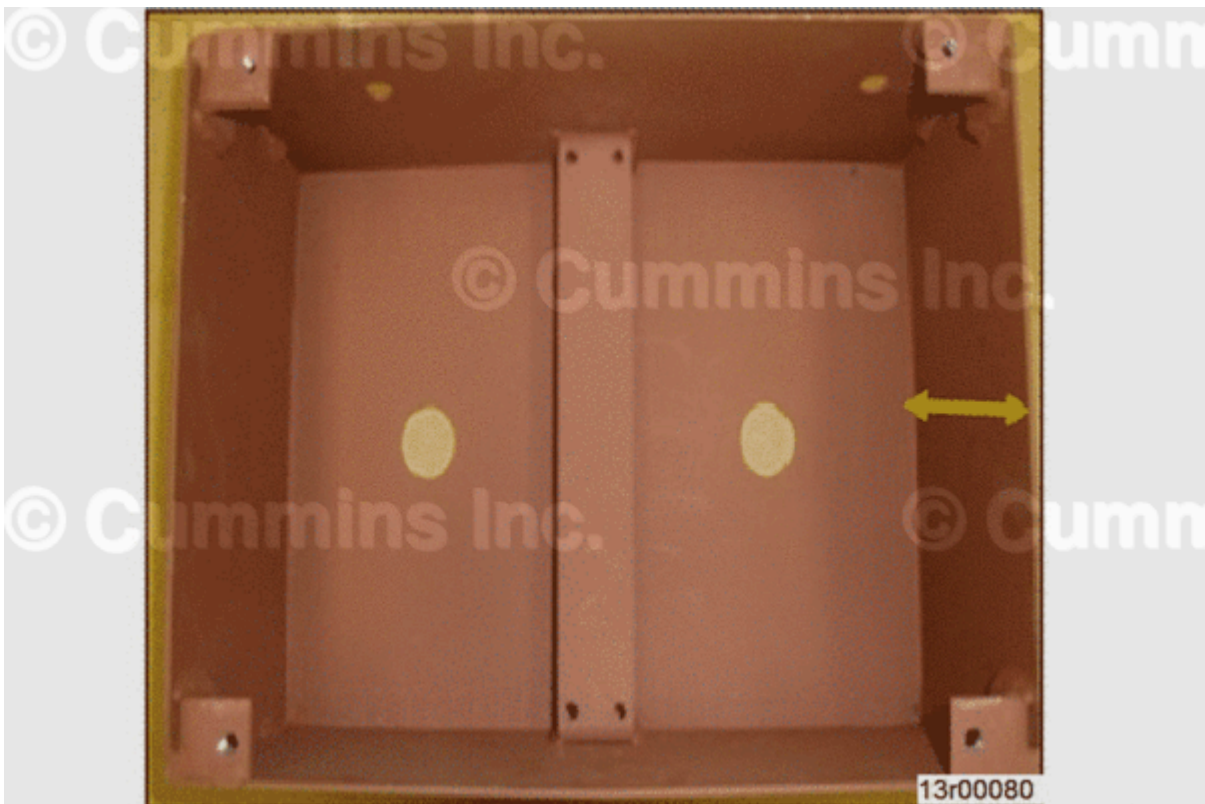


Figure 2, New Box Junction Width – 119mm [4.7 in]



Figure 3, Old Cover Plate Without Foam



Figure 4, New Cover Plate with Firend TB 070 Foam

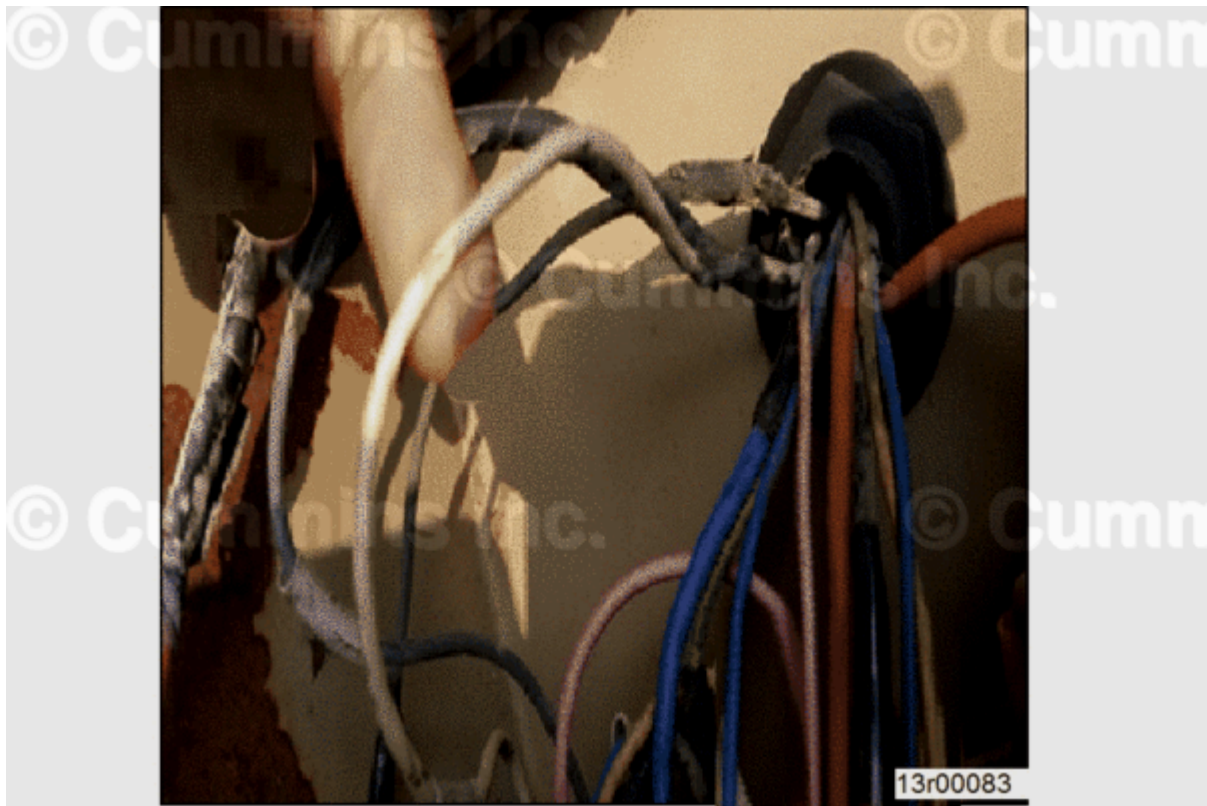


Figure 5, Wires Losing Insulation

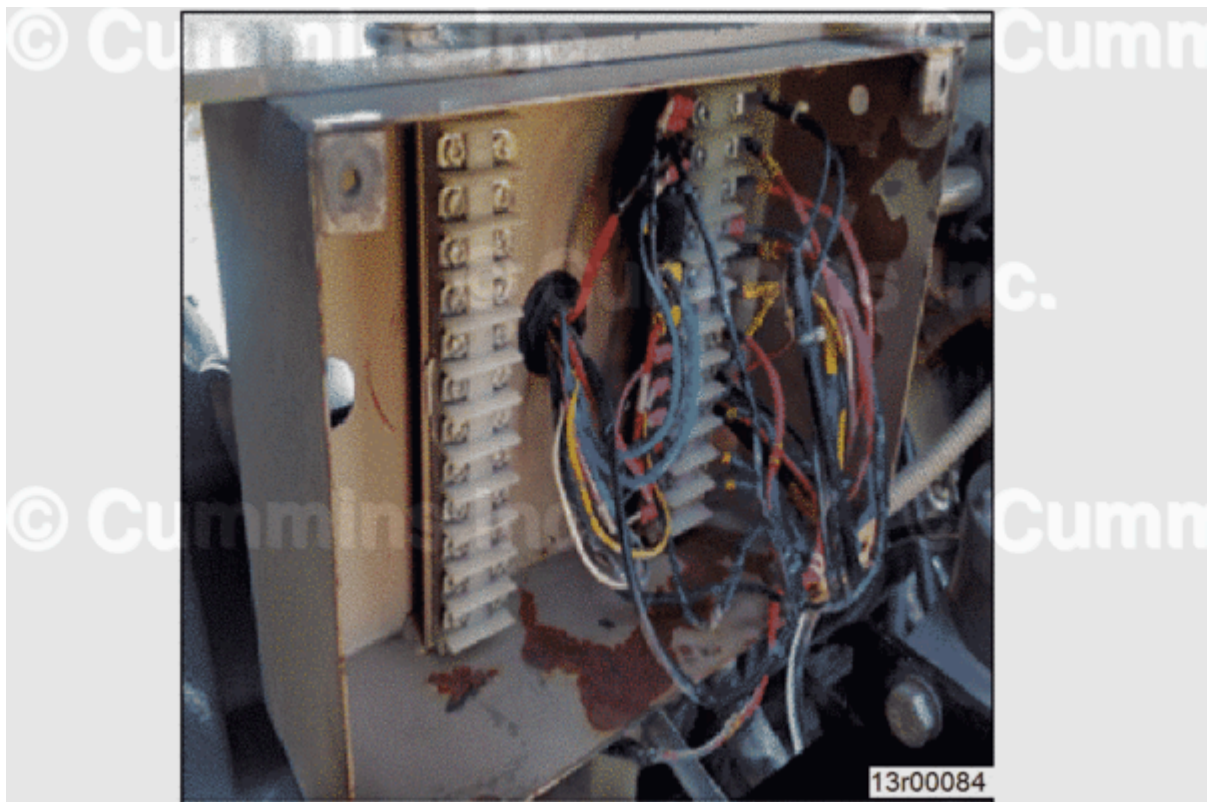


Figure 6, Lack of Clearance Between Wires and Cover

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Box Junction	5278518	No	Yes	4398425
Part Compatibility				
These parts cannot be mixed within the same engine.				
Production Status				
Table 2, Production Information				
ESN First		Build Date ¹	Plant	
25435082		7 March 2018	CIL, KEP	
¹ Engine build date can be found on the engine data plate.				

Document History

Date	Details
2018-6-20	Module Created
2018-7-10	Added "NH, NT / PT Fixed Time" to Product Affected section