



Technical Service Bulletin: TSB180174

Released Date: 09-Aug-2019

Thin Wall Block Condition

Thin Wall Block Condition

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK19 CM500
- QSK19 CM850
- QSK19 CM2150

Issue

Coolant leaks from the cylinder head gasket cylinder number 1 forward coolant port.

Symptom:

- Coolant leak from cylinder number 1 cylinder head gasket forward coolant port.

Root Cause:

- Casting variation of cylinder block resulting in a thin cylinder block wall next to cylinder number 1 forward coolant port.

Verification

- Confirm leak location is cylinder number 1 forward coolant port. See Figure 1 below.
- After removing cylinder head, measure cylinder block wall thickness between coolant drilling and outer edge of cylinder block. Use calipers to measure cylinder block wall thickness. See Figure 2 below.

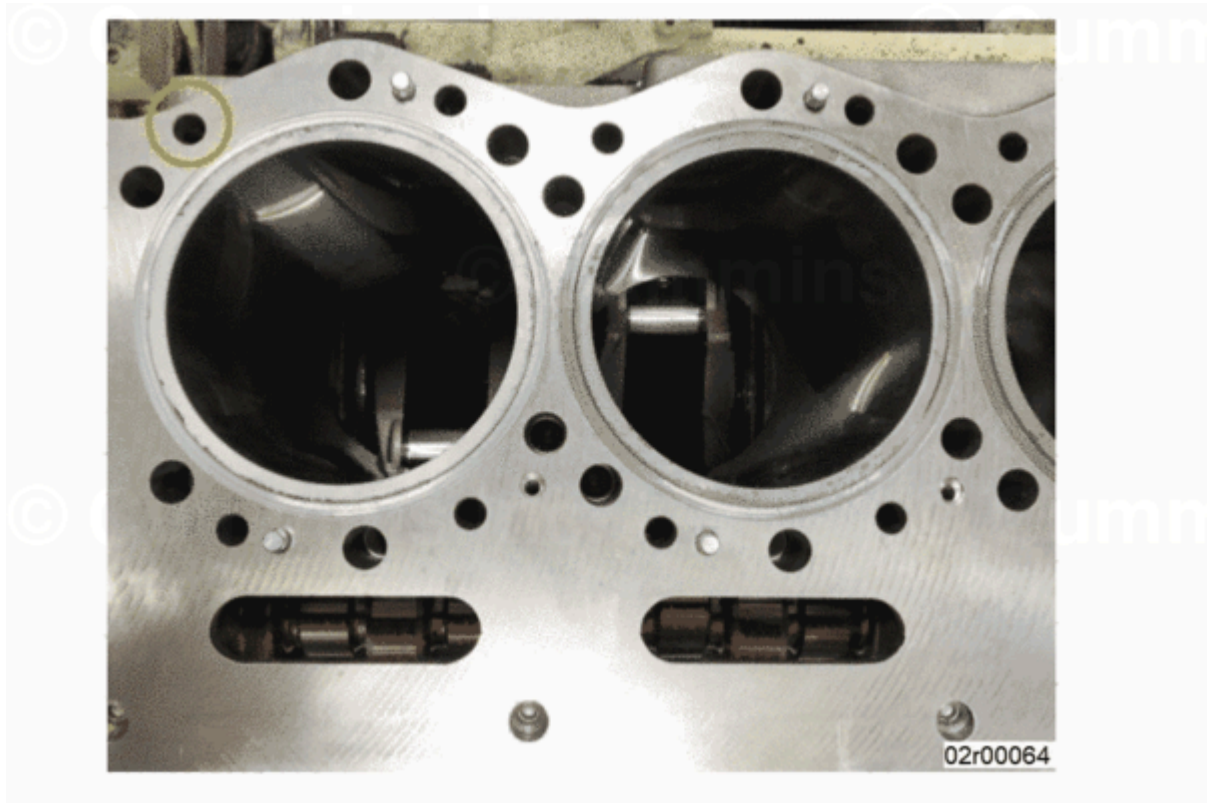


Figure 1, Coolant Port Measurement Location.



Figure 2, Use Calipers to Measure Cylinder Block Coolant Port Wall Thickness.

Resolution

Replace cylinder head gasket.

Service Instructions

- Industrial application cylinder blocks with a measurement between 3.25mm [0.128in]and 5mm [0.197in] use head gasket Part Number 3634664.
- Rail application cylinder blocks with a measurement between 4.25mm [0.167in] and 5mm [0.197in] use head gasket Part Number 3634664.
- For cylinder blocks with a measurement of over 5mm, use cylinder head gasket Part Number 4334080.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
GASKET,CYLINDER HEAD	3634664	No	No	-
GASKET,CYLINDER HEAD	4334080	No	No	-

Document History

Date	Details
2018-12-7	Module Created