



Technical Service Bulletin

Technical Service Bulletin: TSB200114

Released Date: 01-Jun-2020

New Gear Cover Spacer Plate Gasket

New Gear Cover Spacer Plate Gasket

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- K19
- QSK19 CM2150
- QSK19 CM2350 K105
- QSK19 CM2350 K114
- QSK19 CM500
- QSK19 CM850

Description of Change

New gasket is more robust against oil leaks and provides common gasket between K19 and QSK19 engines.

Reason for Change


Increased gasket retainer height prevents rubber bead from tearing while maintaining sealing pressure.

Service Instructions

New and existing part numbers are backwards compatible.

For K19 engines:


- Gear cover spacer plate gasket is **not** modified. See Figure 1 below.

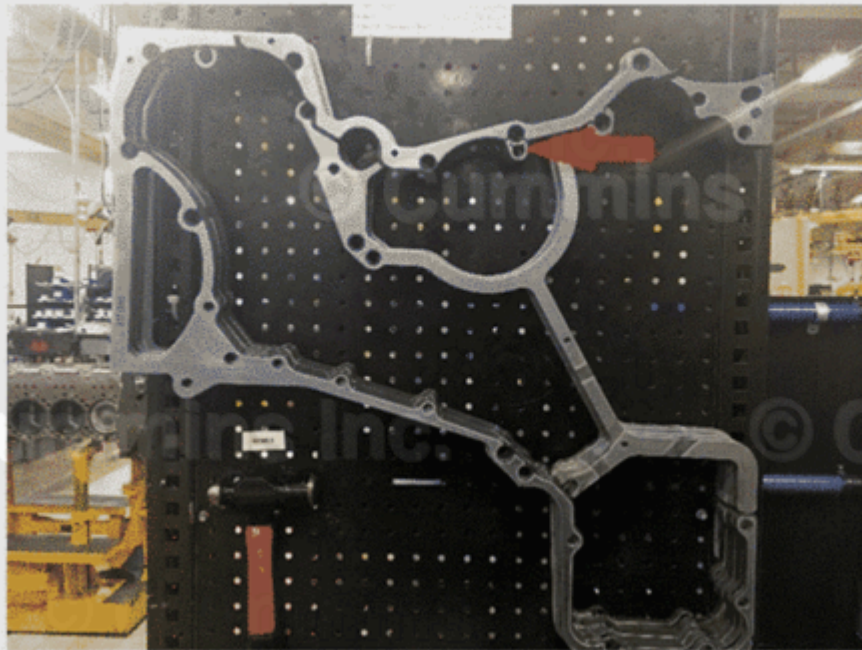

00r00446

For QSK19 engines:

- Tab **must** be removed by cutting along pre-scored marks. See Figure 2 below.

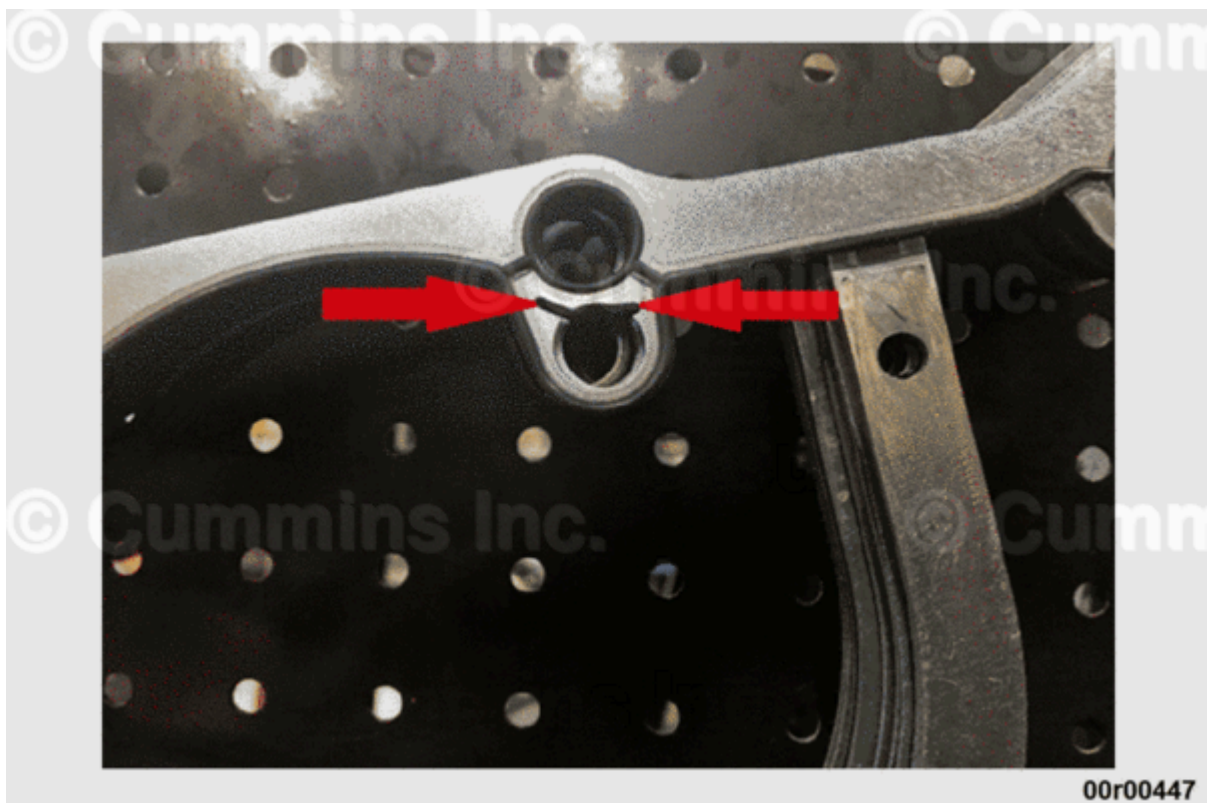

00r00447

Service Parts Availability Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Gear Cover Plate Gasket	4371880	Yes	Yes	5483654

Production Status

Implemented for production. See Table 2.

Table 2, Production Information		
ESN First	Build Date ¹	Plant
37274358	28-February-2018	CIC - Industrial Center
¹ Engine build date can be found on the engine dataplate.		

Document History

Date	Details
2020-5-13	Module Created