



Technical Service Bulletin: TSB210206

Released Date: 05-Jan-2023

Steel Lubricating Oil Pan Adapter Cover Cracks: Lubricating Oil Leaks

Steel Lubricating Oil Pan Adapter Cover Cracks: Lubricating Oil Leaks

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK19 (All Versions)

Issue Summary

Symptom:

- Lubricating oil leak

Root Cause:

- Cracks in steel lubricating oil pan adapter cover

Verification

Verify lubricating oil leakage from steel lubricating oil pan adapter cover, Part Number 3070780. See Figure 1 and 2 below.



Figure 1, Evidence of Lubricating Oil Leak From Steel Lubricating Oil Pan Adapter.



Figure 2, Crack Along Steel Lubricating Oil Pan Adapter Flange.

Resolution

- If the steel lubricating oil pan adapter cover, Part Number 3070780, is cracked; replace lubricating oil pan adapter cover with aluminum lubricating oil pan adapter cover, Part

Number 207306.

- See Figure 3 below for a side by side comparison of each type of lubricating oil pan adapter cover.
- When using aluminum lubricating oil pan adapter cover, Part Number 207306, install the following:
 - New gasket, Part Number 3073213
 - Quantity 18 of new capscrew, Part Number 3035624. Torque to 47 N•m [35 lb-ft] using torque sequence in Figure 4 below
 - Quantity 1 of washer, Part Number 67946
 - Quantity 1 of threaded plug, Part Number 3055069. Torque to 54 N•m [40 lb-ft]



Figure 3, Comparison of Lubricating Oil Pan Adapter Cover. Left: Steel, Right: Aluminum.

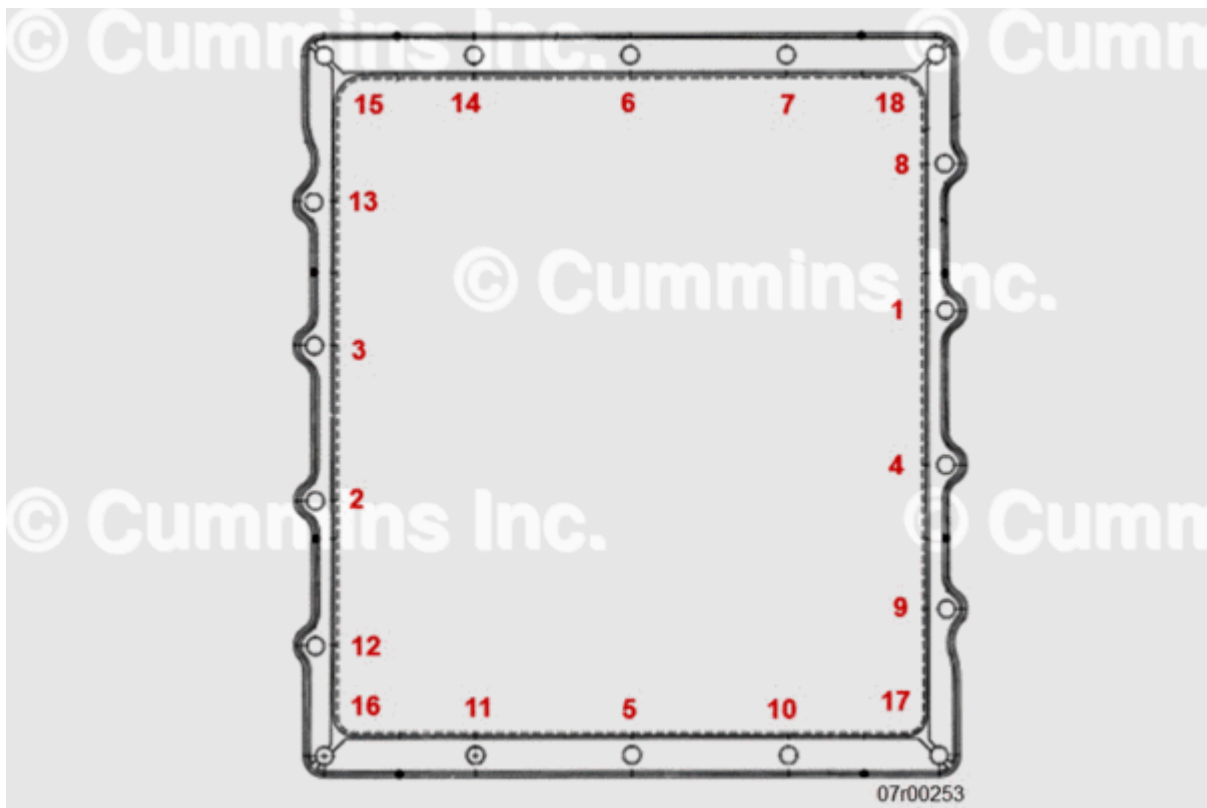


Image 4, Aluminum Lubricating Oil Pan Adapter Cover Torque Sequence.

Service Instructions

Service parts are available. See Table 1 below for part numbers.

Table 1, Service Parts

Part Description	Steel Lubricating Oil Pan Adapter Cover Part Numbers	Part Quantity	Aluminum Lubricating Oil Pan Adapter Cover Part Numbers
COVER, LUBRICATING OIL PAN ADAPTER	3070780	1	207306
GASKET, ADAPTER	3073213	1	3073213
SCREW, CAPTIVE WASHER CAP	3040838	18	3035624
WASHER, PLAIN	-	1	67946
PLUG, THREADED	-	1	3055069

Production Status

Implemented for production. See Table 2 below.

Table 2, Production Information		
ESN First	Build Date ¹	Plant
37285519 ²	14 September 2021	Seymour Engine Plant
¹ Engine build date can be found on engine dataplate. ² For engine with lubricating oil pan options OP4120 and OP4079. Engines with other lubricating oil pan option may still use the steel lubricating oil pan adapter cover.		

Document History

Date	Details
2021-9-22	Module Created
2022-11-29	Updated Table 2.