



Technical Service Bulletin

Technical Service Bulletin: tsb020016	Released Date: 17-Oct-2002
Engine Lube Pump Suction Head to Housing Gasket	

Engine Lube Pump Suction Head to Housing Gasket

Core Issue

It has been found that on some QSK45, QSK60, and QSK78 engines the torque on the capscrews that hold the engine lube pump suction head to the housing do **not** meet specifications. This early warning instructs the technicians to check the torque on these bolts, if the oil pan is being removed for another reason.

Confirmation

All QSK45, QSK60, and QSK78 engines.


Low or erratic oil pressure.

The capscrews that hold the engine lube pump suction head to the housing do **not** meet the 47 N•m [35 ft-lb] specification.

The gasket between the engine lube pump suction head and housing is crushing, and the capscrews are losing some of their torque.

If the torque is completely lost, the engine lube pump could lose suction, causing a loss of engine oil pressure.

Resolution

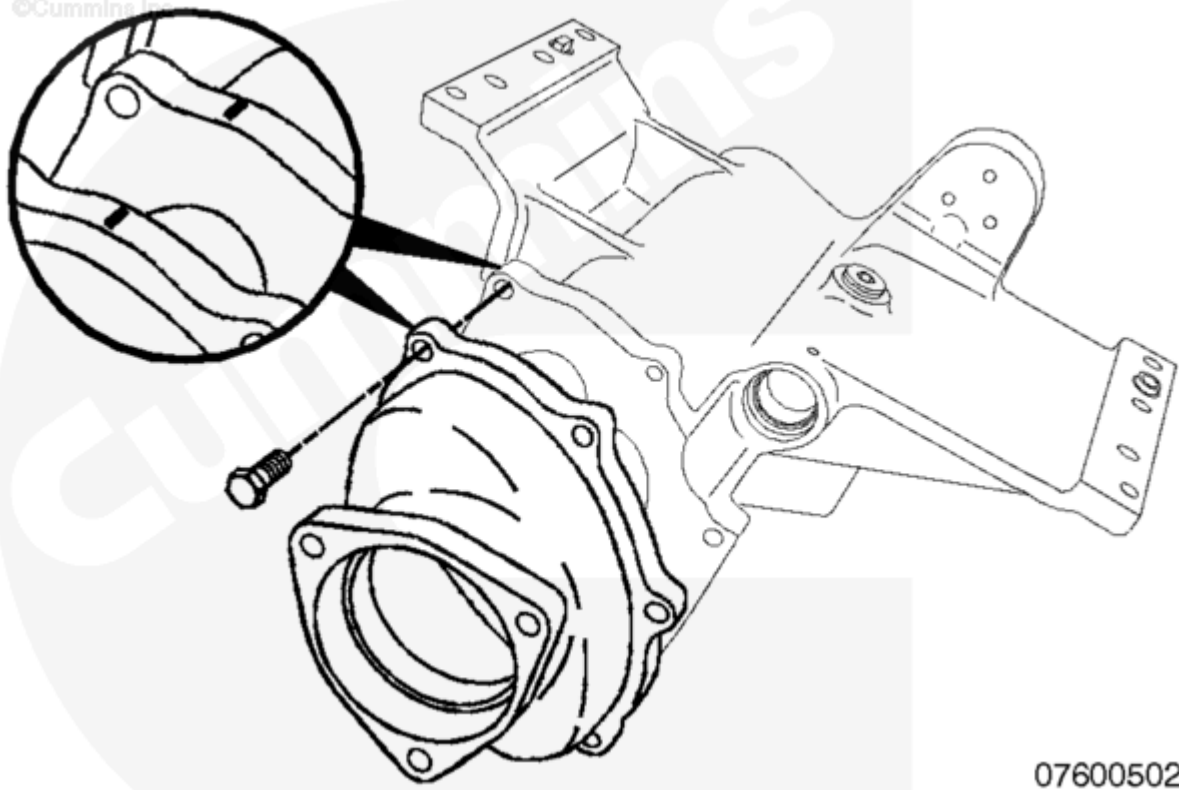

07600502

Torque the engine lube pump suction head to housing capscrews to specification.

Torque Value: 47 n·m [35 ft-lb]

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Last Modified: 17-Oct-2002
