



Technical Service Bulletin

Technical Service Bulletin: tsb100049	Released Date: 18-Jun-2010
Front and Rear Crankshaft Seal Leaks	

Front and Rear Crankshaft Seal Leaks

Core Issue

There have been a number of front and rear crankshaft seal leaks on QSK45/60/78 engines in production test. The cause of the leak has been determined to be a manufacturing issue with the seal. The affected seals are from specific batch numbers. These numbers have been identified and are shown below. All seals with the batch numbers shown below **must** be removed from parts distribution centers (PDC) and distributor stock in order to prevent repeat malfunctions in the field. This issue was found during production testing and few, if any, seals were installed on production engines.

Confirmation

QSK45 CM500

QSK60 CM500, CM850, CM2150

QSK78 CM500

If a seal from one of the batches has been used on an engine, it may result in a low hour oil leak from the seal. **Only** seals that match the date codes below should be removed from stock.

If it is suspected that a crankshaft seal matching these batch numbers has been installed on an engine it is recommended that the engine's oil level is monitored closely.

Crankshaft seals that match the part number and the batch numbers shown below should be removed from stock and **not** used on any engine.

Front crankshaft Seal Batch Numbers (Part Number: 4100624)

- 09-131
- 09-280
- 09-323

Rear crankshaft Seal Batch Numbers (Part Number: 4100625)

- 09-196
- 09-133


The suspected cause of the seal leaks is a supplier quality issue, which has been corrected.

There is no progressive damage to the engine if a seal from one of the mentioned batch numbers is installed. However, it could result in extensive down time while the seal is changed.

Resolution

All stock of crankshaft seals **must** be checked against the batch numbers listed. If any seals match the batch numbers they **must** be removed from stock and **not** used.

Return the seals that match the batch numbers to PDC where they were purchased, referencing the Parts Alert Number 012-10.

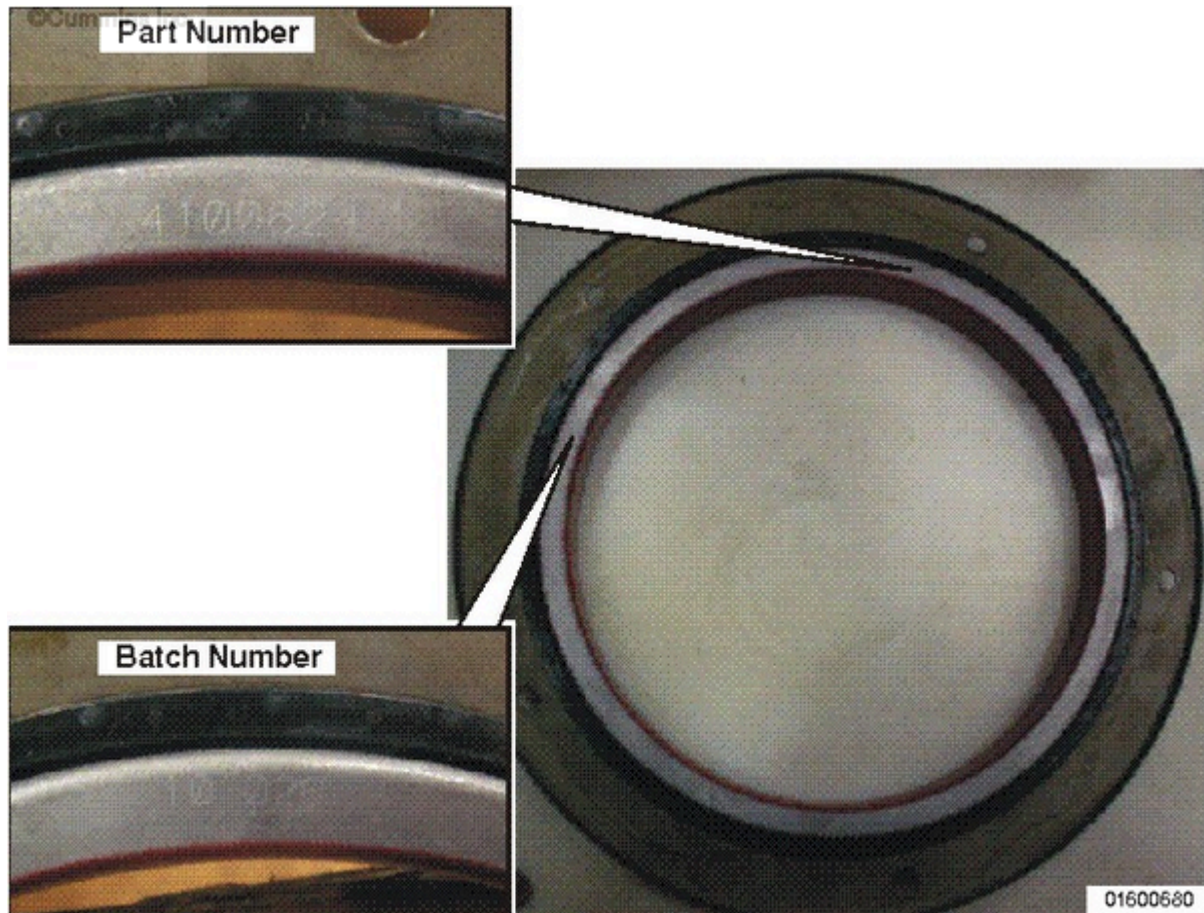

Location of Part Number and Batch Number on the Seal

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.