



# Technical Service Bulletin

Technical Service Bulletin: tsb100125

Released Date: 28-Nov-2001

Gear Cover Bushing Installation Instructions

## Gear Cover Bushing Installation Instructions

### Warranty Statement


The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

### Contents

This Technical Service Bulletin introduces the new front support trunnion for the QSK45 and QSK60 Series engines. This Technical Service Bulletin also revises Procedure 001-031, Front Gear Cover, for the Troubleshooting and Repair Manual, QSK45 and QSK60 Series Engines, Bulletin 3666217. The new trunnion, Part Number 4066304, is cast-steel design and was first used in production on engine serial number first 33148569.

To fit this trunnion to engines using the previous design, you **must** change the wear sleeve fitted to the front gear cover. The new wear sleeve, Part Number 4065741, has different dimensions and uses a harder material.

The grease fitting (1) has been moved to the lower left-bank side of the trunnion.

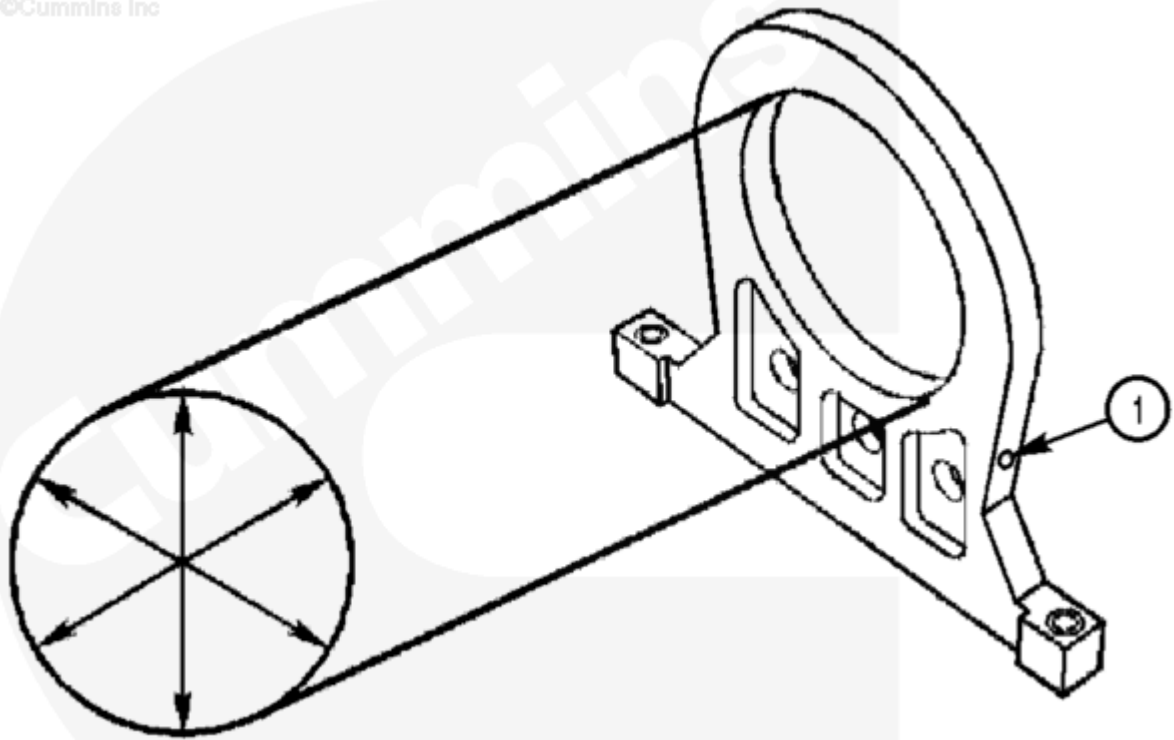

01600233

Fig. 1, Front Support Trunnion with New Grease Fitting Location (1)