



Technical Service Bulletin: tsb100158

Released Date: 23-Apr-2002

New Alternator Belt Tensioner And New Belt Material

New Alternator Belt Tensioner And New Belt Material

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin introduces a new design alternator belt tensioner, and a new alternator belt material for the QSK45 and QSK60 series engines.


The old alternator belt, Part Number 3171732, is made of reinforced neoprene and is susceptible to cracking on construction applications. The new belt is constructed from a hybrid 'Orion QT' neoprene, alkylated chlorosulphonated polyethylene material. The new belt Part Number is 4066750.

This change went into production at the Daventry Engine Plant on October 1, 2001. Engine serial number first is 33150722.

The old design alternator belt tensioner is Part Number 4000980. This design was experiencing bearing and bushing wear, due in part to ingress of dirt. The new belt tensioner, Part Number 4086084, provides three times improvement in life expectancy. The new design has two main new features:


1. A cast shield to protect the bearing from dirt ingress.
2. A T-profile spring bushing and labyrinth damper seal to prevent dirt ingress to bushing wear areas.

This change went into production at the Daventry Engine Plant on February 25, 2002. Engine serial number first is 33151516.

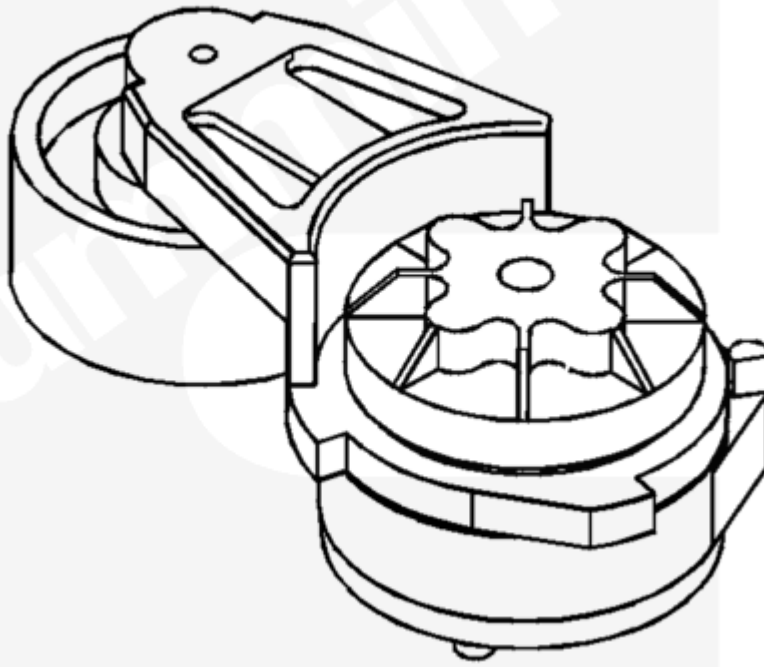

13600027

Old Belt Tensioner (4000980)

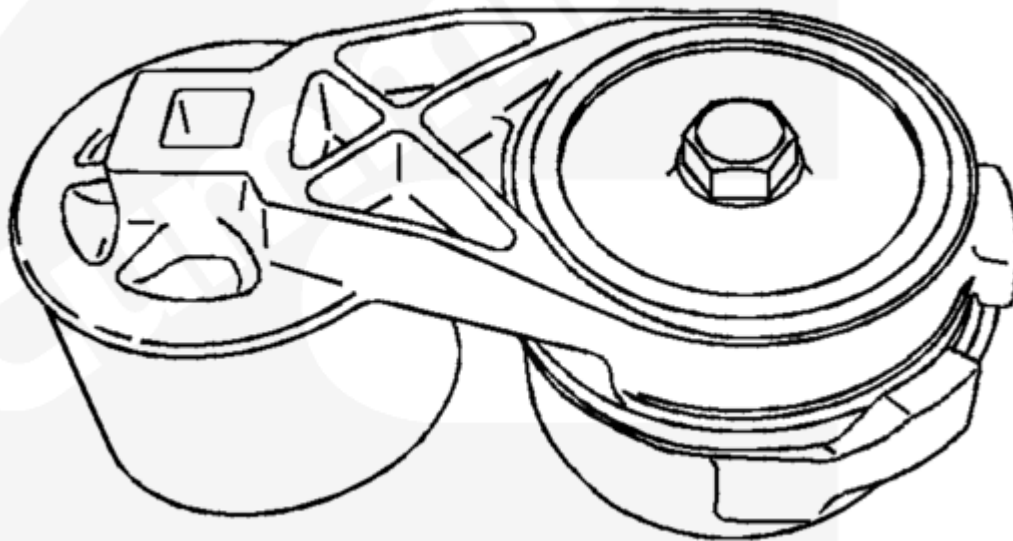

13600028

New Belt Tensioner (4086084)

Note : This is a product improvement and is **not** subject to campaign.

