



Technical Service Bulletin

Technical Service Bulletin: tsb100162

Released Date: 09-May-2002

LTA and Intercooler Tube O-Ring

LTA and Intercooler Tube O-Ring

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin is to introduce a new LTA and intercooler tube o-ring, Part Number 4066112, for QSK60 Industrial and Power Generation engines. The new o-ring is a Viton/EPDM blend, which is a material that offers resistance to swell without the long term decomposition associated with the contact with coolant.

This change went into production at the Daventry Engine Plant on 23-Apr-2001. The approximate ESN first is 33149297.

New Part Number	Quantity	Description	Old Part Number	Quantity	Description
4066112	1	Seal, O-Ring	3175545	1	Seal, O-Ring

⚠ CAUTION ⚠

Do not use petroleum-based oil when installing the new o-ring. The use of petroleum-based oil will cause swelling of the o-ring. Use vegetable oil to lubricate the o-ring.

The new o-ring is available for new engine production and service.

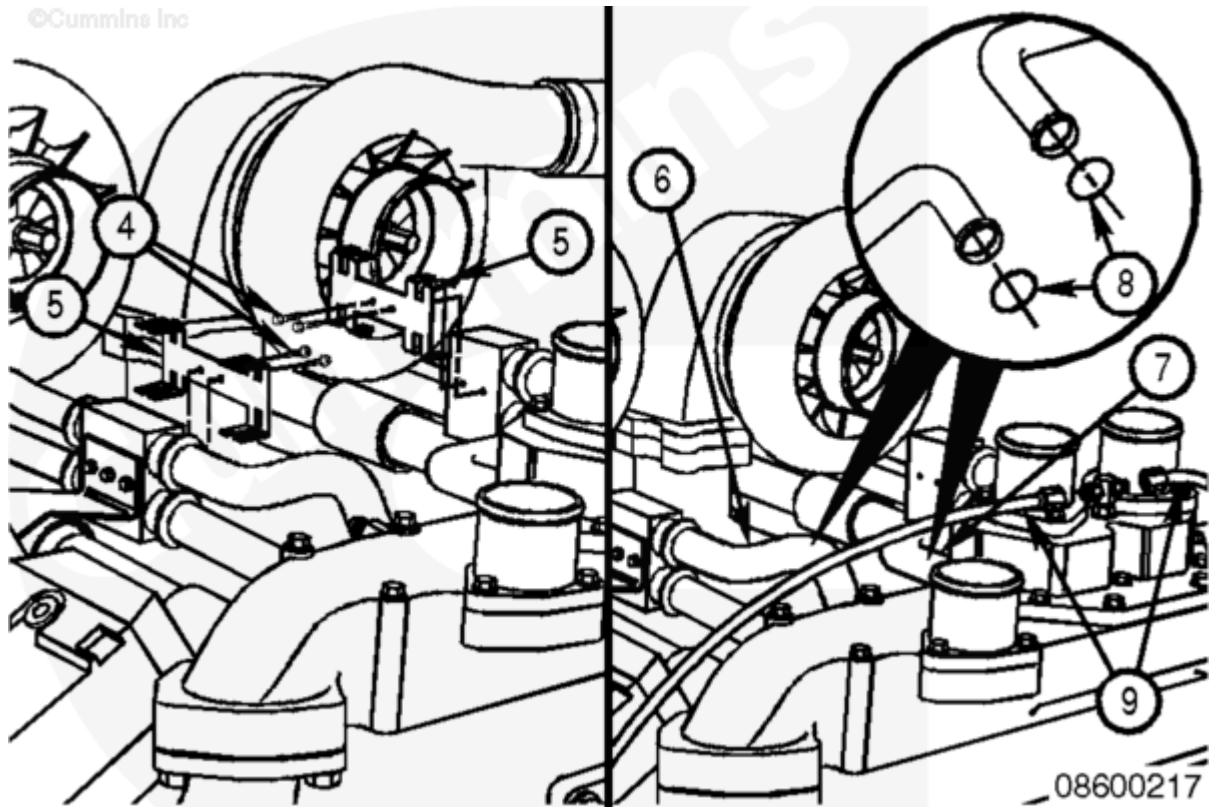


Figure 1

Note : This is a product improvement not subject to campaign.