



Technical Service Bulletin

Technical Service Bulletin: tsb100164

Released Date: 23-May-2002

HX82 High Pressure Turbocharger Improvement

HX82 High Pressure Turbocharger Improvement

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin announces the release of a new HX82 turbocharger service kit, Part Number 4089126. The turbocharger has a new turbine housing, designed to eliminate cracking at the exhaust mounting flange due to thermal fatigue.

Note : The complete turbocharger can only be purchased as part of the service kit, although the new turbine housing (Part Number 3597922), is available individually.


Table 1, Part Number Changes

Description	New Part Number	Old Part Number
Turbocharger Service Kit	4089126	3800691
Turbocharger Turbine Housing	3597922	3539766

Note : When replacing the turbine housing, the capscrews, lockplates and exhaust flange gasket must be changed. These parts must be ordered in addition to the turbine housing.

Table 2, Additional Parts

Description	Part Number	Quantity
Screw, Hexagon Head Set	3521225	8
Lockplate	3522904	4
Screw, Hexagon Flange Head Cap	4000837	4
Gasket, Turbocharger	4065615	1

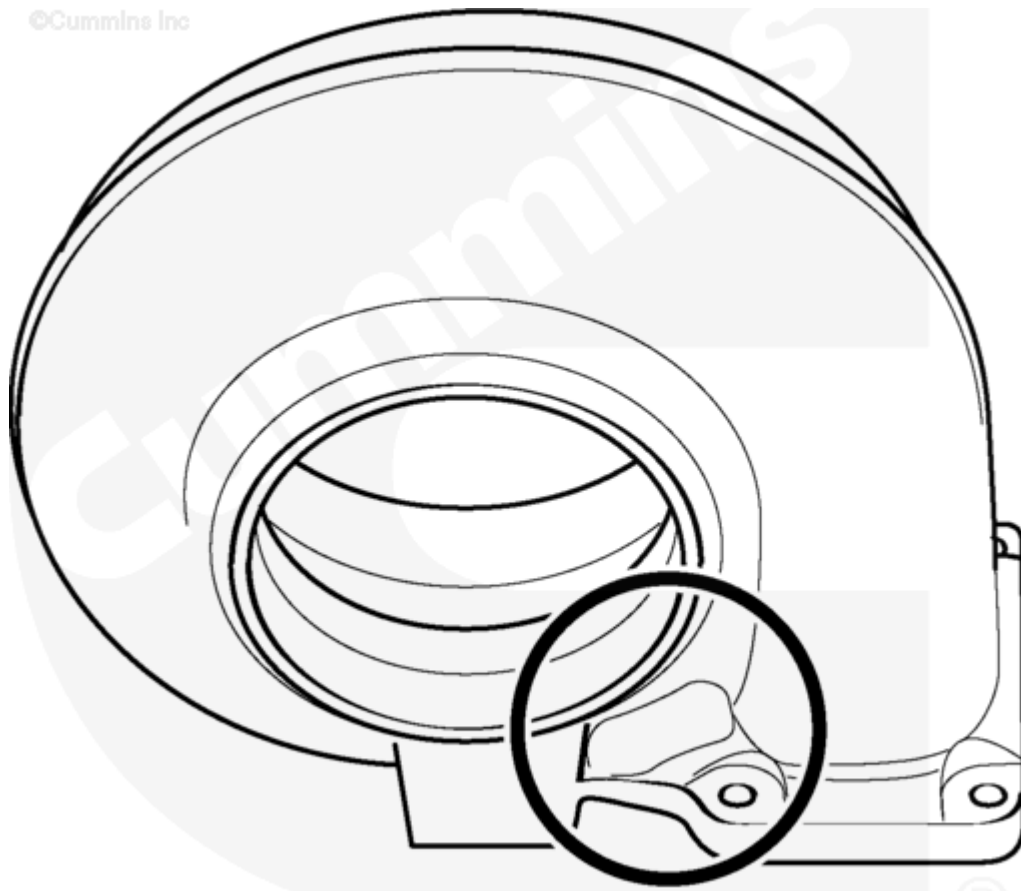

10600211

Fig 1, New Design Turbocharger Housing. Note the casting change at the exhaust mounting flange.

The new turbocharger went into production at the Daventry Engine Plant, during November 2001, with engine serial number first 33150955.

Note : This is a product improvement and is not subject to campaign.