



Technical Service Bulletin

Technical Service Bulletin: tsb100179

Released Date: 28-Aug-2002

New Crankshaft Thrust Bearing Design

New Crankshaft Thrust Bearing Design

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This service parts/topic introduces changes to the QSK45 and QSK60 crankshaft thrust bearing design.

Changes have been made to the thrust bearing design to increase fatigue strength and also to fail-safe the thrust bearing from incorrect installation.


To improve the fatigue strength a different material has been used in conjunction with a change to the thrust bearing face geometry. To fail-safe the thrust bearing from incorrect installation a change has been made to the area of the thrust bearing that overlaps.

Figure 1 shows the two halves together, figure 2 shows the old design of thrust bearing in the overlap area. Figure 3 show the new design of thrust bearing in the overlap area.

The new design is backward/forward compatible and obsoletes the old thrust bearings.


Part Numbers

Descriptions	Old Part Number	New Part Number
Thrust Bearing (Std.)	4017080	4007569

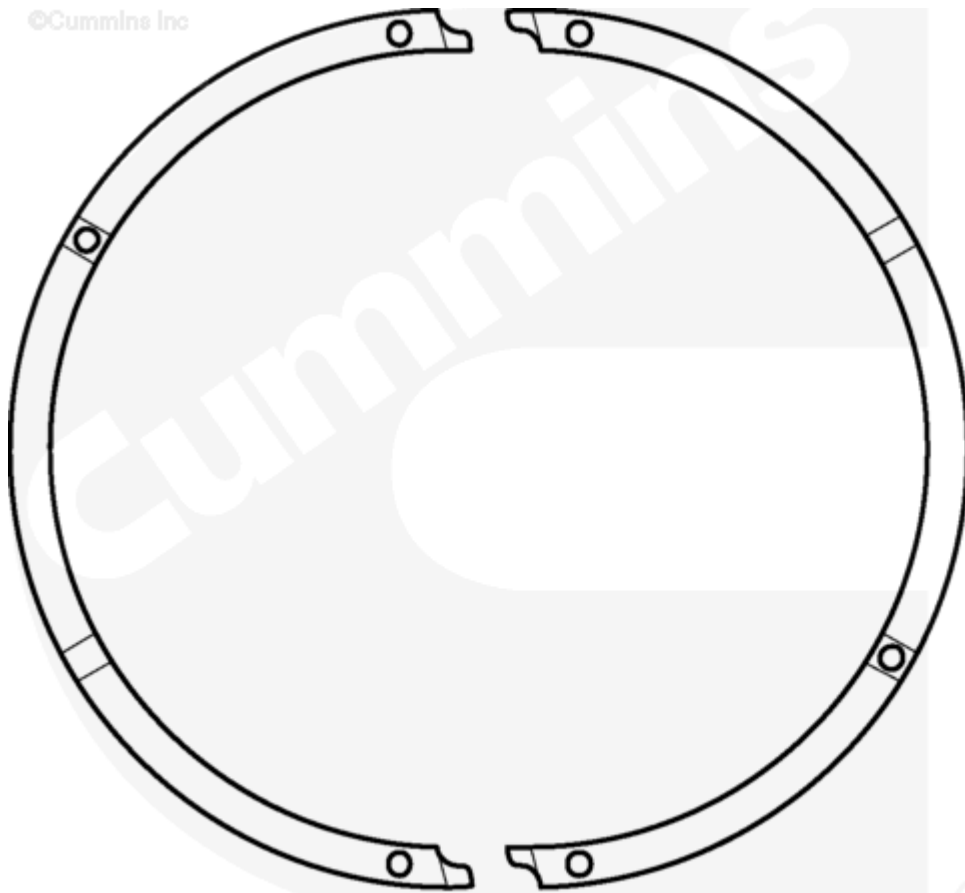

® 01600239

Fig. 1.

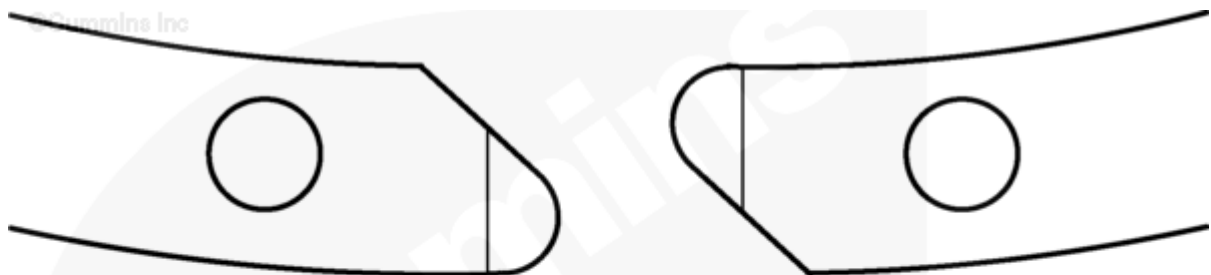

01600240

Fig. 2. Old Design.

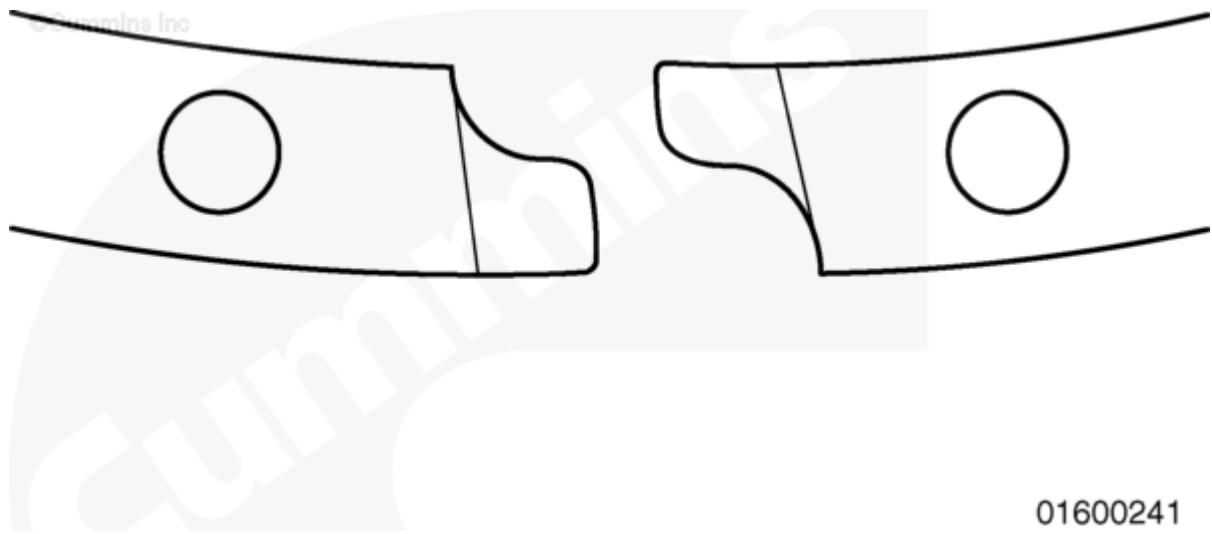


Fig. 3. New Design.

This change went into production at the Daventry Engine Plant with engine serial number first 33151998.

Note : This is a product improvement and is not subject to campaign.