



Technical Service Bulletin

Technical Service Bulletin: tsb100204

Released Date: 27-May-2003

LTA Junction Block Pipe Support Brace.

LTA Junction Block Pipe Support Brace.

Warranty Statement


The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

The purpose of this topic is to inform the field of the introduction and of an LTA (Low Temperature Aftercooler) pipe support brace, designed to help prevent water leakage from the LTA junction block located on the left bank Number 1 rocker housing on QSK45/60 engines. The junction block bracket has been stiffened to improve its rigidity, and a brace and U-bolt clamp has been incorporated to improve the pipe to junction block joint integrity.

Table 1 - Parts

Item	Qty	P/N	Description
1	1	4100907	Bracket, Connection
2	1	4100806	Brace, Tube
3	1	4007584	Clamp, U Bolt
4	4	3902460	Capscrew
5	2	3900629	Capscrew
6	2	4007602	Nut

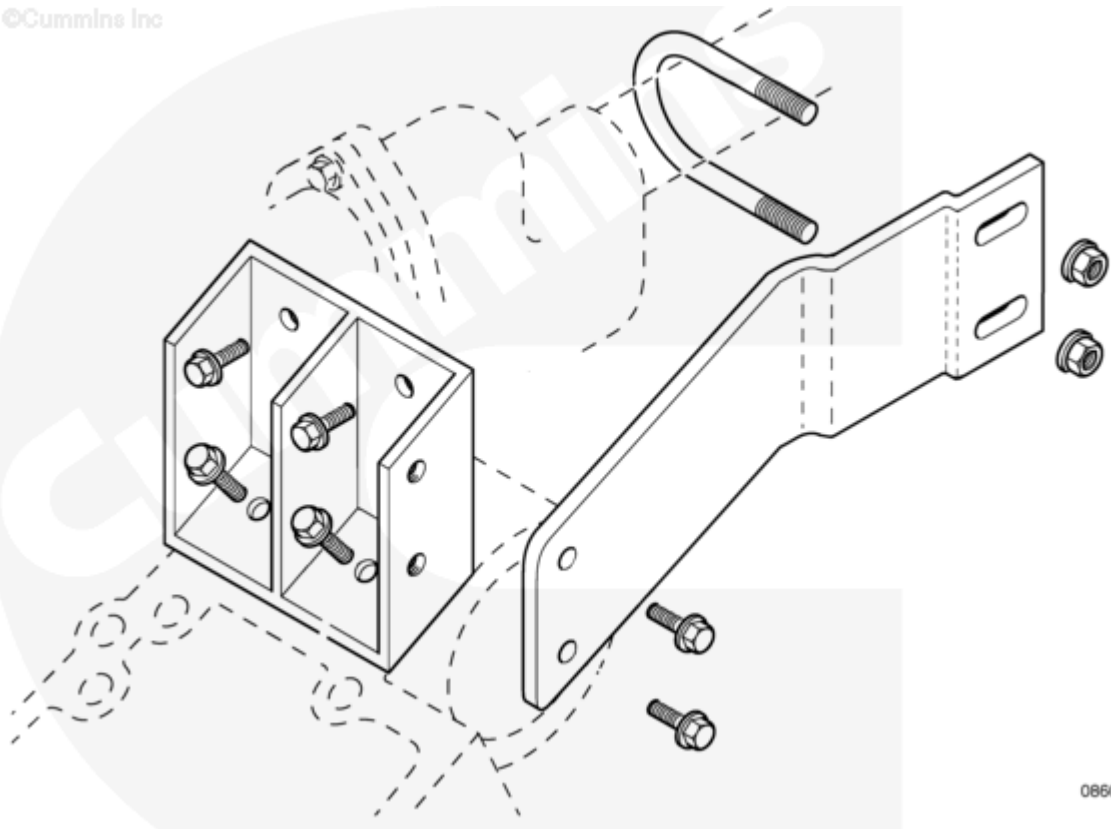

08600393

New LTA junction block support bracket with pipe support brace.

Note : This is a product improvement and not subject to campaign or TRP.

Last Modified: 27-May-2003
