



Technical Service Bulletin

Technical Service Bulletin: tsb100214

Released Date: 19-Jun-2003

New Engine Speed Sensor and Jumper Harness

New Engine Speed Sensor and Jumper Harness

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents


The purpose of This Technical Service Bulletin is to introduce a new engine speed sensor on the QSKV industrial and genset products.

The old sensor has two sets of two exposed lead wires coming from the sensor and terminating into individual 2-pin connectors. The improved design encloses all four leads with convolute and terminates them into a single 4-pin connector.

The old sensor part number has been obsoleted. A jumper harness is required when replacing an older sensor with the new design. The jumper harness adapts the single 4-pin connector on the new sensor to the two individual 2-pin connectors on the harness. The jumper harness is **not** required when replacing sensors on engines built with the new foam-filled metallic harness, which is often referred to as the Phase 2 harness.

Engine Speed Sensor Parts Matrix

Old Sensor Part Number	New Sensor Part Number	Engine	Description	Jumper Harness Part Number
3865349	3408472	QSK45/60	3 inch body	3408526
3865350	3408471	QSK45/60/78	5 inch body	3408526

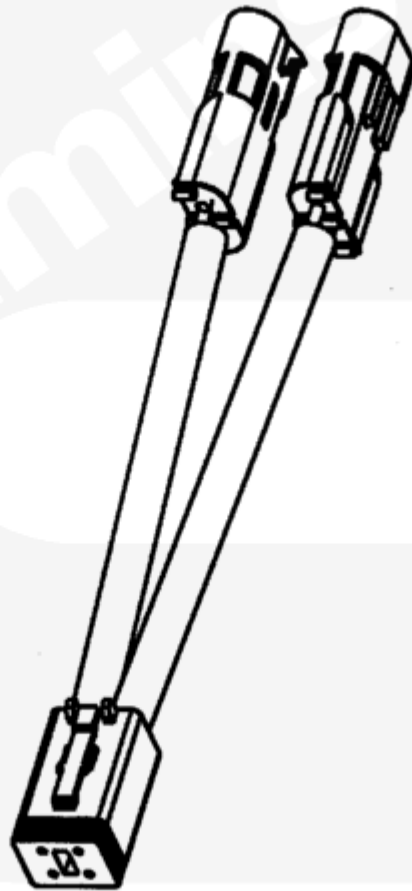

19600435

Adaptor Jumper Harness (Part Number 3408526)

Note : This is a product improvement and is **not** subject to campaign.