



Technical Service Bulletin

Technical Service Bulletin: tsb100216

Released Date: 14-Jul-2003

Introduction of New Fuel Filter Head Outlet Fitting with Check Valve for QSK45, QSK60, and QSK78 Engines

Introduction of New Fuel Filter Head Outlet Fitting with Check Valve for QSK45, QSK60, and QSK78 Engines


Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin introduces a new fuel filter head outlet fitting with an internal check valve, Part Number 4086602, for QSK45, QSK60, and QSK78 engines.

©Cummins Inc

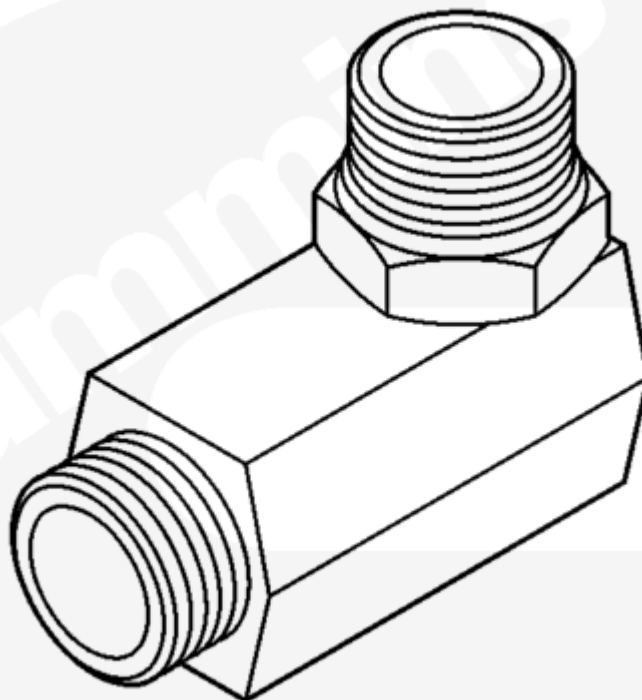

05600156

The new fuel filter head outlet fitting with an internal check valve can **only** be used with the new number 20 SAE size fuel line and the corresponding fuel pump inlet connection.

Description	Part Number
Valve, check	4086602
Hose, flexible	4007058
Elbow, male adapter	4007074

The hard starting failure mode is associated with the current fuel filter head outlet fitting. This is due to fuel in the fuel line draining back into the fuel filters. When this occurs, the engine will experience a hard starting condition. The check valve holds the fuel in the fuel line between the fuel filter head and the fuel pump.

The old fuel filter head outlet fitting, Part Number 3332349, is now being obsoleted and superseded to the new fuel filter head outlet fitting. The new fuel filter head outlet fitting with internal check valve was made an option for production at the Daventry Engine Plant in January 2003.

Note : This is a product improvement and is not subject to campaign.

Last Modified: 14-Jul-2003
