



Technical Service Bulletin

Technical Service Bulletin: tsb100239

Released Date: 15-Oct-2003

New Cylinder Head Casting and Valve Rotator

New Cylinder Head Casting and Valve Rotator

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents


This Technical Service Bulletin introduces changes to the QSK45 and QSK60 cylinder head. A redesigned exhaust gas temperature sensor has led to the exhaust gas temperature sensor port being relocated in the cylinder head. The cylinder head casting has been improved to provide greater resistance to cracking, the casting change can **not** be seen from a visual inspection. The new cylinder head supersedes the existing cylinder head. A new valve rotator has been released for the QSK45 and QSK60 cylinder head, the new valve rotator is a direct replacement for the original.

The original exhaust gas temperature sensor port was located in the top of the cylinder head exhaust port, the new exhaust gas temperature sensor port is located in the side of the exhaust port. The new cylinder head has both the old and new exhaust gas temperature sensor locations and can be fitted to existing engines.

It is **not** possible to fit an old cylinder head to a new engine, as there is no port for the exhaust gas temperature sensor.


Figure 1 shows the old type valve rotator, figure 2 shows the new type rotator.

Description	Old Part Number	New Part Number
Cylinder Head	4100537	4086077
Valve Rotator	3085961	4086649

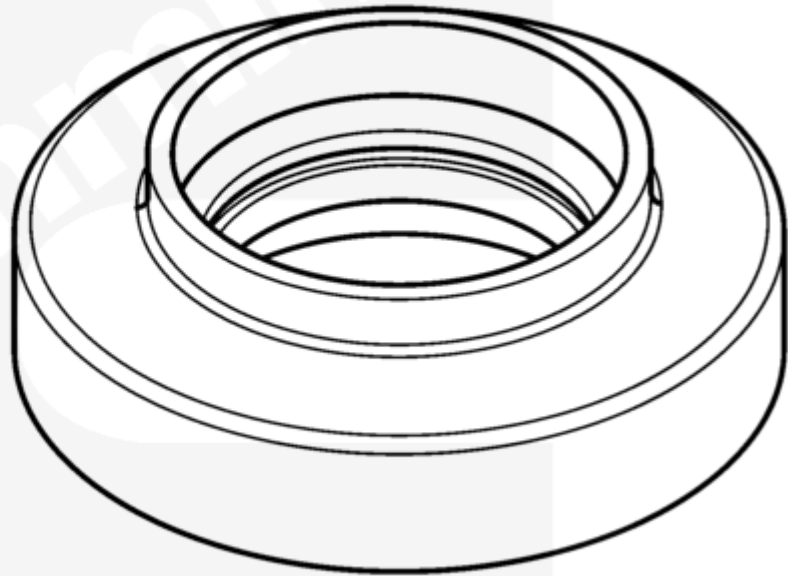

02600052

Figure 1 Old Type Valve Rotator.

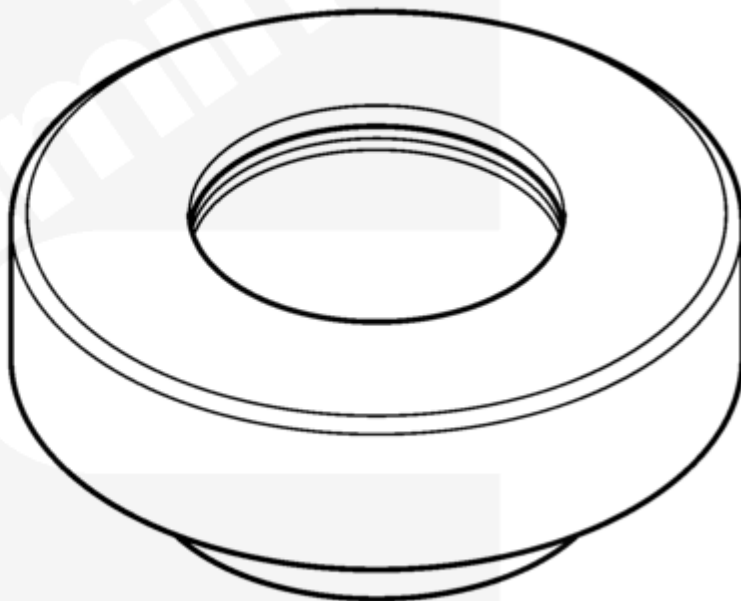

02600053

Figure 2 New Type Valve Rotator.

The new cylinder head went into production at the Daventry Engine Plant with Engine Serial Number first of 33153085.

Note : This is a product improvement, not subject to campaign.

