



Technical Service Bulletin

Technical Service Bulletin: tsb100289

Released Date: 22-Jul-2004

New Front Gear Housing

New Front Gear Housing

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin introduces new front gear housings for QSK45/60 series engines and QSK78 series engines.

The new design of the QSK45/60 engine front gear housing (Figure 1) incorporates increased bolt hole counterbore fillet radius and two additional strengthening ribs (1).

Engine Serial Number first was 33155621, built 13th January 2004.

The old QSK45/60 gear housing Part Number, 4016512 has been made obsolete and supersedes to the new gear housing Part Number, 3635814.

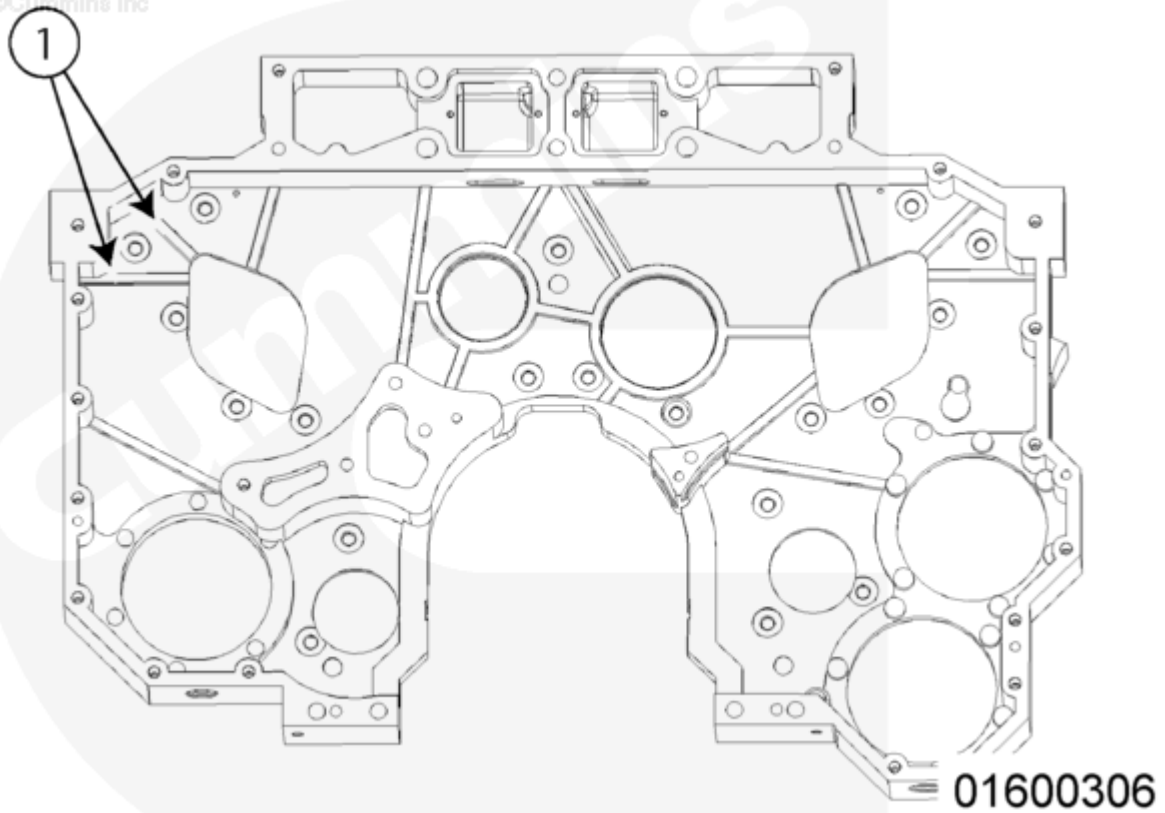


Figure 1, New QSK45/60 Front Gear Housing

The new design of the QSK78 engine front gear housing (Figure 2) incorporates increased bolt hole counterbore fillet radius, two additional strengthening ribs (1) and increased thickness on thirteen bolt holes (2) from 5.0 mm (0.197 in.) to 8.0 mm (0.315 in.).

Engine Serial Number first was 66300472 built 14th June 2004.

The old QSK78 gear housing Part Number, 4007357 has been made obsolete and supersedes to the new gear housing Part Number, 3636085.

Note : This is a product improvement and not subject to campaign.

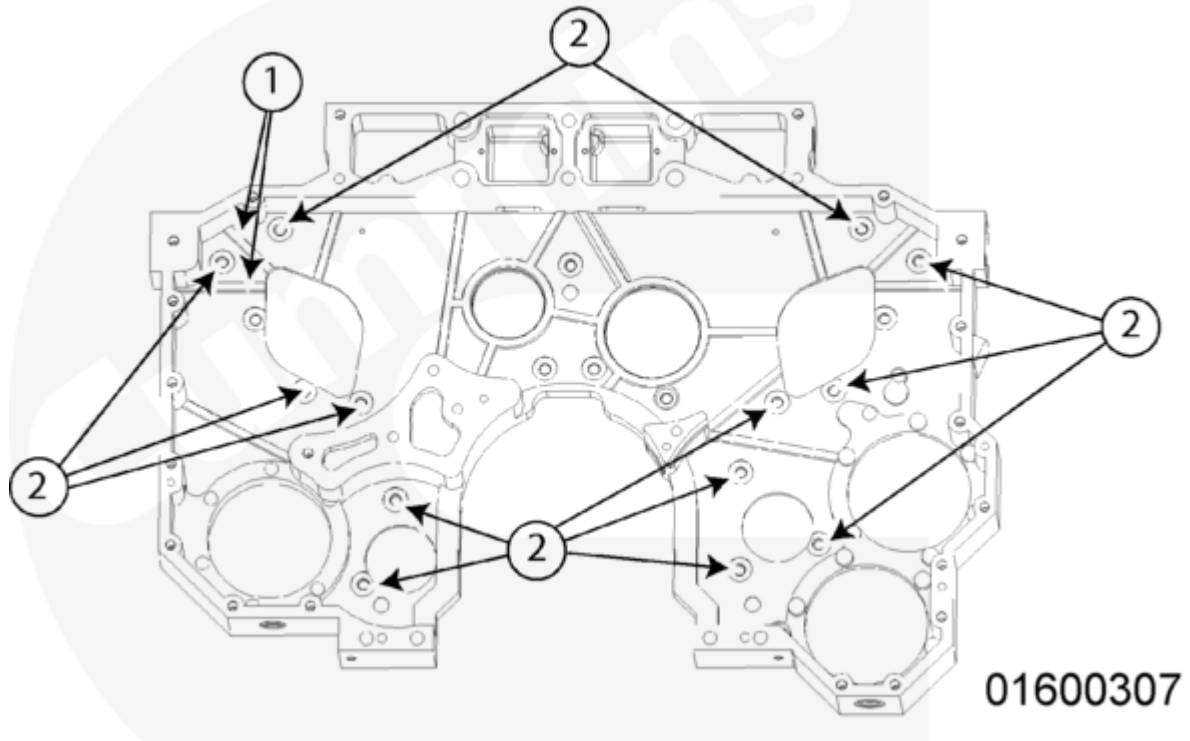


Figure 2, New QSK78 Front Gear Housing