



Technical Service Bulletin

Technical Service Bulletin: tsb100290

Released Date: 22-Jul-2004

New Front Engine Support Bushing

New Front Engine Support Bushing

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin is to inform the field of a product change for QSK45, QSK60 single stage and QSK60 two stage, front engine support bushing.


The purpose of this change was to eliminate possible interference issues with the front cover radius when the bushing was installed.

- New Part Number: 4101322
- Old Part Number: 4065741

Due to this change the installation tolerances have also changed when installing the bushing to the front cover.

Press the bushing (item A, Figure 1) until it is flush to 1.0 mm [0.040 in] MAX the surface (B, Figure 1).

The engine serial number first for the change was 33153409.

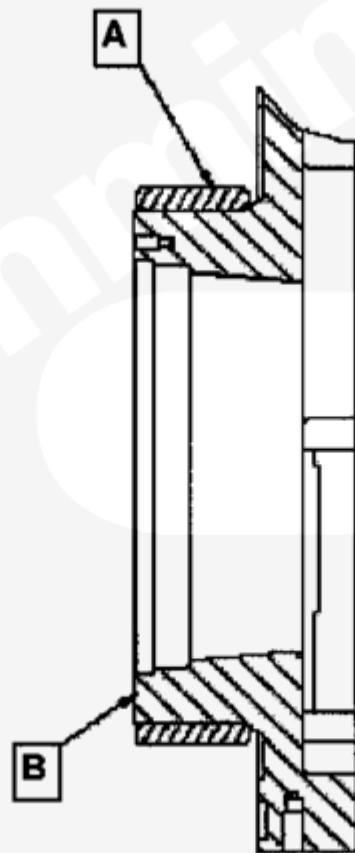

16600022

Figure 1

Note : This is a product improvement and is **not** subject to campaign.