



Technical Service Bulletin

Technical Service Bulletin: tsb100298

Released Date: 30-Aug-2004

New Connecting Rod Bearings

New Connecting Rod Bearings

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Service/Parts Announcement introduces new connecting rod bearings.

The affected applications are all QSK45 and QSK60 engines made on or after June 30, 2003, with approximate engine serial number first 33154283.

Note : This is a product improvement and is not subject to campaign.

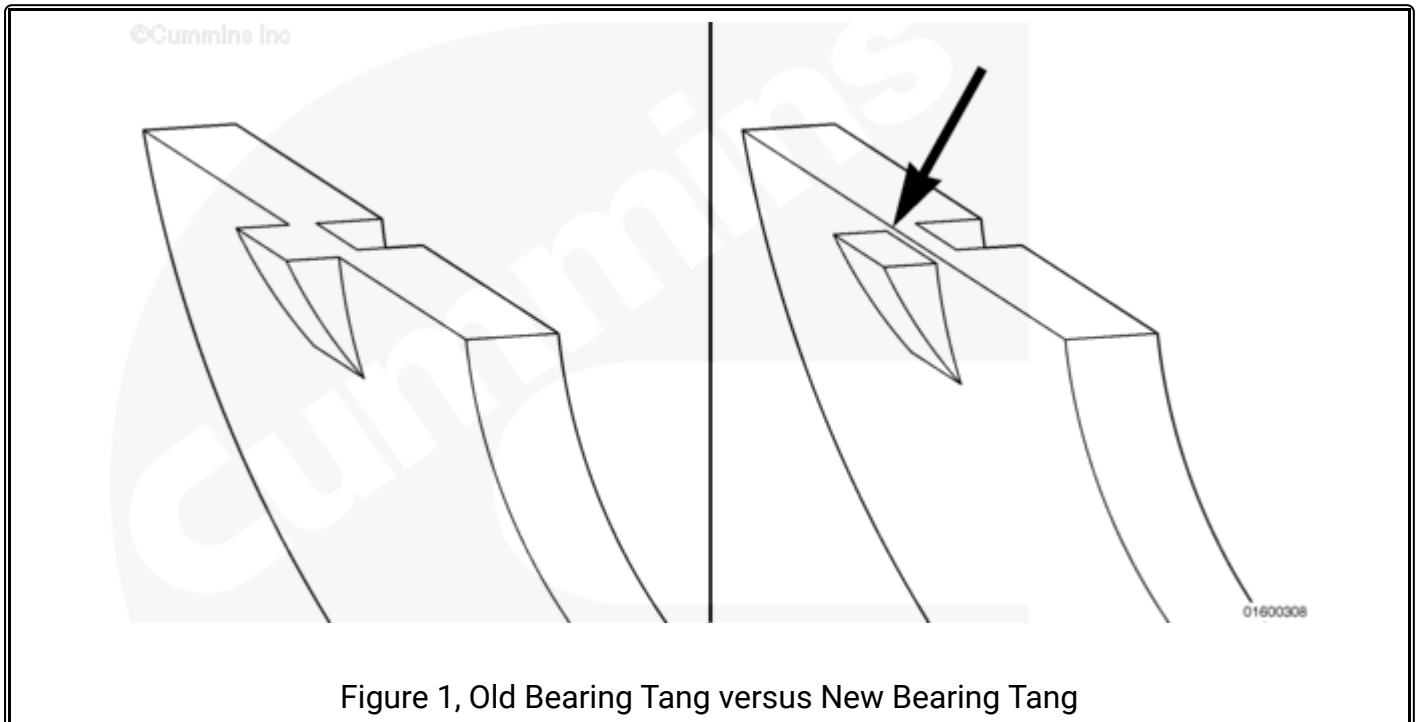


Figure 1, Old Bearing Tang versus New Bearing Tang

In order to increase the serration surface area on the new connecting rod, Part Number 3635125 and Part Number 3635126, the rod bearing tang had to be modified to eliminate the interference with the added serrated area. The new rod bearing features a 'drop notch' tang, that is cut slightly shorter than the edge of the bearing shell, in order to clear the serrations without interference.

The new connecting rod bearings are fully compatible with the new connecting rods, Part Number 3635125 and Part Number 3635126, and with the old connecting rods, Part Number 3171060 and Part Number 3171061. No stock of the old connecting rod bearing is left in factory production as of July, 2004. Please replace all entries of the old connecting rod bearing part numbers with the new part numbers on hard copies of the QSK45 and QSK60 Parts Catalogs, per the following table.

Table 1, New and Old Connecting Rod Bearings					
Size	Standard	.25 mm [.01 in] Undersize	.50 mm [.02 in] Undersize	.75 mm [.03 in] Undersize	1.00 mm [.04 in] Undersize
Old Rod Bearing	3089872	3089873	3089874	3089875	3089876
New Rod Bearing	4100932	4100935	4100936	4100937	4100938