



Technical Service Bulletin

Technical Service Bulletin: tsb100465

Released Date: 28-Apr-2006

Lubricating Oil Centrifuge Modification

Lubricating Oil Centrifuge Modification

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin details a modification carried out on the lubricating oil centrifuge (Fleetguard® Part Numbers 389497500S, CH4410500 and CH4412000), fitted on some QSK60 Construction series engines. To resolve an issue of high pressure spikes within the centrifuge and subsequent rotor cracking, the balance notch on the rotor turbine has been modified to include a radius which will lower the stresses and eliminate the cracking.

The modified rotor centrifuge was first fitted to engines in Daventry engine plant in November 2005, ESN 1st 33162018.


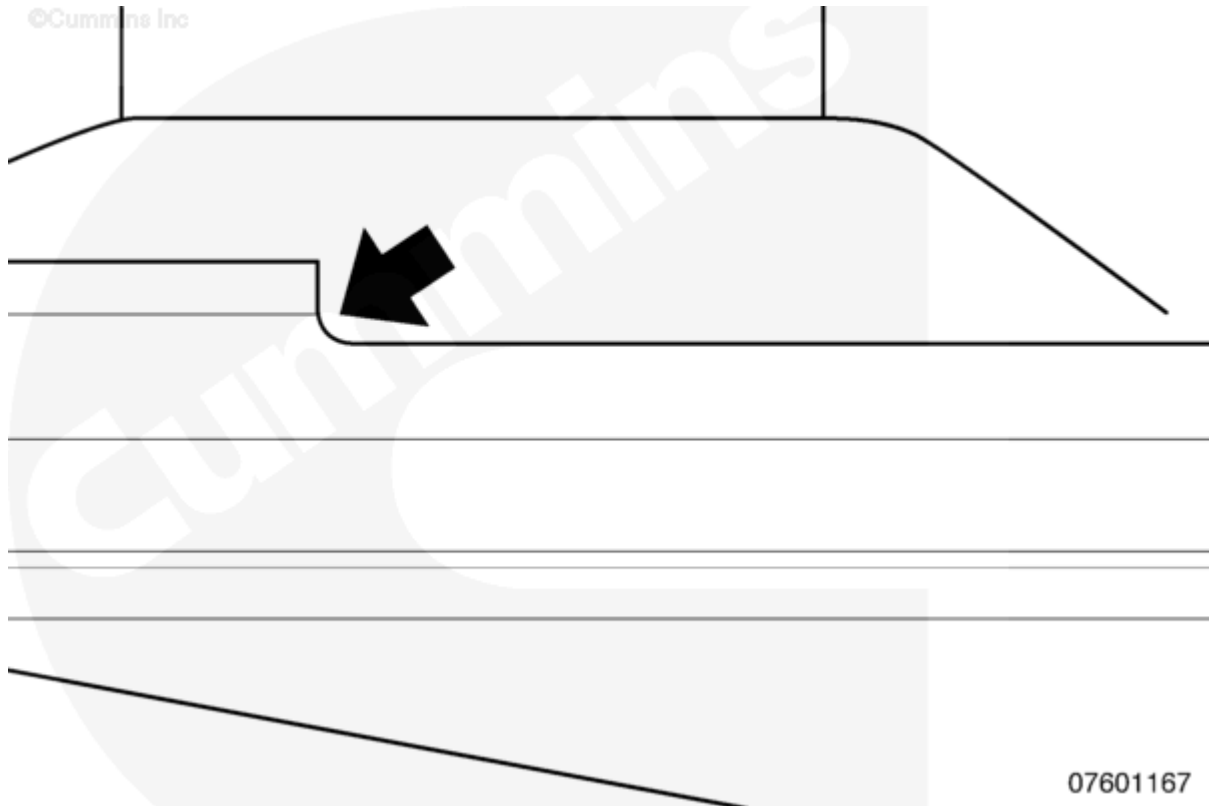



Fig 1. New Radius on Balancing Notch.

No part number change was required. Fleetguard® have marked all the present stock of modified rotor assemblies with a white line on the outside of the turbine can, as well as a white check mark on the bottom of the centrifuge.

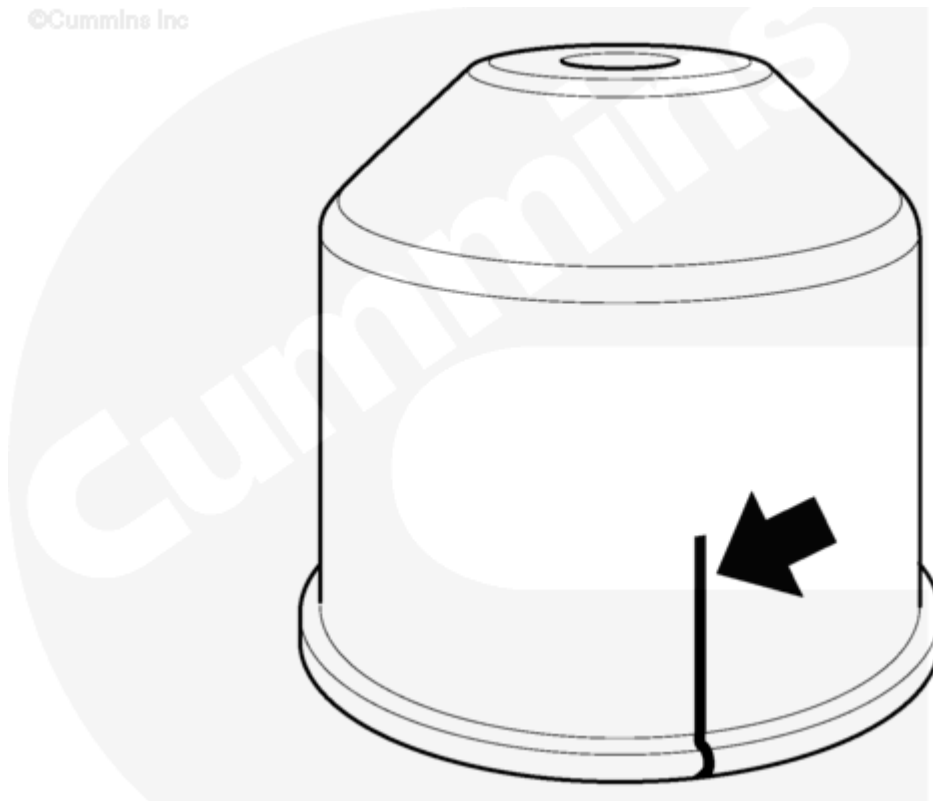

07601168

Fig. 2

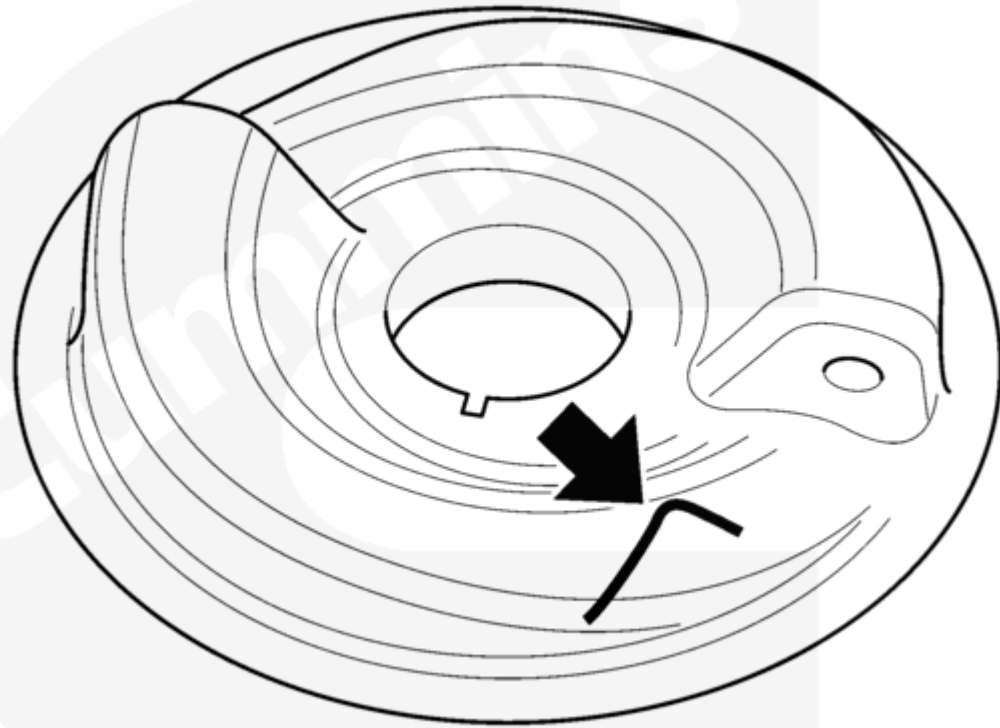

07601169

Fig. 3

Fig. 2 and Fig. 3 show markings on modified centrifuge.

Note : This is a product improvement, not subject to campaign.