



Technical Service Bulletin

Technical Service Bulletin: tsb100466

Released Date: 28-Apr-2006

Lubricating Oil Pump Idler Gear Assembly Kit

Lubricating Oil Pump Idler Gear Assembly Kit

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

The purpose of this Service/Part Topic is to remind the field of the availability of a service kit for the replacement of the idler gear assembly on QSK45, QSK60 and QSK78 engine lubricating oil pumps.


It is important that people at the service and repair facilities are aware of this kit, since it is critical that these lubricating oil pump components are always in perfect operating condition. By design, this gear is lubricated by unfiltered engine oil, so it is therefore extremely susceptible to damage caused by metallic debris in the engine lubricating oil. Damage sustained to the components is likely to eventually lead to a complete failure of this mechanism and, consequently, to a total loss in lubricating oil pressure causing major engine damage.

Following any failure, by which the lubricating oil has possibly become contaminated with any form of metallic debris, the idler shaft and gear **must** be carefully inspected for the presence of any damage. If any damage is found, the component **must** be replaced.

The idler shaft, gear and thrust bearings are contained in the service kit.

Lubrication Oil Pump Idler Kit, Part No. 4066547

Ref. No.	Description	Qty.
1	Stub shaft subassembly	1
2	Bearing, thrust	2
3	Idler gear subassembly	1

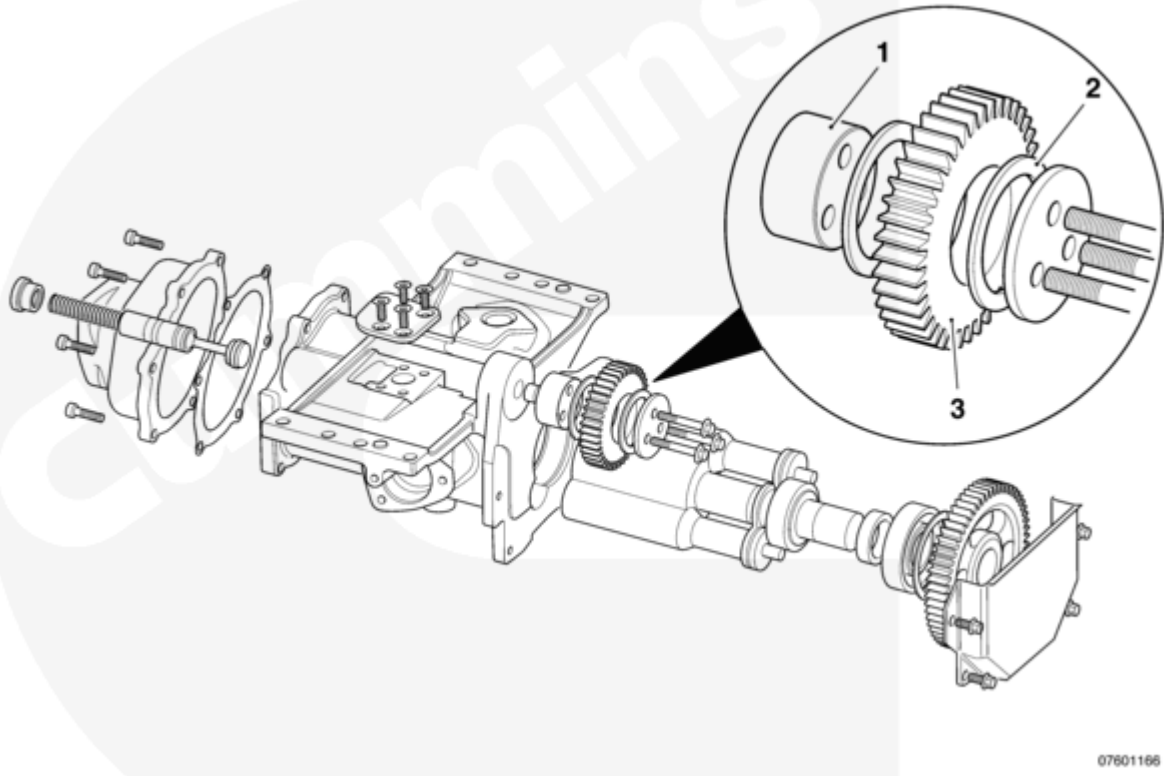

07601166

Note : This is a product improvement, not subject to campaign.