



Technical Service Bulletin

Technical Service Bulletin: tsb100482

Released Date: 09-Aug-2006

New Lubricating Oil Pump with Integrated Pressure Relief Valve

New Lubricating Oil Pump with Integrated Pressure Relief Valve


Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin introduces a redesigned lubricating oil pump with an integrated pressure relief valve.

©Cummins Inc

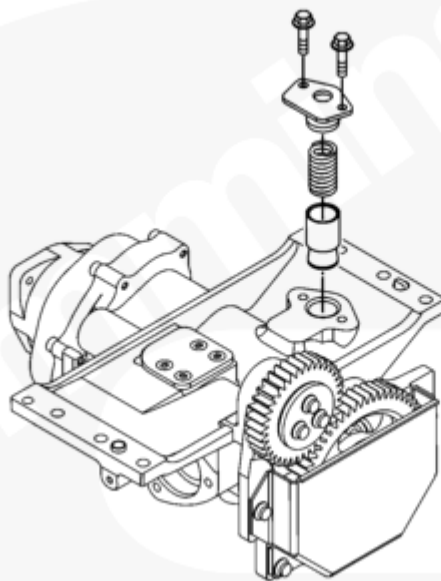

17601177

This new lubricating oil pump will reduce oil pressure spikes during cold weather start up.

When a lubricating oil pump is replaced in the field, the new lubricating oil pump with the integrated pressure relief valve **must** be used. A temporary repair practice (TRP) will soon authorize the field to install the new lubricating oil pump when an oil filter failure occurs.

The new lubricating oil pumps, obsoletes and supersedes **all** of the old lubricating oil pumps. The remaining inventories of the old lubricating oil pumps have been scrapped.

Table 1, Old and New Lubricating Oil Pump Part Numbers			
Engine	New Part Number	Old Part Number	Description
QSK45	3638986	4100710	Lubrication oil pump
QSK60	3638987	4100711	Lubrication oil pump

The new lubricating oil pump with the integrated pressure relief valve is in production. The production dates and the engine serial number (ESN) first are listed below.

Table 2, Production Dates and Engine Serial Numbers		
Engine	Production Dates	Engine Serial Number First
QSK45	May 15, 2006	33164296
QSK60	May 15, 2006	33164290

Note : This is a product improvement and not subject to campaign.