



Technical Service Bulletin

Technical Service Bulletin: tsb100512

Released Date: 27-Sep-2006

New LTA Water Pump

New LTA Water Pump

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.


Contents

This Service Parts/Topic announces the introduction of a revised LTA water pump, Part Number 3638083, and the changes that have been included.

The improvements included a change from greased bearings to oil fed bearings, which has increased lubrication. The oil feed is taken from the side of the gear cover.

Additional changes included improved water and oil seals, increased pump body strength, and the introduction of a discharge cavitation plate to prevent cavitation damage to the pump body.


The older style and revised LTA water pumps look similar in appearance, due to the main developments occurring internally.

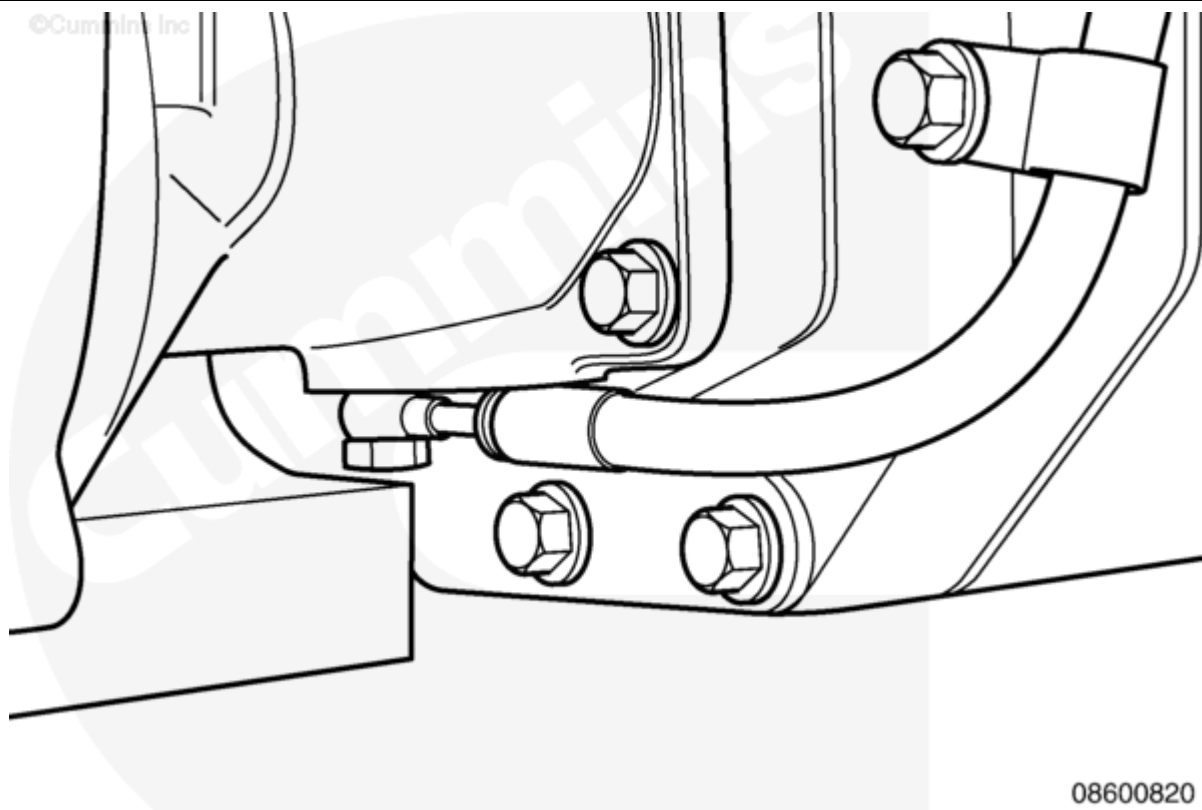

08600820

New Oil Feed, Part Number 3638095, (with new banjo type connector)

The strength of the pump body has been improved by adding a stiffening rib, as shown in the diagram below, and the introduction of a one-piece pump body.

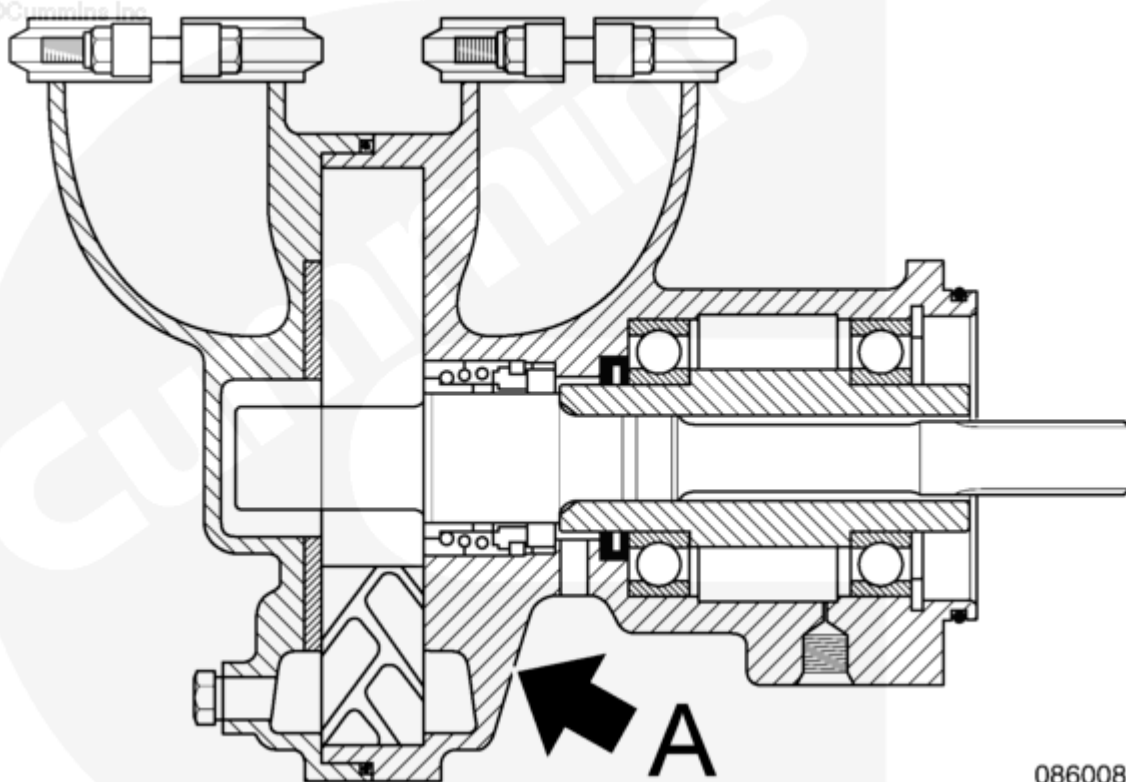

08600821

The stiffening rib is shown, marked A.

The part number for the revised LTA water pump is as follows:

Old Water Pump Part Number	Revised Water Pump Part Number	
3636850	3638083	
The effective date of production was 7th August 2006, ESN 1st 33165335. If a new water pump (Part Number 3638083) is to be fitted in place of an old water pump (Part Number 3636850), the following parts will be required:		
Part Number	Quantity	Description
3638095	1	Hose, Flexible
3963982	2	Washer, Sealing
68152	2	Clip
3682701	1	Elbow, Male Union
3638094	1	Screw, Banjo Connection
Note : This is a product improvement not subject to campaign.		