



Technical Service Bulletin

Technical Service Bulletin: tsb100555

Released Date: 30-Jan-2007

Modified Lubrication Oil Centrifuge

Modified Lubrication Oil Centrifuge

Warranty Statement


The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Note : This Technical Service Bulletin supersedes topic 06T7-11. Replace 06T7-11 with this topic.

This Technical Service Bulletin describes a modification carried out on the lubrication oil centrifuge, Fleetguard Part Numbers 389497500S, CH4410500, and CH4412000, fitted to some QSK60 Construction series engines. This modification resolves an issue of high oil pressure spikes within the centrifuge and subsequent rotor cracking. The balancing notch on the rotor turbine has been modified to include a radius which lowers the stresses and eliminates the cracking. The centrifuge oil supply **must** be tapped after the full-flow lubrication filter(s) (clean side) to eliminate potential issues of high oil pressure spikes, which can be detrimental to centrifuge performance.

The modified rotor centrifuge was first fitted to engines in the Daventry engine plant in November 2005, with ESN First 33162018.


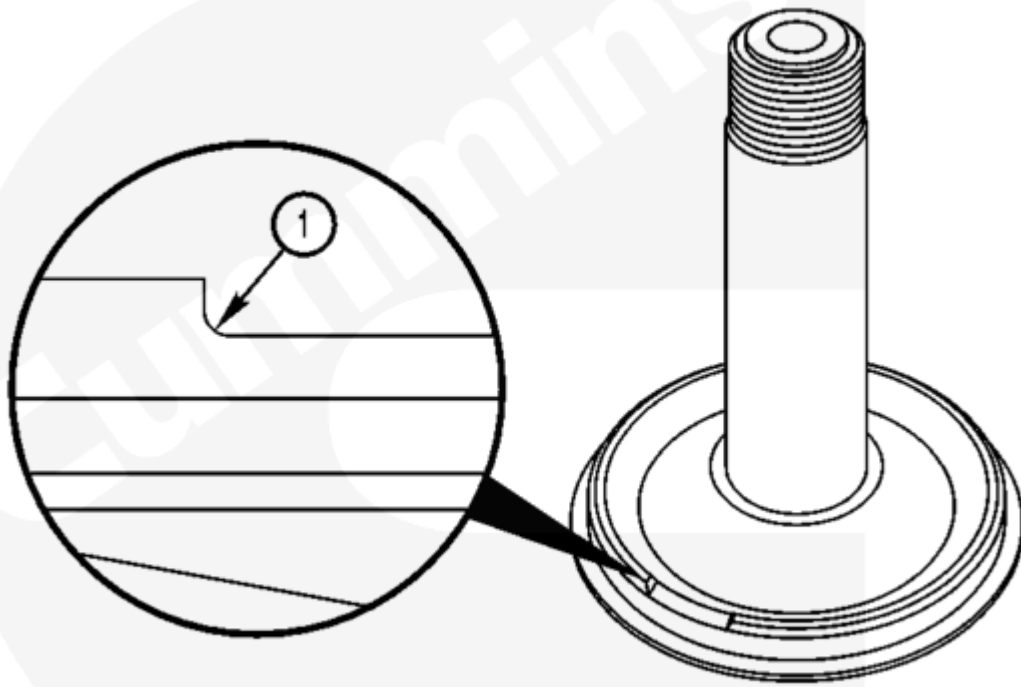


07601198

New Radius on Rotor Balancing Notch

1. Radius.

No part number change was required. Fleetguard® have marked the modified rotor assemblies with a white line on the outside of the turbine can as well as a white check mark on the bottom of the centrifuge.

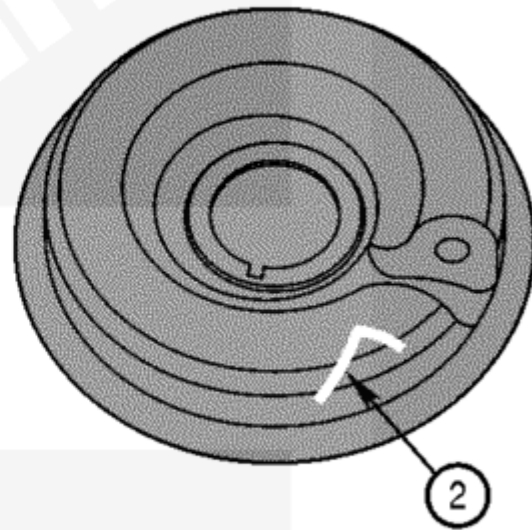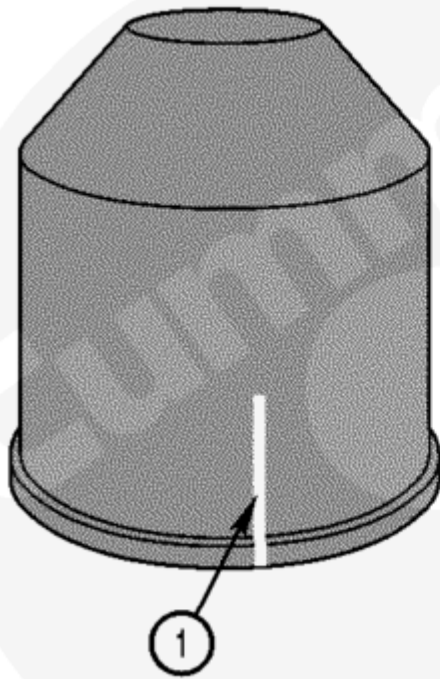

07601199

Modified Lubrication Oil Centrifuge

1. White line on outside of turbine
2. White check mark on bottom of centrifuge.

Note : This is a product improvement and not subject to a campaign.