



Technical Service Bulletin

Technical Service Bulletin: tsb100645

Released Date: 13-Nov-2007

Revised Fan Drive Idler Arm Assembly

Revised Fan Drive Idler Arm Assembly

Warranty Statement


The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This purpose of This Technical Service Bulletin is to introduce a revised the fan drive idler arm assembly for the QSK60, WA1200 fan option FA6236. The revised design will improve fan hub reliability and durability.

The revised fan drive idler arm went into production in August 2007 at the Daventry Engine Plant. Engine serial number first was 33170187.

©Cummins Inc

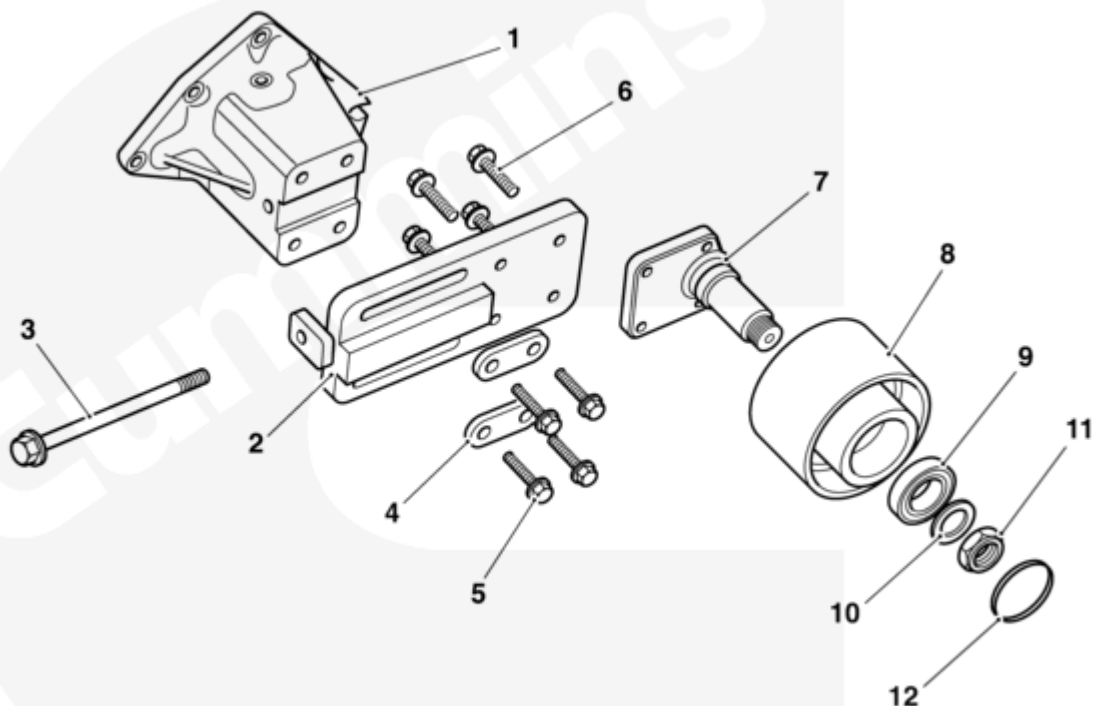

08600775

Item Number	Part Description	Part Number	Quantity
1	Idler Pulley Bracket	3640028	1

2	Adjusting Bracket	3636278	1
3	Adjusting Screw	4101288	1
4	Mounting Spacer	4101256	2
5	Capscrew	4001226	4
6	Capscrew	206391	4
7	Fan Hub Shaft	3637488	1
8	Idler Pulley	3640030	1
-	Oil Seal	3048625	1
9	Roller Bearing	3048626	2
-	Bearing Spacer 26.56 mm [1.0457 in]	3637489	1
-	Bearing Spacer 26.69 mm [1.0507 in]	3640390	1
-	Bearing Spacer 26.82 mm [1.0557 in]	3640391	1
-	Bearing Spacer 26.94 mm [1.0607 in]	3640392	1
-	Bearing Spacer 27.07 mm [1.0657 in]	3640439	1
10	Washer	205168	1
11	Nut, Lock	206506	1
12	Expansion Plug	4101292	1