



Technical Service Bulletin

Technical Service Bulletin: tsb100686

Released Date: 04-Apr-2008

New Straight Split Connecting Rods


New Straight Split Connecting Rods

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin announces a new connecting rod for use on QSK45 and QSK60 diesel engines.

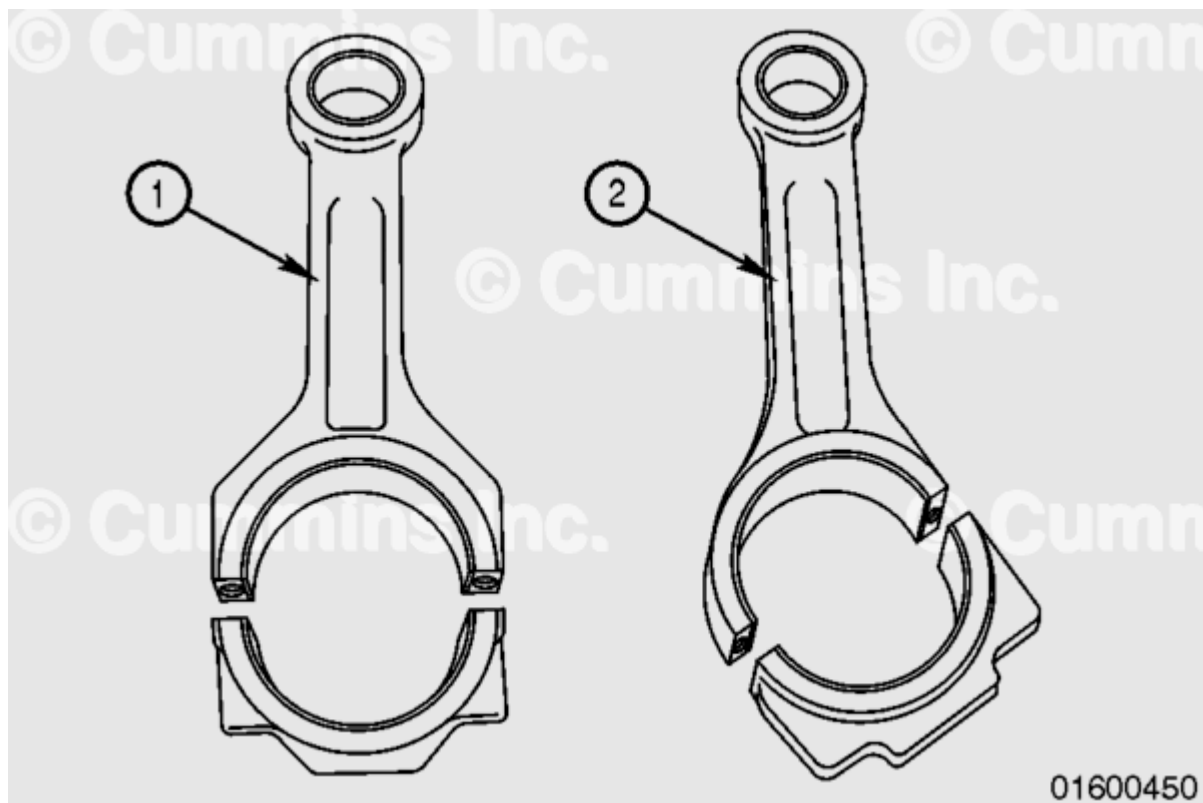

The new connecting rod has changed from an angle split (2) to a straight split (1) bolted joint connection. See the illustration above. The change was introduced to increase the durability of the connecting rod. Straight split (1) and angle split (2) connecting rods can **not** be mixed within an engine. All connecting rods **must** be the same.

The new straight split connecting rod went into partial production at Daventry engine plant on 21 November 2007, and full production on 10 March 2008. Engine serial number (ESN) first for full production is 33172847. Engines with the following ESN's were built with the new straight split connecting rod between 21 November 2007 and 10 March 2008:

Engines with New Straight Split Connecting Rod Built Between 21 November 2007 and 10 March 2008						
33171075	33171928	33172092	33172242	33172427	33172569	33172619
33171266	33171929	33172110	33172257	33172428	33172570	33172620
33171522	33171930	33172111	33172342	33172459	33172598	33172621
33171528	33171939	33172145	33172343	33172505	33172614	33172622
33171822	33172076	33172173	33172344	33172506	33172615	33172664
33171840	33172077	33172174	33172372	33172513	33172616	33172742
33171873	33172078	33172213	33172395	33172518	33172617	33172743
33171875	33172091	33172214	33172426	33172568	33172618	33172764

Straight split connecting rods can **only** be used with new-style piston cooling nozzles and cylinder blocks which contain the new casting changes, or have been modified. Cylinder blocks built prior to 22 January 2008 and ESN first 33172060 require machining to allow for the new hardware. Contact an Cummins® Authorized Repair Distributor for further assistance with cylinder block machining requirements.

New Straight Split Connecting Rod Parts	
Description	Part Number
Connecting Rod	3640518
Connecting Rod (Marine Certified)	3640519
Connecting Rod Bearing (Standard)	3640763
Connecting Rod Bearing (0.25 mm undersize)	3640764
Connecting Rod Bearing (0.50 mm undersize)	3640765
Connecting Rod Bearing (0.75 mm undersize)	3640766
Connecting Rod Bearing (1.00 mm undersize)	3640767

For more information on the differences between straight split and angle split connecting rods, refer to Procedure 001-014 (Connecting Rod) in Section 1 of the Service Manual, QSK45 and QSK60, Bulletin 4021530. (</qs3/pubsys2/xml/en/procedures/56/56-001-014.html>)

Last Modified: 04-Apr-2008
