



Technical Service Bulletin

Technical Service Bulletin: tsb101240

Released Date: 22-Jan-2003

Jacket Water Cooling Circuit Improvement

Jacket Water Cooling Circuit Improvement

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Service/Parts Topic announces an improvement to the jacket water cooling circuit on QSK60 engines with 2-stage turbocharging. The intent of the design change is to increase coolant flow around the right bank cylinder liner number 8, resulting in greater cooling and ultimately extended piston ring life. This is achieved with the addition of a loop in the cooling system which balances the coolant flow between the right bank cylinder number 1 and cylinder number 8.

This coolant loop is unique to QSK60 2-stage engines because the coolant supply for the intercoolers is located near the right bank cylinder number 8.

It is recommended that the right bank cylinder number 8 coolant loop is fitted at engine rebuild.

Item No.	Part Number	Description	Item No.	Part Number	Description
1	3902460	Screw, hex flange cap (x 10)	8	3043487	Clamp, hose (x 6)
2	68189	Clip (x 6)	9	4086840	Tube, water transfer (x 1)
3	3903990	Screw, hex flange cap (x 6)	10	4086839	Tube, water transfer (x 1)
4	S962E	Draincock (x 1)	11	4080549	Hose, plain (x 3)
5	62279	Spacer (x 1)	12	3093828	Hut, hexagonal (x 15)
6	4086842	Tube, water transfer (x 1)	13	4100455	Bracket, water bracket (x 5)

Item No.	Part Number	Description	Item No.	Part Number	Description
7	4086841	Tube, water transfer (x 1)	14	3028291	Seal, o-ring (1)

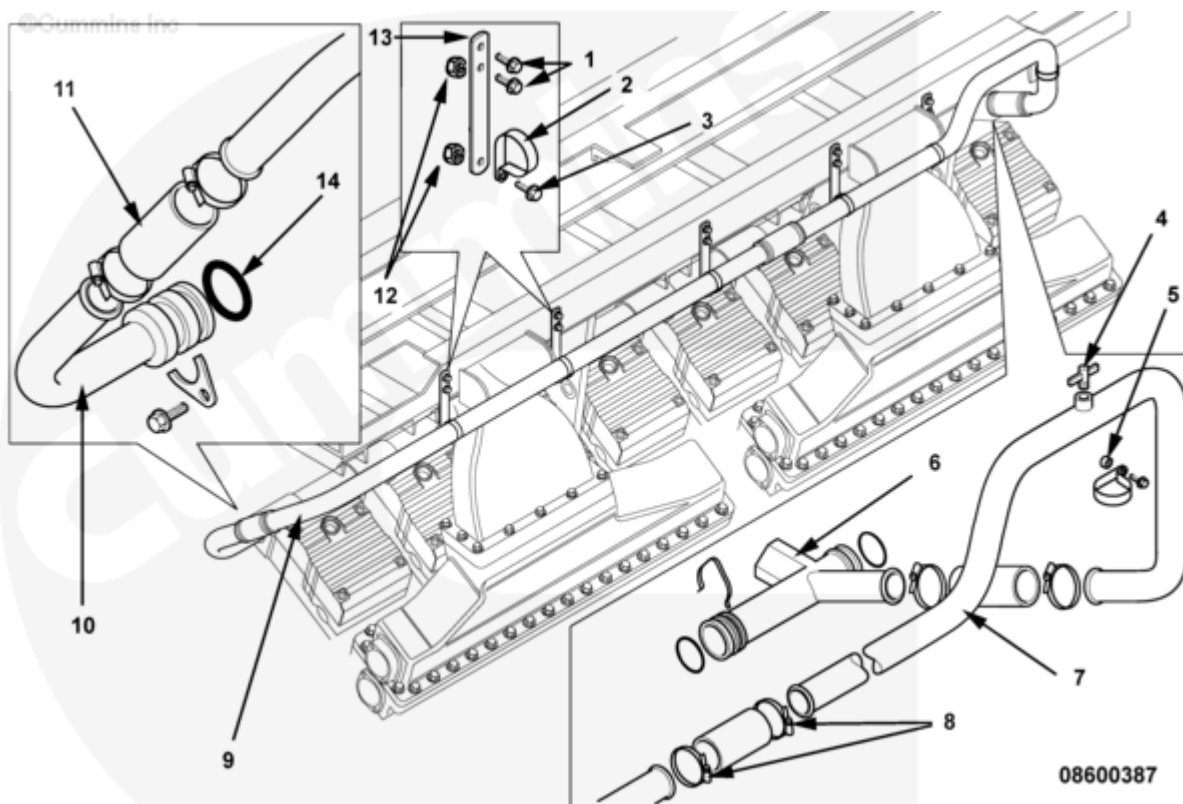


Figure 1, New Arrangement (Right Bank)

Note : This is a product improvement is is not subject to campaign.