



Technical Service Bulletin

Technical Service Bulletin: tsb101277

Released Date: 26-Aug-2003


New Oversize Head Gasket

New Oversize Head Gasket


Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

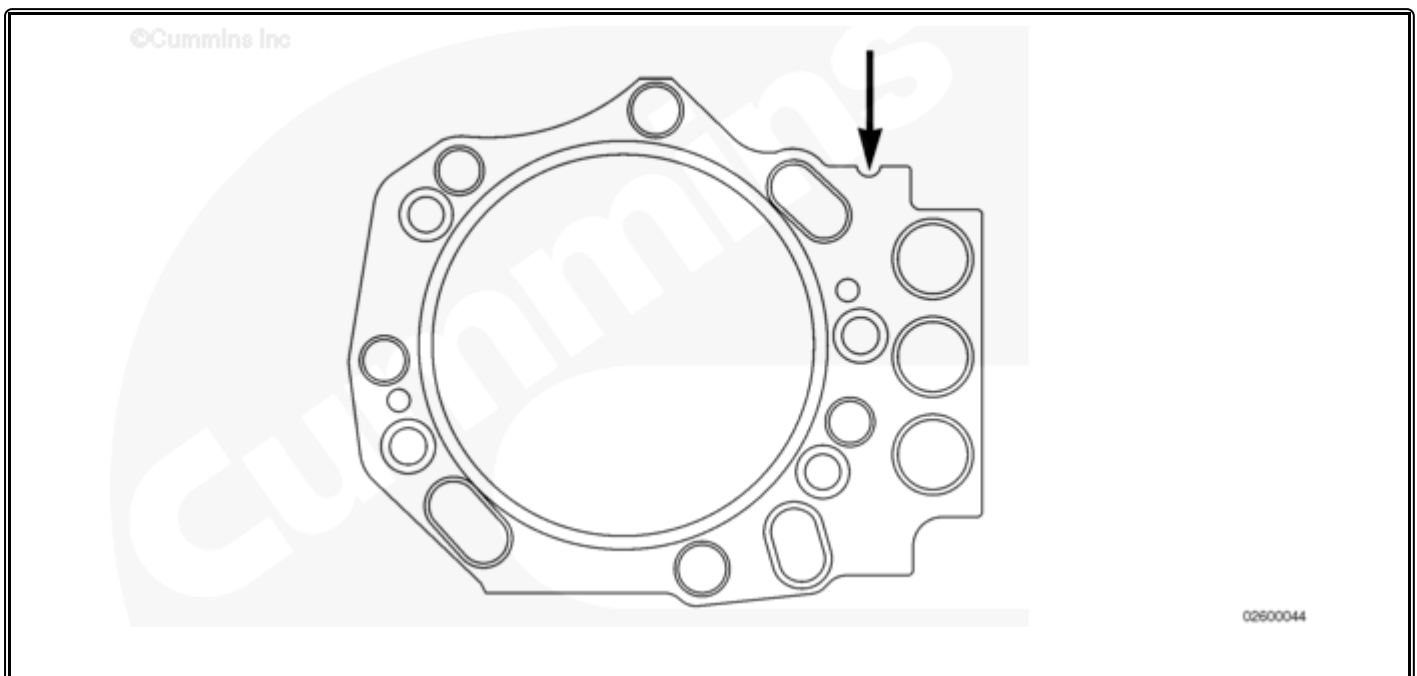

This service/parts topic introduces a new oversize head gasket and wear limits for the cylinder block head deck of the QSK45 and QSK60 engines. The new cylinder head gasket, Part Number 4086730, has been released to allow the repair of worn cylinder blocks at engine rebuild/overhaul. The new gasket makes use of the same material and form as the existing gasket but is 0.51 mm [0.020 in] thicker. The gasket has a notch in the carrier to denote the gasket is a service oversize gasket, see the illustration above.

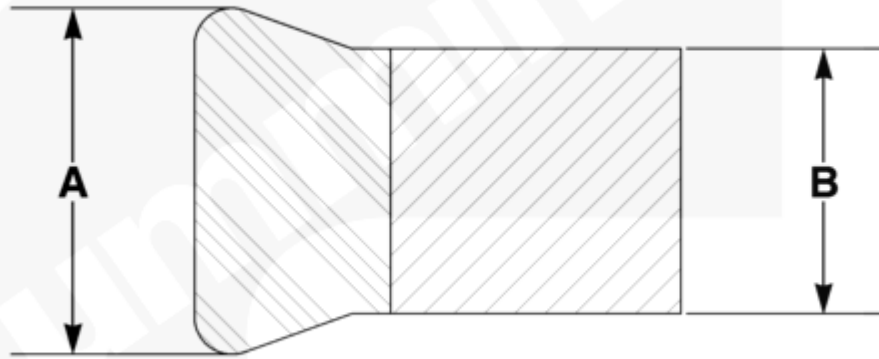

02600045

The illustration above shows the dimensions for the oversize gasket.

mm		in
3.12	MIN	0.123
3.48	MAX	0.137

mm		in
2.43	MIN	0.096
2.59	MAX	0.102

Cylinder block head decks wear due to several factors, some are listed below:

Dirt under the gasket

- In operation, fine particles of dirt can get under the head gasket where it becomes trapped. In operation, the cylinder head moves on the head gasket (very small amounts) and the gasket moves on the cylinder block. When dirt is trapped between the gasket and the block, motion frets the cylinder block surface.

Coolant leaks

- If coolant leaks from the head gasket, the counterbore, or leaks externally, corrosion can start. The cylinder head deck is eroded by corrosion and pitting .

Related Procedures

56-001-026
(/qs3/pubsys2/xml/en/procedures/56/56-001-026.html)

Cylinder Block
(/qs3/pubsys2/xml/en/procedures/56/56-001-026.html)

